Waste Tank Summary Report for Month Ending February 28, 1999

Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

FLUOR DANSEL HANFORD, INC.

Sichland, Washington

Hanford Management and Integration Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

Approved for Public Release; Further Dissemination Unlimited

LEGAL DISCLAIMER

This report was prepared as an account of work sponsored by an agency of the United States Government, Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, er any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Maference herein to any specific commercial product, process, or . service by trade name, trademark, manufacturer, or otherwise, dises not necessarily constitute or imply its endorsement, resommendation, or favoring by the United States Government or may agency thereof or its contractors or subcontractors. The wisws and opinions of authors expressed herein do not macessarily state or reflect those of the United States Government or any agency thereof.

While report has been reproduced from the best available copy.

Wintestim the United States of America

回路CLM-2.CHP (1-91)

Waste Tank Summary Report for Month Ending February 28, 1999

B. M. Hanlon Lockheed Martin Hanford Corp.

Date Published May 1999

Prepared for the U.S. Department of Energy Office of Environmental Restoration and Waste Management

FLUOR DANIEL HANFORD, INC.
P.O. Box 1000
Richland, Washington

Hanford Management and Integration Contractor for the U.S. Department of Energy under Contract DE-AC06-96RL13200

Approved for Public Release; Further Dissemination Unlimited

RELEASE AUTHORIZATION

Document Number:

HNF-EP-0182-131

Document Title:

WASTE TANK SUMMARY REPORT FOR MONTH ENDING FEBRUARY

28, 1999

This document, reviewed in accordance with DOE Order 241.1,
"Scientific and Technical Information Management," and 241.1-1,
"Guide to the Management of Scientific and Technical
Information," does not contain classified or sensitive unclassified information and is:

APPROVED FOR PUBLIC RELEASE

Mark A. Williams

Lockheed Martin Services, Inc. Document Control/Information Clearance

Reviewed for Applied Technology, Business Sensitive, Classified, Copyrighted, Export Controlled, Patent, Personal/Private, Proprietary, Protected CRADA, Trademark, Unclassified Controlled Nuclear Information.

LEGAL DISCLAIMER. This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, not any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof. This report has been reproduced from the best available copy. Printed in the United States of America.

APPROVALS

Prepared by:

Responsible Manager:

C. DeFigh-Price, Manager Process Engineering

This page intentionally left blank.

WASTE TANK SUMMARY REPORT

B. M. Hanlon

ABSTRACT

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 63 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U. S. Department of Energy-Richland Operations Office Order 5820.2A, Chapter I, Section 3.e. (3) (DOE_RL, 1990, Radioactive Waste Management, U. S. Department of Energy-Richland Operations Office, Richland, Washington) requiring the reporting of waste inventories and space utilization for Hanford Tank Farm tanks.

This page intentionally left blank.

CONTENTS

Pag	ţе
SUMMARY1	
I. WASTE TANK STATUS	
II. WASTE TANK INVESTIGATIONS	
III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS	
Appendixes:	
A. WASTE TANK SURVEILLANCE MONITORING TABLES	-1
1 Watch List Tanks	
3 Temperature Monitoring in Watch List Tanks	
4 Temperature Monitoring in Non-Watch List Tanks A-6	
5 Single-Shell Tanks Monitoring Compliance Status A-7	
6 Double-Shell Tanks Monitoring Compliance Status	
7 ENRAF Surface Level Gauge Installation and Data Input Methods	
8 Tank Monitor and Control System (TMACS) Monitoring Status	
B. DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION	·1
1 Double-Shell Tank Waste Type and Space Allocation B-2	
2 Double-Shell Tank Waste Inventory	
Figures:	
1 Total Double-Shell Tank Total Inventory	
C. TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS C-	1
1 Tank and Equipment Code/Status Definitions	٠Ţ
1 Tank and Equipment Code/Status Demittions	
D. TANK FARM CONFIGURATION, STATUS AND FACILITY CHARTS D- Figures:	-1
1 High-Level Waste Tank Configuration D-2	
2 Double-Shell Tank Instrumentation Configuration D-3	
3 Single-Shell Tank Instrumentation Configuration D-4	
E. MONTHLY SUMMARY E-	-1
1 Monthly Summary E-2	-
2 Tank Use Summary	
3 Pumping Record, and Liquid Status and Pumpable Liquid Remaining	
In Tanks	
4 Inventory Summary by Tank Farm E-5	
5 Inventory and Status by Tank - Double-Shell Tanks E-6	
6 Inventory and Status by Tank - Single-Shell Tanks E-8	
F. PERFORMANCE SUMMARY F.	-1
Table:	
1 Performance Summary F-2	
2 Summary of Waste Transactions in the Double-Shell Tanks F-4	
3 Comparison of Projected Versus Actual Waste Volumes for	
Hanford Facilities F-5	

G	. MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCI
	FACILITIES G-1
	Tables:
	1 Misc. Underground Storage Tanks and Special Surveillance Facilities (Active). G-2
	2 East Area Inactive Underground Storage Tanks and Special Surveillance
	Facilities (Inactive) G-3
	3 West Area Inactive Underground Storage Tanks and Special Surveillance
	Facilities (Inactive) G-4
ינו	TEAR WOLLDAR ESTIMATES
11.	LEAK VOLUME ESTIMATES H-1
	Table:
	1 Single-Shell Tank Leak Volume Estimates
I.	SINGLE-SHELL TANKS INTERIM STABILIZATION, AND CONTROLLED, CLEAN
	AND STABLE STATUS I-1
	Tables:
	1 Single-Shell Tanks Interim Stabilization Status I-2
	2 Tri-Party Agreement Single-Shell Tank Interim Stabilization
	Schedule I-5
J.	CHARACTERIZATION PROGRESS STATUS
	Figure:
	1 Characterization Progress Status
	· · · · · · · · · · · · · · · · · · ·

N	ETRIC CONV	ERSION CHART	
1 inch	2.54 centimeters		
1 foot	=	30.48 centimeters	
l gallon	=	3.80 liters	
1 ton	-	0.90 metric tons	

$$^{\circ}\mathbf{F} = \left(\frac{9}{5} \,^{\circ}\mathbf{C}\right) + 32$$

1 Btu/h = 2.930711 E-01 watts (International Table)

WASTE TANK SUMMARY REPORT FOR MONTH ENDING FEBRUARY 28, 1999

Note: Changes from the previous month are in bold print.

I. WASTE TANK STATUS

Category	Quantity	Date of Last Change
Double-Shell Tanks ^c	28 double-shell	10/86
Single-Shell Tanks	149 single-shell	1966 ^d
Assumed Leaker Tanks	67 single-shell	7/93
Sound Tanks	28 double-shell 82 single-shell	1986 7/93
Interim Stabilized Tanks ^b	119 single-shell	11/97
Not Interim Stabilized *	30 single-shell	11/97
Intrusion Prevention Completed	108 single-shell	09/96
Controlled, Clean, and Stableh	36 single-shell	09/96
Watch List Tanks ^f	22 single-shell 6 double-shell	12/98 ⁸ 6/93
Total	28 tanks	,

^a All 149 single-shell tanks were removed from service (i.e., no longer authorized to receive waste) as of November 21, 1980.

II. WASTE TANK INVESTIGATIONS

This section includes all single- or double-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

^b Of the 119 tanks classified as Interim Stabilized, 64 are listed as Assumed Leakers. The total of 119 Interim Stabilized tanks includes one tank that does not meet current established supernatant and interstitial liquid stabilization criteria. (See Table I-1 footnotes, item #2)

^c Six double-shell tanks are currently included on the Hydrogen Watch List and are thus prohibited from receiving waste in accordance with "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the *National Defense Authorization Act for Fiscal Year 1991*, November 5, 1990, Public Law 101-510.

Last date the single-shell tanks went into service (Tank Farm AX).

^{*} Three of these tanks are Assumed Leakers (BY-105, BY-106, SX-104). (See Table H-1)

See Section A tables for more information on Watch List Tanks.

² Dates for the Watch List tanks are "officially added to or removed from the Watch List" dates. Eighteen tanks were removed from the Organics Watch List in December 1998; two tanks still remain on this watch list. See Table A-1, Watch List Tanks, for further information.)

h The TY tank farm was officially declared Controlled, Clean, and Stable in March 1996. The TX tank farm and BX tank farms were declared CCS in September 1996. (BX-103 has been declared to have met current interim stabilization criteria, and is included in CCS - see also Appendix I).

<u>Tank 241-B-111:</u> The interstitial level dropped about 1.5 inches at the end of September 1998 (-3 standard deviations from the baseline which exceeded the criteria established for this tank). The tank has been under investigation as a possible leaker since but the data is inclusive. A small localized gas release would provide the same response, and the expert panel indicated that both a leak and a small gas release were of similar probability as a mechanism for the level drop. The level has not decreased further since October 1998, and the tank now appears stable.

Resolution Status: The tank continues to be monitored to collect and evaluate data. See also Off-Normal Occurrence Report (item #7) below.

A. Assumed Leakers or Assumed Re-leakers: (See Appendix C for definition of "Re-leaker")

This section includes all single- or double-shell tanks or catch tanks for which an off-normal or unusual occurrence report has been issued, or for which a waste tank investigation is in progress, for assumed leaks or re-leaks. Tanks/catch tanks will remain on this list until either a) completion of Interim Stabilization, b) the updated occurrence report indicates that the tank/catch tank is not an assumed leaker, or c) the investigation is completed.

There are currently no tanks for which an off-normal or unusual occurrence report has been issued for assumed leaks or re-leaks.

B. Tanks with increases indicating possible intrusions:

This section includes all single-shell tanks and related receiver tanks for which the surveillance data show that the surface level or ILL has met or exceeded the increase criteria, or are still being investigated.

<u>Candidate Intrusion List:</u> Increase criteria in the following tanks indicate possible intrusions. Higher priority safety work on Tank SY-101 has taken precedence over these investigations.

Tank 241-B-202
Tank 241-BX-101
Tank 241-BX-103
Tank 241-BY-103
Tank 241-C-101
Tank 241-U-111

244-AR Tanks and Sumps: Currently, all ventilation systems at 244-AR are shut down. Based on the weight factor gauges for the sumps and tanks, Tank 001 contains 1,300 gallons, Tank 002 contains 12,250 gallons, Tank 003 contains 2,000 gallons, and Tank 004 contains 250 gallons. Sump 001 contains 15.5 gallons, Sump 002 contains 0-2 gallons, and Sump 003 contains 3,300 gallons. There was no change in tank/sump contents as of December 31, 1998. Status of jet pumping: first attempts at jetting in December 1997 were unsuccessful. There has been no funding available for jet pumping of these tanks and sumps since that time.

Catch Tank 241-A-417: The weight factor readings (WTF) have fluctuated between 39.00 inches and 41.00 inches since the tank was pumped in April 1998. The day and night readings can vary by an inch. Both readings on January 31, 1999 were at 37.00 inches, which exceed the 1.00-inch decrease criteria from the baseline.

Resolution Status: Discrepancy Report 99-860 was closed on February 10, 1999; readings were constant at 40.00 inches. Reasons for different previous readings: parallax view of instrument, accuracy of the gradients on the chart, air compressor loading and unloading, and air compressor pressure. Catch tank 241-A-417 will no longer appear in this report.

Catch Tank 241-AX-152: The liquid level in this catch tank was steady around 66.75 inches from the startup of Project W-030, Tank Farm Ventilation System," in March 1998 until late August 1998. The level then began to decrease. The October 1998 reading of 65 inches is 1.75 inches below the summer average. This is an active catch tank, routinely pumped, and deviations from baseline are not applicable per OSD-31. The decrease represents a significant change in trend and it is apparent that tank conditions changed around the end of August 1998.

Resolution Status: Discrepancy Report #98-853 was issued on November 4, 1998. One possible cause under investigation is a change in flow path, causing an increase in evaporation. The tank was pumped down to 2.25 inches on November 13, 1998. Since that time the level has decreased to 0.00 inches. The Discrepancy Report will remain open and the tank will remain on the alert list until an engineering investigation is complete.

III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

1. Single-Shell Tanks Saltwell Jet Pumping (See Table E-6 footnotes for further information)

<u>Tank 241-C-106</u> – Waste removal operations were initiated on November 18, 1998. Commencement of sluicing (sludge removal) began the process of waste removal in the highest heat-generating single-shell storage tank. Wastes from C-106 will be pumped underground through a new specially constructed pipeline to AY-102. The ventilation system for AY-102 is designed for the anticipated heat load of the waste from C-106.

Through mid-December 1998, sluicing of tank C-106 was on hold for evaluation of stack gaseous emissions that occurred during the first sluicing batch on November 18, 1998. A Process Test Plan was developed and conducted on December 16, 1998, to obtain better gas sample data under controlled sluicing conditions. The Process Test was aborted early due to a jumper leak in the tank C-106 sluice pit. Approximately 0.8 inches (2,300 gallons) of sludge was transferred to tank AY-102 during this Process Test. Following the Process Test, temperature readings on the thermocouple tree in Riser 14 increased to approximately 220-225°F: this has been attributed to the improved contact between the sludge and the thermocouple tree as a result of sluicing.

Sluicing operations continued to be shut down in January 1999, due to a leak in the supernate jumper in the sluice pit at tank C-106. Higher than expected temperature readings occurred on the thermocouple tree in riser 14 in the tank, with a peak temperature of approximate 225°F seen on the lower waste thermocouple at 4 inches from the tank bottom.

A high pressure test of the sluice line following repair of the leaking jumper in Pit 06C was conducted in February 1999. Approximately 3,000 gallons of flush water was utilized. The sluicer jet was directed straight down into tank C-106. Only a very slight increase in the stack release of Volatile Organic Compounds was observed during the approximately 10 minutes of flushing (approximately 2 ppm increase.)

Tank C-106 is being actively sluiced and volumes are predicted with some uncertainty at this time. Tank AY-102 receives C-106 waste, and due to settling, the actual waste inventory in C-106 is calculated following a settling period based on predicted fluffing of the waste. The inventory for C-106 will be determined and reported following increment three, or the removal of approximately three feet of C-106 solids.

Tank 241-SX-104 - Pumping resumed October 7, 1998, and was shut down for several periods during February 1999 for transfers to SY-102. In February 11.1 Kgallons were pumped: 19,804 gallons of dilution water and 2,066 gallons of water for transfer line flushes were used during these operations. A total of 183.1 Kgallons has been pumped from this tank.

<u>Tank 241-SX-106</u> – Pumping started on October 7, 1998, and was shut down for several periods during February 1999 for transfers to SY-102. In February, 600 gallons were pumped: 870 gallons of dilution water and 644 gallons of water for transfer line flushes were used during these pumping operations. A total of 24.6 Kgallons has been pumped from this tank.

<u>Tank 241-T-104</u> - Pumping resumed on June 7, 1998. No pumping was done in February 1999 due to the cross-site transfer activities. Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be adjusted as porosity data becomes available with continued pumping; a total of 146.8 Kgallons has been pumped from this tank.

Pumping operations are suspended in this tank until after the cross-site transfer from SY-102.

Tank 241-T-110 - Pumping resumed in July after the pump was replaced; no pumping was done in February 1999 due to cross-site transfer activities. Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be adjusted as porosity data becomes available with continued pumping; a total of 40.9 Kgallons has been pumped from this tank.

Pumping has been suspended in this tank until after the cross-site transfer of waste from SY-102.

Saltwell Screens - Saltwell screens have been installed in Tanks S-102, S-106, S-109, S-111, and U-103.

2. Single-Shell Tank TPA Interim Stabilization Milestones

All M-41-xx Milestones are being renegotiated. See also Table I-2, Tri-Party Agreement Single-Shell Tank Interim Stabilization Schedule.

3. Tank Waste Remediation System Safety Initiatives

The U. S. Secretary of Energy has directed that six safety initiatives be implemented in the Tank Waste Remediation System Program to accelerate the mitigation/resolution of the high priority waste tank safety issues at the Hanford Site. Forty-two milestones were established for accomplishing the initiatives.

No Safety Initiatives were completed in February 1999.

The following Safety Initiatives remain to be completed:

SI 4a - Upgrade Alarm Panels in Seven Tank Farms

SI 4c - Complete Accelerated Walk-Downs and Field Verify Essential Drawings

SI 6d - Initiate C-106 Accelerated Retrieval

SI 4a - An assessment of the Completion Record is being evaluated for this Safety Initiative. Completion dates for SI 4c and 6d have been missed.

4. <u>Double-Shell Tank 241-SY-101</u> Waste Level Increase

Tank 241-SY-101 exhibited gas release events due to generation and retention of flammable gas. Waste level was used as an indirect measure of retained gas inventory. A mixer pump was installed in the tank in July 1993, which circulates liquid wastes from the tank's upper layer down to the bottom where jet nozzles discharge the fluid about two feet from the bottom. This prevents gas bubbles from building up at the bottom, and results in venting of small steady gas releases, rather than in large infrequent gas releases. Since early 1997, the surface level has been rising in spite of regular mixer pump operations. Investigations continue on why the surface level is rising.

Several void fraction instrument (VFI) readings have been completed which gives the void fraction at depth in the riser through which it is deployed. The VFI readings indicate that the level increase is due to gas trapped in the crust, which comprises the upper approximately 60 inches of waste. The results of the core sampling (of both retained gas sampling and regular cores) and the VFI results, are in agreement.

Resolution Status: On February 11, 1998, the PRC recommended that the DOE-RL declare an Unreviewed Safety Question (USQ) over the continued level growth observed in this tank. DOE has modified the 406-inch and 422-inch mixer pump operational controls to allow additional mixer pump and characterization operations. Tank Farms has implemented TWO Standing Order 99-01 to reflect the relaxation of mixer pump operating controls at 406 and 422 inches. The contractor has established a multi-disciplinary team to solve the level growth issues in SY-101. The prime near-term focus is to transfer approximately 100,000 gallons out of SY-101. The schedule is presently 1st Quarter FY00.

An in-tank camera was recently installed to aid in evaluation of the surface level growth. Equipment and materials are being staged to perform some near-term mitigation activities while fabrication of a transfer system from SY-101 to SY-102 is being assembled.

5. Characterization Progress Status (See Appendix J)

Characterization is the understanding of the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

Characterization Progress for February

Characterization sampling this month involved core sampling in tank 241-TX-113, vapor sampling in U-102 (as funded by Interim Stabilization) and vapor grab sampling of two tanks with Standard Hydrogen Monitoring Systems (SHMS)

6. Computer Automated Surveillance System (CASS) Retired From Service

On February 22, 1999, the Data General Computers on which the Computer Automated Surveillance System (CASS) resided were retired from service. The CASS system was placed into service in 1978 and in recent years, the Tank Monitoring and Control System (TMACS) has replaced many of the key functions of CASS. The remaining CASS readings were replaced by manual field readings. A plan is being formalized to migrate the field alarms previously monitored on the CASS to TMACS.

PMHC-TANKFARM-1998-0156, Off-Normal Occurrence Report, "Potential Inadequacy of Authorization Basis (USO)," Latest Update February 12, 1999

On December 31, 1998, the Plant Review Committee (PRC) concluded that a Potential Inadequacy in the Authorization Basis (PIAB) exists.

The Unreviewed Safety Question (USQ) screening results indicate drainage volume from some transfer routes could potentially exceed the assumptions used in the Basis for Interim Operation (BIO) on the volume of liquid that could drain from a pipe in the event of a leak.

Immediate Actions: (1) Stop all waste transfers, (2) Standing Order TWO-99-005 was issued, which describes actions and approvals necessary prior to performing each transfer.

The USQ states: Based on HNF-3612, "Hydraulic Calculations for Cross Site Transfer System and Selected Physically Connected Routes," a larger transfer line drainback of volume than previously analyzed in the Authorization Basis appears to be possible.

During preparation for an upcoming cross-site transfer, piping runs associated with the Cross Site Transfer System were identified that result in larger transfer line drainback volumes than analyzed in the Authorization. The USQ screening determines if the increase in drainback volume represents an analytical error, omission, or deficiency in the authorization basis.

Conclusion: The USQ screening determined that the piping runs available drainback represent a deficiency in the Authorization basis. As other transfer routes (e.g., 244-BX to 241-AP-106) may have piping runs yielding larger drainback volumes than previously analyzed, this PIAB is extended to cover <u>any</u> transfer route. Based on the increased length of pipe leading to larger volume of drainback (i.e., increase the material at risk), a potential deficiency in the Authorization Basis exists that could lead to increased consequences over that previously analyzed for any transfer route.

Per Standing order TWO-99-005, a transfer specific analysis was performed for the pending cross-site transfer from SY-102 to AP-106. (Note: waste was actually transferred to AP-107, and will be reported as such in the next report).

On January 12, 1999, the results of the transfer specific analysis were documented as Unreviewed Safety Question Determination (USQD), USQ Tracking No. TF-99-0017.

The USQD concludes that the proposed activity is within the TWRS Authorization Basis and that the contract has the approval authority to perform the transfer.

Standing Order TWO-99-005 was issued and describes actions and approvals necessary prior to performing each transfer.

This Occurrence Report is extended pending the results of the PRC evaluation of USQ for USQ No. TF-99-0017.

8. RL-PHMC-TANKFARM-1998-0124, Off-Normal Occurrence Report, "Liquid Observation Well (LOW)
Readings in SST 241-B-111 Indicate a Potential Drop in Interstitial Liquid Level (ILL)." Latest Update
February 1, 1999.

On September 29, 1998, LOW readings, used to help determine and monitor tank ILLs were in excess of -3 standard deviations from the baseline established for this tank, indicating a liquid level drop of approximately 1.2 inches.

On October 20, 1998, the Plant Review Committee (PRC) recommended:

- 1) Place the tank on the alert list and continue normal monitoring with increased surveillance and:
 - a) if level growth above 2-sigma deviations after 21 days is experienced, file a discrepancy report
 - b) if the level trend is downward (2-sigma deviation), file a discrepancy report Report data for PRC review and recommendations.

On January 27, 1999, the PRC met and reviewed the data collected since the occurrence report notification date (October 10, 1998). The PRC determined that the data remained inconclusive.

Continuing actions will be to monitor tank B-111 levels closely, evaluate data collected, and reconvene the PRC in three months to review additional tank data.

APPENDIX A

WASTE TANK SURVEILLANCE MONITORING TABLES

TABLE A-1. WATCH LIST TANKS February 28, 1999

These tanks have been identified as Watch List Tanks in accordance with Public Law 101-510, Section 3137, "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," (1990). These tanks have been identified because they "... may have a serious potential for release of high-level waste due to uncontrolled increases in temperature or pressure."

Single-Shell Tanks		Officially Added to	Double-Shell Tanks	······································	Officially Added to
Tank No.	Watch List	Watch List	Tank No.	Watch List	Watch List
1 d / K / 1 1 U .	Water Eist	Water List	Tank No.	Water List	vvatch List
A-101	Undergo	1/01	411.400		
A-101	Hydrogen	1/91	AN-103	Hydrogen	1/91
AX-101	Underson	1./0.1	AN-104	Hydrogen	1/91
AX-101	Hydrogen Hydrogen	1/91 1/91	AN-105 AW-101	Hydrogen	1/91
AA-103	Liveropen	1/51	SY-101	Hydrogen	6/93
C-102	Organics	5/94	SY-103	Hydrogen Hydrogen	1/91 1/91
C-103	Organics	1/91	6 Tanks	.,,	1,01
C-106	High Heat	1/91	2.00.10.10.20.20.10.20.20.1		
	-				
S-102	Hydrogen	1/91	TANKS BY WAT	TCH LIST	
S-111	Hydrogen	1/91			······································
S-112	Hydrogen	1/91	<u>Hydrogen</u>	Organics	
•			A-101	C-102	•
SX-101	Hydrogen	1/91	AX-101	C-103	
SX-102	Hydrogen	1/91	AX-103	2 Tanks	
SX-103	Hydrogen	1/91	S-102		•
SX-104	Hydrogen	1/91	S-111		
SX-105	Hydrogen	1/91	S-112		
SX-106	Hydrogen	1/91	SX-101		
SX-109	Hydrogen because other	r tanks	SX-102	-	
	vent thru it	1/91	SX-103	High Heat	
			SX-104	C-106	
T-110	Hydrogen	1/91	SX-105	1 Tank	
			SX-106		•
U-103	Hydrogen	1/91	SX-109		
U-105	Hydrogen	1/91	T-110		
U-107	Hydrogen	12/93	U-103		
U-108	Hydrogen	1/91	U-105	•	
U-109	Hydrogen	1/91	U-107		
	•		U-108		
			U-109		
			AN-103		
			AN-104	•	
			AN-105		
			AW-101		
			SY-101		
			SY-103	f 1s - Daniel wassessessesses	
	•		25 Tanks	3 Tenks	
•					
•			•	-Shell tanks	
	•		6 Double	o-Shell tanks	
			28 Tanks	on Watch Lists	•
22 Tanke					

All tanks were removed from the Ferrocyanide and 18 tanks from Organics Watch Lists; see Table A-2.

TABLE A-2. ADDITIONS/DELETIONS TO WATCH LISTS BY YEAR February 28, 1999

Added/Deleted dates may differ from dates that tanks were officially added to the Watch Lists. (See Table A-1).

·					,				ks (1)
		cyanide	Hydrogen	Organics	High Heat				Tota!
/91 Original List Response to Public Law 101-5			23	8			47	- 6	
Added 2/91 (revision to Original List)	200000000000000000000000000000000000000	T-107			\$50.00000000000000000000000000000000000		1		0.000
otal - December 31, 1991	24		23	7 8 · · · · · ·	200 B		48	. 6	3886
Added 8/92	FEEDOS AND	STATISTICS CONTRACTOR	1 AW-101		Journal of Market Const.	92		1	
otal - December 31, 1892	24	第二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十	24	8	914. 1 22.1		48	- 6	4008
Added 3/93			\	1 U-111			1	1	1
Deleted 7/93	-4	(BX-110)		·			-4		1
		(BX-111)							
	İ	(BY-101) (T-101)			Ì		,		
Added 12/93	l	(1-101)	1 (U-107)				_		1
otal - December 31, 1993	200	and raining	a. allen Selected Sectional and advantage of a	9	1		0 45	i rasti i vi ori	ageofice.
Added 2/94	78.82U S		25	9 1 T-111	1:00			6	
Added 5/94				10 A-101			1 4		
ridddd 3/0 Y				AX-102			*		
	ŀ		ļ	C-102		à	į		
	ŀ		<u>[</u>	S-111	i				Î
	ĺ			SX-103		ş.			
•				TY-104			i		
				U-103					
	l			U-105					
		•		U-203		3			
				U-204	Ì				
Deleted 11/94	,	-2 (BX-102)					-2		
		(BX-106)				2	[
otal - December 1894 thru December 1995	. 18	Application (Application	26	20	a la Baju		48	8	
Deleted 6/96	-4	(C-108)				100	-4		
		(C-109)					ı		
		(C-111)				談	- 1		
B 4		(C-112)			Į.	9	- 1		
Deleted 9/96	-14	(BY-103)			l		-10		
·		(BY-104)				20	ı	- 1	
		(BY-105)		•	l		1		
		(BY-106)	}		l				
		(BY-107)	1		Ì	30	- 1	1	
		(BY-108)			Į.		ŀ		
		(BY-110) (BY-111)	1		l	ejet Heli			
i		(BY-112)		ŀ			- 1	- 1	
		(T-107)					ŀ	1	
		(TX-118)			-			- 1	
		(TY-101)							
		(TY-103)					- 1		
		(TY-104)				ė.		i	
Deleted 12/98				18 (A-101)		9	-12	- 1	
				(AX-102)		1.	- 1	ļ	
į		ı		(B-103)		3	- 1	- 1	
]	(S-102)				Ī	
				(S-111)					
ļ				(SX-103)					
ľ		ľ		(SX-106)	Š		ļ	ļ	
-	-	ľ		(T-111)			- 1	1	
			1	(TX-105)	1		•	ŀ	
		į	Į.	(TX-118)		9	- 1	ļ	
				(TY-104)			1	- 1	
		ľ	1	(U-103)			- 1	1	
ļ		ı	ļ	(U-105) (U-106)			į	ĺ	
		ļ	İ	(U-106) (U-107)		1	J	[
_ i				(U-111)	Jan.	•	1	1	
			- 1	(U-203)			- !	- 1	
		ŀ		(U-204)			- [- [
				10 407/	3	427	1	- 1	
		J		1	977		1	- 1	

⁽¹⁾ Eighteen of the 20 tanks were removed from the Organics Watch List in December 1998; eight of the tanks removed from the Organics List are also on the Hydrogen Watch List; therefore, the total tanks added/deleted depends upon whether a tank is also on another list. See table A-1 for current Watch List Tanks.

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (Sheet 1 of 2) February 28, 1999

All Watch List tanks are reviewed for increasing temperature trends. Temperatures in these tanks are monitored by the Tank Monitor And Control System (TMACS), unless indicated otherwise.

Temperatures are taken in the waste unless in-waste thermocouples are out of service. Temperatures below are the highest temperatures recorded in these tanks during this month, and do not exceed the maximum criteria limit for this month.

Temperatures in Degrees F. Total Waste in Inches

(Total waste in inches is calculated from Inventory tables and size of tank, not surface level readings)

Hydrogen (Fl			Orga	inics
		Total		Total
Tank No.	Temp.		Tank No.	Temp Waste
A-101	148	347	C-102	82 149
AX-101	129	272	C-103	114 66
AX-103	109	40	2 Tanks	
S-102	104	207		•
S-111	90	224		
S-112	84	239	·	
SX-101	133	171	Ì	Total
SX-102	142	203	Tank No.	Temp Waste
SX-103	161	243	C-106 (2)	223 72
SX-104	143	229	1 Tank	
SX-105	166	254		
SX-106	104	201	(Sluicing began N	lovember 18,
SX-109 (1)	139	96	1998, in this tan	k)
T-110	63	133		
U-103	86	166		
U-105	90	147		
U-107	78	143		
U-108	. 87	166		
U-10 9	84	164		•
AN-103	107	348		
AN-104	108	384		
AN-105	105	410		-
AW-101	100	410		
SY-101	123	405		
SY-103	95	270		
25 Tanks	<u> </u>		3 Tanks	

¹⁸ tanks have been removed from the Organics Watch List. See Table A-2 for list and dates.

²² Single-Shell Tanks and 6 Double-Shell Tanks remain on the Watch List

TABLE A-3. TEMPERATURE MONITORING IN WATCH LIST TANKS (sheet 2 of 2)

Notes:

Unreviewed Safety Ouestion(USO):

When a USQ is declared, special controls are required, and work in the tanks is limited. There are currently no USQs on single-shell tanks. There is a USQ on double-shell tank SY-101 for liquid level increase.

Hydrogen/Flammable Gas:

These tanks are suspected of having a significant potential for hydrogen/flammable gas generation, entrapment, and episodic release. The USQ associated with these tanks was closed in September 1998. Twenty-five tanks (19 SST and 6 DST) remain on the Hydrogen Watch List.

Organic Salts:

These tanks contain concentrations of organic salts ≥3 weight% of total organic carbon (TOC)(equivalent to 10 wt% sodium acetate). The USQ associated with these tanks was closed in October 1998, and 18 organic complexant tanks were removed from the Organic Watch List in December 1998. Two organic solvent tanks (C-102 and C-103) remain on the Organic Watch List.

High Heat:

These tanks contain heat generating strontium-rich sludge and require drainable liquid to be maintained in the tank to promote cooling. Only tank C-106 is on the High Heat Watch List because in the event of a leak, without water additions the tank could exceed temperature limits resulting in unacceptable structural damage. The tank is cooled through evaporation in conjunction with active ventilation. Water is periodically added as evaporation takes place. There is no USO associated with tank C-106.

Active ventilation:

There are 15 single-shell tanks on active ventilation (eight are on the Watch List as indicated by an asterisk):

C-105	. SX-107
C-106 *	SX-108
SX-101 *	SX-109 *
SX-102 *	SX-110
SX-103 *	SX-111
SX-104 *	SX-112
SX-105 *	SX-114
SX-106 *	

Note: A-104, 105 and 106 exhauster has been out of service since 1991 and is no longer considered actively ventilated. Although C-104 has a cascade line with C-105, it is not considered to be actively ventilated.

Footnotes:

- (1) Tank SX-109 has the potential for flammable gas accumulation only because other SX tanks vent through it.
- (2) Tank C-106 is on the Watch List because in the event of a leak without water additions the tank could exceed temperature limits resulting in unacceptable structural damage.

TABLE A-4. TEMPERATURE MONITORING IN NON-WATCH LIST TANKS February 28, 1999

SINGLE-SHELL TANKS WITH HIGH HEAT LOADS (>40,000 Btu/hr)

Ten tanks have high heat loads for which temperature surveillance requirements are established by OSD-T-151-00013. Only one of these tanks (241-C-106) is on the High Heat Watch List. In an analysis, WHC-SD-WM-ER-333, "Evaluation of Heat Sources in High Heat Single Shell Tanks," Bander, 1994, it was determined that six of the ten tanks have heat sources greater than 40,000 Btu/h. Additionally, although four tanks have heat loads less than 40,000 Btu/h, it is recommended that these tanks remain on the High Heat Load List because of uncertainties in the parameters used in these analyses. It is estimated that the current analysis predicts the heat loads within +/- 20%.

Temperatures in these tanks did not exceed OSD requirements for this month. All high heat load tanks, with the exception of 241-A-104 and 241-A-105, are on active ventilation. All high heat load tanks are monitored by the Tank Monitor and Control System (TMACS), with the exception of A-104 and A-105, which are taken manually on a weekly basis.

	Tempera	ature	Total Waste	(Total Waste In Inches is
Tank No.	(F.)		In Inches	calculated from inventory table
A-104	167		10	and tank size, not surface level
A-105	135		07	readings)
C-106 (*)	223	(Riser 14)	72	
	150	(Riser 8)	72	•
SX-107	163		43	
SX-108	183		37	
SX-109	140		96	
SX-110	161		28	
SX-111	183		51	
SX-112	145		39	
SX-114	177		71	
10 Tanks				

(*) C-106 on High Heat Load Watch List. Sluicing began November 18, 1998. Highest temperature in 34 lateral thermocouples beneath A-105: 235

SINGLE SHELL TANKS WITH LOW HEAT LOADS (<=40,000 Btu/hr)

There are 118 low heat load non-watch list tanks. Temperatures in tanks connected to TMACS are monitored by TMACS; temperatures in those tanks not yet connected to TMACS are manually taken semiannually in January and July. Temperatures obtained were within historical ranges for the applicable tank.

No temperatures have been obtained for several years in the tanks listed below. Most of these tanks have no thermocouple tree.

Tank No.	Tank No.
BX-104	TX-101
BY-102	TX-110
BY-109	TX-114
C-204	TX-116
SX-115	TX-117
T-102	U-104
T-105	

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS

149 TANKS (Sheet 1 of 6) February 28, 1999

The following table indicates whether Single-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month:

NOTE:

All Watch List and High Heat tank temperature monitoring is in compliance. (4)
All Dome Elevation Survey monitoring is in compliance. (See also footnote 13)
All Psychrometrics monitoring is in compliance (2).
Drywell monitoring no longer required (9).
In-tank photos/videos are taken "as needed" (3)

LEGEND:	
(Shaded) N/C	= in compliance with all applicable documentation
N/C	= noncompliance with applicable documentation
0/5	= Out of Service
Neutron	= LOW readings taken by Neutron probe
POP	= Plant Operating Procedure, TO-040-650
MT/FIC/ ENRAF	= Surface level measurement devices
OSD	= Operating Specifications Doc., OSD-T-151-00013, -00031
N/A	= Not applicable (not monitored, or no monitoring schedule)
None	= Applicable equipment not installed

	Tank Category		Temperature	Primary perature Leak		Surface Level Readings (1)		
Tank	Watch High		Readings	Detection	1	Readings (OSD)(5.7)		
Number	List	Heat	(4)	Source (5)	MT	(OSD)	ENRAF	Neutron
A-101	25.9 X 1323	在基础与影响		LOW	None	None	Augustinian (nemineral)	S. C. Severessian
A-102		PERMINER.		None	None	120455	None	None
A-103	45535666		erene Cyal Cagnilla	LOW	None	None		The Committee of the Constitution of the Const
A-104	Continue of the	X		None	None	None :	88028084 STREET,	None
A-105	a parties in a large	* X *		None		None	None	None
A-106	LONG LANCES			None	None	None		None
AX-101	X			LOW	None	None		(10)
AX-102			高温 产品数	None	≥ None	None	el de la Partium de la Colonia de la Section de la Section de la Section de la Section de la Section de la Sec Section de la Section de l	None
AX-103	, X., , ,	Mala Link	Salas Andrea	None	None	None	province in the	None
AX-104	એ નોંધાની પાક હેલાનો જો કરો છે. જો	463 (CLASS)	Manyrey englandig	None	None	None		None
B-101		16/65/36	BURNAU GURDE	None	None	reconstant	None	None
B-102		40.151600		ENRAF	None	None		None
B-103	pagarit a const	Situ disentary	20,038, 3893, 349, 55	None	None		None	0/8
B-104	Tarrazana des	o tene adalatan ada	IANGARAN SAMBOR GEORGE	LOW	a paragrations transfer	None	None	
B-105			******	LOW		None	None	
B-106				FIC	None		None	None
B-107			tas and superiorisis	None	Section 2018 All the	None	None Sales	None
B-108	Transferance (Fig.	利提得特殊	- Principle Colored to the	None	None	CONTRACTOR AND AND	Santa None	None
B-109	a Banker of Mills Ferring	设据用块物的	AND TO SURBER ASSESS	None	ALTERNATION CONTRACTOR	None	None	None
B-110	-206-540504.	43000000000000000000000000000000000000	AND SERVICE STREET	LOW	0/8	None	None **	NOTE AND DESIGNATION OF THE
B-111	1500K-5648	54.05.1303	44747643888	LOW	None	e enigricadadas es	None"	distribution de la company de la company de la company de la company de la company de la company de la company
B-112		1965, 1918/915.	MIT IN TOUR OF STAR AND STAR	ENRAF	None	None	renesiono, vi in enteriore	None
B-201		Callydon, Creeks		MT	1217222234404	None	None	None
B-202	isas etimisis k	2596616-6819	epodecusares posta a	MT	E-1000000 301 331 57 6	None	None	None
B-203				MT		None	None	None
B-204	4 (04-1) 648 (6) 1 (4) (1		Carring Commence	MT	STATE ASSESSED.	None	None	None
BX-101	detention of the state of		neversions support	ENRAF	None	- None	ACMINIST TO PRINCE	None
BX-102	24445444 P	WE STATE		None	None	None say	CP State Control (Proc SP C. C.)	None None
BX-103	service design	and the same	SOUR PURE NEW	ENRAF	A None	None	Perioden in Carlotti	None
BX-104	1011679691	Minutes (fig.	None	ENRAF	None	None	P1001000000000000000000000000000000000	None
BX-105	5000000000	1902-1803-15		None	None	None		None
BX-106	70240203455	indistra		ENRAF	None	None		None
BX-107	200703233333	1000		ENRAF	None	None		None

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS
149 TANKS (Sheet 2 of 6)

		Category	Temperature	Primery Leak	Surfa	ce Level Reading	ps (1)	LOW Readings
Tank Number	Watch List	High Heat	Readings (4)	Detection Source (5)	MT	(OSD)	ENRAF	(OSD)(5,7) Neutron
BX-108	dittiene i idea			None	None	None Sala	agana garagas	None
BX-109	201004201556	e magazataran dan sam		None	None	None	-980E F030C 138	None
BX-110	669686368.653	85 85 68 60 86 600 600	rations and a sure to the state as	None	None	None	andrada arreneldes	None
BX-111				LOW	None	None		NOR
BX-112				ENRAF	None	None		None
BY-101				LOW	110110	None	None	NOW
BY-102	AND THE PROPERTY AND		None	LOW	0/8		None	erenden in der Seine
BY-103	din garin rija.		None.	LOW	None	None None	Maria Maria da Maria Maria da Maria da Ma	en ar eriggist jerden. Segandelse skipt in
BY-104				LOW	0/8	None	None	Send the send of the send of the
BY-105	10.050,000,000	. 7		LOW	CM2 and the one seems water	None	None	rainesiejture e
BY-106	550000000000000000000000000000000000000	y sa-sagaday ahalakasa:	eren jan jong seria.	LOW	siculariyayaa, bib	None	None	to committees were
BY-107	100 9930 DE-100 D	e secondoral		FOM	6.56154.634.544.64.646.6	None	None	
BY-108				None		None	None	None
BY-108			None	LOW	None	0/5	None	
BY-110	160 CO 180 CO		AND THE PROPERTY OF THE PROPER	LOW	None	V/S None	AND REAL PROPERTY.	americal de la la companya de la companya de la companya de la companya de la companya de la companya de la co
BY-111	TETROGRAMATA THE TRACERONAL	r germagere, ereden. C germagere		LOW	None	None	arg Kesalantieri Halan aktaberrasi	igus sumasumen val Engligi Magazina (ban
BY-112		e and control of the control	and and an entre of the	LOW		None	None	
C-101				None	la arguna (ingrascina)	Nona	None	None
C-102	2010(41,03,01,34	C SPSSTARSCHARGE		None	None	10000000000000000000000000000000000000	None	None
C-102	27,1000311910	ar van Kanser a Kasasilan kan	AND STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, ST	ENRAF	None	Nona	NAME OF THE PERSON OF	None
C-103				None	C15(0)000 *********************************	0/\$	Jugggernuskinsprotis	
C-105				None	None None	None	None	None
C-106 (3)	Company Company	X	San Santaga (Carani	ENRAF	None	None	lelis (S.) epikurijiketk	None None
C-106 (3)		8 (\$2.00 page \text{Appendix \$1.000})	magagagagaaa, sa sa s	ENRAF	***********	None	Acceptant and very	a series and a series of the series of
C-107	ega kowana se u	6	學的第三字是由阿爾巴拉巴阿爾森伯爾	None	None None		e Name of State California	None dest
C-109			apada, azalohta (1927) Salah das apada (1927)		Maria Committee	None None	None None	None
C-110			umpfelskalestesbelskaut dielde erderen.	None MT	erigiskopentriina. Kanderaaninaksinina.		None	None
	40.000.000.000					None	None	None
C-111	1880 SC 40 CO 60 CO			None	N.	None	None	None
C-112				None	None	None		None
C-201	(445) (314) (414)			None		None	None	. None
C-202	Grane is section.	CONTROL CONTROL CONTROL	Sta Schlows College	None	actività dalcarea di arces	Mone assure	None -	gasa None a se
C-203	9917.03.03.03.03.03	i, ka gagaritinkasik	Sperger State (1991)	None	eligi (seleta pelatria)	None A	None	None
C-204			None	None		None	None	None 116
S-101	30 20 00000	a transcrativo de tra	ANALON SETTINGUES	ENRAF	None	None	uras manta manta	Table Surger Land
S-102	X		La versi de antago pola calanda de la como	ENRAF	None	None		
S-103				ENRAF	None	None		
S-104				LOW		None	None	
S-105	194000000000000000000000000000000000000	distribution de la constantina de la constantina de la constantina de la constantina de la constantina de la c		LOW	None	, None	in Caracaparus i sectan	SECRETARIO E COMMENTE EST.
S-106	1404241111111	rente territorio della	200000000000000000000000000000000000000	ENRAF	None	None 💄	363 37 30 300	Kangapata (Kangapata
S-107	Appendition of the second			ENRAF	Sala None		ostanie populacija.	P. P. C.
S-108	identification of the		ortal a facility out?	LOW	None		reaction bearing	
S-109 ·				LOW	See None			Significant Color
S-110	100000000000000000000000000000000000000			LOW	None			Sandralija kolentrije
S-111	X			ENRAF	None			
S-112	X			LOW	None			
SX-101	X			LOW	None		(11)	50.000 60.000 60.00
SX-102	X			LOW	None	None	Security and the second	a gia selica ar
SX-103	X			LOW	None			
SX-104	X1			LOW	None	None		
SX-105	×		2012/03/16/19/22	FOM	None		production to the same of	
SX-106	X	r af ang paga pengenan	Erspirkungsstäp	ENRAF	None	None		
SX-107	100000000000000000000000000000000000000	X		None		None	None	None
SX-108		X		None	-200/39/21/2019	None	None	None

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 3 of 6)

	Tank C	Tank Category		Primary Leak	Surfa	ice Level Readi	ngs (1)	LOW Readings
Tank	Watch	High	Readings	Detection		(OSD)		(OSD)(5,7)
Number	List	Heat	(4)	Source (5)	MT	FIC	ENRAF	Neutron
SX-109 (3)	X	7 (19 X (1971)		None	None	None		None
SX-110		X		None		None	None	Nane
SX-111		X		None		None	None	None
SX-112 SX-113		X		None		None	None	None
SX-113				None	5 (34.14) (55) (p.15-1)	None sale	None None	None
SX-115		Z. Z. Z. Z. Z. Z. Z. Z. Z. Z. Z. Z. Z. Z		None	Hallia Parka Alba	None	None None	None
T-101			None	None		None S	None	None
T-102			None	None ENRAF	None	None		None
T-103			NOTIO		None	None		None
T-104		TANGSTANDARFATTE		None LOW	None	None		None
T-105	4040710500000000000000000000000000000000	Francisco de la compania del compania de la compania del compania de la compania del compania de la compania del compania de la compania del compania de	None	None None	None	Nane		
T-106	000000000000000000000000000000000000000	The Cartesian of	Security Sec		None	None		None
T-107				None	None	None		None
T-108				ENRAF	None	None		None
T-109		166531943435552897		ENRAF	None	Nane		None
T-110	X	· 通用工具工程的可能的	All Strategics	None	None	None		None
T-111				LOW	None	None.		
T-112				LOW	None .	None		
T-201	59 (34 C) (30 pt (34)			ENRAF	None	None		None
T-202			TALL CONTRACTOR OF THE CONTRAC	MT		None	None	None
T-202	radioract attack		STATEMENT OF THE STATEM	MT		None	None	None
T-203	8536386023860 865444446666444			None		None	None	None
TX-101				MT		None	None	None
	100000000000000000000000000000000000000	Par Gasety, 32 (2)	None	ENRAF	None Sage	None None	topi espitakkoje izagoj	None None
TX-102	raja (stajuje) 498.256	Estimate Pitt	Prac Grandagenser	LOW	None None	None None	Section Control (1997)	新新华州市东州 市
TX-103	Service Payers	central and sale		None	None None	None		None 3
TX-104 TX-105	Sicologica (Colorida		Table of the State	None	None	None	1600 PR 2314 1997 VI	None
TX-106	hand the fact of the same		Section and Action Controls	None	None	None	1035. 1400.000.0043.0000.1380	None (7)
TX-107	rassonari e laselari	APV Material project (Co.)	COLDENSES SERVICES	LOW	None	None		
TX-108	200000000000000000000000000000000000000	TATESTON SECTION	Jakob daca censera	None	None	None		None
TX-109	Sacreta de la companya		None	None	None		None	
TX-110				LOW	None	None	and the section of the	ACMAPANCE
TX-111	4554,9556,000,000,000		None -	LOW	None a sage	None	interior reporterior in the	io bywine paoleja
TX-112	1,650 (500)021,000,000		5.000494961757 Selve.	LOW	None	None	Section Polesteries (3)	《美国教士》等中国的制度。 第234:
TX-113		。 通過學也也學過過經濟學的學術學 第二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十二十	trosorgeneraerenersen Arbeiterene		None	None	169 (126 (60) 16 (2) 16 (6)	Maria Salah Salah
TX-113	1400 1000 1000 1000 1000 1000 1000 1000	gerigeropangenomen Textitetakananakti	None	LOW	None	None		
TX-115		SENTENCE CONTRACTOR CONTRACTOR	A CONTRACTOR OF THE PROPERTY O	LOW	None	None	And the second s	
TX-116		and the standard of	None		None	None		
TX-110	1,183015-411-35-02	Materia i propini	None None	None LOW	None None	None		None
TX-118		aratan kanggaraga Caratan	Note			None		
TY-101				LOW	None None	None		
TY-102	46 366 46			None ENRAF		None		None
TY-102				LOW	*******	None		None
TY-103				ENRAF	None	None		k. Spring Spring
TY-105	1969 1896 23 103 103			None	None	None		None
TY-106	1000 100 L 2 100 100 100 100 100 100 100 100 100 1			None	None None	None		None
U-101				MT	None	None		None
U-102			2000 00 00 00 00 00 00 00 00 00 00 00 00	LOW		None	None	None
U-102	- X	es competitions	#	ENRAF	None None	None		NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NOTE: NO
U-104	Translation of the last	Tackers of States	None		NONE	None	est au deservantes a dipagna	
U-105	X	Albania de la casa de		None ENRAF		None	None	None
U-106				ENRAF	None None	None None		anderstanders National

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS 149 TANKS (Sheet 4 of 6)

	Tank Ca	itegory	Temperature	Primary Leak	Surf	ace Level Read	lings (1)	LOW Readings
Tank	Watch High		Readings Det	Detection		(OSD)(5,7)		
Number	List	Heat	(4)	Source (5)	MT	FIC	ENRAF	Neutron
U-107	*	90m 0000000		ENRAF	None	None St	e erior severanistics	n principalita ilipraida
U-108	X			LOW	None	None		900000000000000000000000000000000000000
U-10 9	X			ENRAF	None	None	te errordestablik berted	folio de objetos
U-110	And Control of the Control		and the second second	None	None	None		None
U-111				LOW	None	None		
U-112	100.00	No. of Contrast Contrast	A SERVICE AND SERVICE SERVICES	None	80,901-01,982-0,084-9-0,034-942	None	None	None
U-201	ar ansaring saware	6.028.00039.000	e depote consultante a social	MT	Cargory and providing a continue	None	None	None
U-202		Allego di salah sabi	d brance participation who	MT	9495, SECTO (\$5.450)	sage None	None	scor None
U-203	and selections	utiliyasiniyatiliyi isili	a agus gasa gustaga:	None	None	None **	a. Se se se se se se se	None Pink
U-204				ENRAF	None	None		None :
Catch Tanks a	and Special Su	rveillance F	açiliti e s					
A-302-A	N/A	N/A	N/A	(6)	None	None		None
A-302-B	N/A	N/A	N/A	(6)		None	None	None
ER-311	N/A	N/A	N/A	(6)	None		None	None
AX-152	N/A.	N/A	N/A	(6)	alle Sugar Salakos Auger sa	None	None	None
AZ-151 ·	N/A	N/A	N/A	(6)	None	and place (Section base)	None	None
AZ-154	N/A	N/A	N/A	(6)		None	None	- None
BX-TK/SMP	N/A	N/A	N/A	(6)	and appropriate	None	None	None
A-244 TK/SMP	N/A	N/A	N/A	(6)	None	None	None	None
AR-204	N/A	N/A	N/A	(6)			None	None
A-417	N/A	N/A	N/A	[6]	None	None	None	None
A-350	N/A	N/A	N/A	(6)	None	None	None	None
CR-003	N/A	N/A	N/A	(6)	None	None	None	None
Vent Sta.	N/A	N/A	N/A	(6)	a programme and the second	None	None	None
S-302	N/A	N/A	N/A	(6)	None.	None		None
S-302-A	N/A	N/A	N/A	(6)	None		None	None
S-304	N/A	N/A	N/A	(6)	None	None	100000000000000000000000000000000000000	None
TX-302-B	N/A	N/A	N/A	(6)		None	None	None
TX-302-C	N/A	N/A	N/A	(6)	None	None		None
U-301-B	N/A	N/A	N/A	(6)	None	None		None
UX-302-A	N/A	N/A	N/A	(6)	None	None		None
S-141	N/A	N/A	N/A	(6)	O/S (12)	None	None	None
S-142	N/A	N/A:	N/A	(6)	0/8 (12)	None	None	None
iotals:	20	10	N/C: 0	A CONTROL OF THE PROPERTY OF T	N/C: O	N/C: 0	N/C: 0	N/C: 0
149 tanks	Watch List	High Heat			:			
	Tanks	Tenks	1				1	1
	(4)	(4)	1			1	ŀ	1

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS -149 TANKS (Sheet 5 of 6)

Footnotes:

1. All SSTs have either manual tape, FIC, or ENRAF surface level measuring devices. Some also have zip cords.

ENRAF gauges are being installed to replace FICs (or sometimes manual tapes). The ENRAF gauges are being connected to TMACS, but many are currently being read manually from the field. See Table A-7 for list of ENRAF installations.

- 2. High heat tanks have active exhausters; psychrometrics can be taken in the high heat tanks. Psychrometric readings are taken on an "as needed" basis with the exception of tanks C-105 and C-106. Hanford Federal Facility Agreement and Consent Order," Washington State Department of Ecology, U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment 1994 (Tri-Party Agreement) requires psychrometric readings to be taken in C-105 and C-106 on a monthly frequency. Tank C-105 exhauster was shut down for C-106 sluicing; but was back on line during parts of December and psychrometrics were performed on C-105 and C-106. Also, SX-farm now has psychrometrics taken monthly.
- 3. C-106 and SX-109 these tanks are on both category lists (Watch List and high heat list) C-106 is the only tank on the high heat list included on the High Heat Watch List; SX-109 is on the Hydrogen Watch List, and also on the high heat list (but not on the High Heat Watch List).
- 4. Temperature readings may be regulated by OSD or POP. Temperatures cannot be obtained in 13 low heat load tanks (see Table A-4). The OSD does not require readings or repair of out-of service thermocouples for the low heat load (≤40,000 Btu/h) tanks. However, the POP requires that attempts are to be made semiannually in January and July to obtain readings for these tanks. There are no in-waste temperatures for tanks AX-102 and B-103. The waste level in this tanks is lower than the lowest thermocouple in these trees.

Temperatures for many tanks are monitored continuously by TMACS; see Table A-8, TMACS Monitoring Status.

- 5. Document WHC-OSD-T-151-00031, "Operating Specifications for Tank Farm Leak Detection," Rev C-0, January 13, 1999, requires that single-shell tanks with the surface level measurement device contacting liquid, partial liquid, or floating crust surface, will be monitored for leak detection on a daily basis. Tanks with a solid surface will be monitored for leak detection on a weekly basis by taking neutron scan data from a Liquid Observation Well (LOW), if an LOW is present. Tanks with a solid surface but without LOWs will not be monitored for leak detection if the tank has been interim stabilized, until an LOW is installed. This latest OSD revision does not require drywell surveys to be taken. (Drywell scans are being taken around C-106, as required by the Waste Retrieval Sluicing System, Spectral Gamma Waste Management). The OSD specifies what leak detection methods are to be used for each tank, and the requirements if the readings are not taken on the required frequency or if equipment is out of service.
- 6. Leak detection for the catch tanks is performed by monitoring for the buildup of liquid in the secondary containment (for most tanks with secondary containment) or for decrease in the liquid level for those tanks without secondary containment or secondary containment monitoring.

Catch tanks 240-S-302 and 241-S-302-A are monitored for intrusions only, and are not subject to leak detection monitoring requirements until liquid is present above the intrusion level.

Weight Time Factor is the surface level measuring device currently used in A-417, A-350 and 244-A-Tank/Sump. DCRT CR-003 is inactive and measured in gallons.

TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 149 TANKS (Sheet 6 of 6)

7. Document WHC-SD-WM-TI-605, REV. 0, dated January 1994, describes the rationale for Liquid Observation Well (LOW) installation priority. This priority is based on tank leak status, tank surface condition, and tank stabilization status. Also included is a listing of tanks with the waste level being below two feet which have no priority assigned because no effort will be made to install LOWs in the near future. LOW probes are unable to accurately monitor interstitial liquid levels less than two feet high.

Tanks which will not receive LOWs:

A-102	BX-101	C-201	T-106
A-104	BX-103	C-202	T-108
A-105	BX-105	C-203	T-109
AX-102	BX-106	C-204	TX-107
AX-104	BX-108	SX-110	TY-102
B-102	C-108	SX-113	TY-104
B-103	C-109	SX-115	TY-106
B-112	C-111	T-102	U-101
		T-103	TJ-112

Total - 34 Tanks

- 8. TX-105 the LOW was in riser 8; the riser has been removed, so the LOW has not been monitored since January 1987. Liquid levels are being taken in riser 9 by an ENRAF gauge and recorded in TMACS.
- OSD-T-151-00031, Rev. C-0, dated January 13, 1999, does not require drywell scans to be taken. Drywell scans
 are currently being taken in C-106 as a requirement of the Waste Retrieval Sluicing System, Spectral Gamma Waste
 Management.
- 10. AX-101 LOW readings are taken by gamma sensors.
- 11. SX-101 ENRAF data suspect: core sampling done displacer sticks on top of crust or goes into hole. LOW is primary device. ENRAF was flushed and recalibrated September 1, 1998, and the reading was back to near normal. Data marked suspect since September 10, when readings began fluctuating daily from 163 inches to 169 inches (new baseline established November 19, 1998, at 166.0 inches). Readings no longer suspect data. Rebaselined February 24, 1999, to 162.3 inches. All February readings are considered valid February 28, 1999 reading at 161.26 inches.
- 12. Catch Tanks S-141 and S-142 have no M.T. readings.

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS 28 TANKS (Sheet 1 of 2)

Februay 28, 1999

The following table indicates whether Double-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month.

NOTE:

Dome Elevation Surveys are not required for DSTs.

Psychrometrics and in-tank photos/videos are taken "as needed" (2)

LEGEND: (Shaded) = In compliance with all applicable documentation N/C = Noncompliance with applicable documentation FIC/ENRAF = Surface level measurement devices M.T. = OSD-T-151-0007, OSD-T-151-0031 OSD None = no M.T., FIC or ENRAF installed = Out of Service 0/\$ W.F. = Weight Factor Rad. = Radiation

			İ			R	ediation Reading	8
Tenk		Temperature Readings (3)	Surf	ace Level Read (OSD)	lings (1)	Leak Dete	Annulus	
Number	Watch List	(OSD)	M.T.	FIC	ENRAF	W.F.	Red. (8)	(OSD)
AN-101	san e Guar Carannas	rational emperiment in the Philip	MARKETES	None C	448 SAR	e 1909 (1000)	(8)	alcocote.
AN-102	garan kecamatan	dipplient will car conditi	Mark Company	Parthal Street	****None	e Saye A Party (Gallyta)	(8)	STATE OF STREET
AN-103	***** X		i i i allenia e	None	E-50-1, 175, 1960 PM	al Manager of Allega	(8)	ARREST CONTRACT
AN-104	is Designably	rankan merakan persakan b	O/S	None	te estratación providente	Carlor North Carlo	(8)	
AN-105	X	ryc pe 31,70 pearsons children.	0/8	None	disertary and property and		(8)	ede de la compa
AN-106					None		(8)	
AN-107		Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Salar Sa			None		(8)	44 A C C C C
AP-101	and the second	and the second	0/5	10 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	None	0/5 (9)	(8)	Significations:
AP-102	at a street at the second	anto di constituto	Market Market	and the state of the state of	None	O/S (9)	- (8) decision	er establisher
AP-103		enticlicates April 64	0/5		None*	0/5 (9)	(8)	SEE
AP-104			0/8		None	O/S (9)	(8)	1800 bezielezet
AP-105			Property and	(5)	None	O/5 (9)	(8)	ka ingedigiana.
AP-106		2012/04/04/05 00:00:00:00:00:00:00:00:00:00:00:00:00:	F1000000000000000000000000000000000000		None	O/S (9)	(8)	
AP-107				200000000000000000000000000000000000000	None	0/5 (9)	(8)	an Meillei
AP-108					None	0/5 (9)	(8)	
AW-101	×	The depth of the standard section is	- O/S	None	South and Company of the	. Jakoberanian	(8)	
AW-102			121 (120 PM	April 20 Cardina	(6)	et tamene.	(8)	:#E>:#3
AW-103	All of the second of the second	Production to		None	22/28/6/2006/20		(8)	366
AW-104	8,840,03,550,5		200000000000000000000000000000000000000	/ None		1995 Edition	(8)	
AW-105	\$44600 See 1417 Sept 2	and the contract of the contra	ACMINING AND S	None	13/2004/5555-656		(8) draw	953425-4285-
AW-106	954644600045465365	Standardor Carcilla A. Perke	2014/04/04/04	None (#198902.J#8190903		(8)	for analysis.
AY-101	(consecutions)	ecologica compression	Sold State Sales	None		O/S	(8)	888 (6) 755
AY-102	والمراغية والمهاد المعمول والمعادية	Company of the party of the St.	2004/00/44 (90/20)	None War	all the State County	AND COME TO SERVE	(8)	Matin Jeris
AZ-101	12940 6316 024606	interactal care ferriors of	HEROMOTO (1550)	None	(February)	SECTION	. No (8)	(5)
AZ-102	and the state of the state of	Taka manang tarahasan ya ma	10001255		None	Jinggapaggapagan	(8)	(6)
SY-101	X		0/8	None			(8)	
SY-102				None		(7)	(8)	
SY-103	есардарда « Х овдардарда	Gentlese Segreta and Jeps Sea.	RPROCES TO CARROO	None	enego penananangan	(7)	(8)	40.000
Totals:	6	N/C: O	N/C: 0	N/C: O	N/C: O	N/C: 0	N/C: O	N/C: 0
28 tanks	Watch List Tanks	ł	1		1		Į i	

TABLE A-6. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 28 TANKS (Sheet 2 of 2)

Footnotes:

- Some double-shell tanks have both FIC and manual tape which is used when the FIC is out of service.
 Noncompliance (N/C) will be shown when no readings are obtained. ENRAF gauges are being installed to replace FICs. The ENRAF gauges are being connected to TMACS, but some are currently being read manually.
- 2. Psychrometric readings are taken on an "as needed" basis. No psychrometric readings are currently being taken in the double-shell tanks.
- 3. OSD specifies double-shell tank temperature limits, gradients, etc.
- 4. Applicable OSD and HNF-IP-0842, latest revisions, are used as guidelines for monitoring Leak Detection Pits. See also (8) below.
- 5. AY-101 and AZ-101/102 are monitored only by the annulus Leak Detection Probe Measurement device.
- 6. AW-102 has ENRAF, FIC and M.T. At some point the FIC will be removed.
- SY-102 Leak Detection Pit CWF reading is above normal range of 24 inches in February 1999.
 SY-103 Leak Detection Pit CWF reading is above normal range of 24 inches in February 1999.
- 8. USQ TF-97-0038, dated April 28, 1997, specifies discontinuing the use of leak detection pit radiation monitoring equipment in all double-shell tank farms where the leak detection pits are used as tertiary leak detection. This applies to all double-shell tank farms.
- 9. Weekly readings are being obtained by Instrument Technicians in these tanks:

AP-103C (for tanks AP-101 - 104) AP-105C (for tanks AP-105 - 108)

TABLE A-7. ENRAF SURFACE LEVEL GAUGE INSTALLATION AND DATA INPUT METHODS

February 28, 1999

LEGEND

SACS = Surveillance Analysis Computer System

TMACS = Tank Monitor and Control System

Auto = Automatically entered into TMACS and electronically transmitted to SACS

Manual = Manually entered directly into SACS by surveillance personnel, from Field Data sheets

No. Date Method No. Date	L										_ .	-			•
Tank Date	EAST	ADEA									:			- :	
No. Date Method No. Date No.		T	laa.a		Tools	I to a to like of	1 1	-	**	T		***	a	T	Υ .
101					XI	_	, ·	. 🐰	SI	installed	Input		Tank	Installed	Input
1-102	No.	*******	Method		**	Date	Method	ı 🏻	~~	Date	Method		No.	Date	Method
1-103	A-101	09/95	Auto		"				S-101	02/95	Manuai		TX-101	11/95	Auto
1-104	A-102	ļ <u>.</u>			Y			8	***		Auto	*	TX-102	05/96	Auto
1-108			-	*					******	05/94	Auto	\otimes	TX-103	12/95	Auto
1-106		05/96	Manual		7			_8					TX-104	03/96	Auto
N-101 08/96 Auto		24/22						. 🏻	*		Manual		TX-105	04/96	Auto
N-102 SX-104 O5/98 Auto SX-105 Manual TX-108 Auto Auto TX-108 Auto TX-10				-				_8	~						Auto
N-103 08/95 Auto		08/96	Auto	8				- 🞇	***						Auto
N-104 08/95 Auto		08/05	A	***				-	~						Auto
N-106 08/95 Auto 8X-107 06/96 Auto 8-111 08/94 Auto 7X-111 06/96 Auto N-107 8X-109 08/95 Auto 8X-101 06/96 Auto 8X-102 08/95 Auto 1X-113 05/96 Auto N-107 8X-109 08/95 Auto 8X-101 06/96 Auto 8X-102 04/95 Auto 1X-113 05/96 Auto 1X				-				- 👸	<u> </u>		_				
N-106 BX-108 O5/96 Auto S-112 O5/95 Auto TX-112 O5/96 Auto Auto S-101 O4/96 Auto TX-113 O5/96 Auto S-101 O4/96 Auto TX-113 O5/96 Auto S-101 O5/96 Auto S-101 O4/95 Auto TX-113 O5/96 Auto S-102 O4/95 Auto TX-114 O5/96 Auto S-102 O4/95 Auto TX-115 O5/96 Auto S-102 O4/95 Auto TX-116 O5/96 Auto S-102 O4/95 Auto TX-116 O5/96 Auto S-102 O4/95 Auto TX-116 O5/96 Auto TX-116 O5/96 Auto S-103 O4/95 Auto TX-116 O5/96 Auto TX		-						-	<u> </u>						
N-107 BX-109 08/95	AN-106	00/83	~310					-88	***				•		
P-101 8X-110 06/96 Auto SX-102 04/95 Auto TX-115 05/96 Auto Auto TX-115 05/96 Auto SX-103 04/95 Auto TX-115 05/96 Auto Auto TX-115 05/96 Auto TX-116 05/96 Auto TX-116 05/96 Auto TX-117 06/96 Auto TX-107 TX-106 TX-107 TX-107 TX-106 TX-107 TX	AN-107							88					· · · · · · · · · · · · · · · · · · ·		
P-102 8X-111 05/98 Auto SX-103 04/95 Auto TX-116 05/98 Auto Auto TX-116 05/98 Auto SX-104 05/95 Auto TX-116 05/98 Auto SX-104 05/95 Auto TX-116 05/98 Auto TX-117 05/98 Auto TX-117 05/98 Auto TX-118 03/98 Auto TX-117 05/98 Auto TX-117 05/98 Auto TX-117 05/98 Auto TX-118 03/98 Auto TX-119 03/98 Auto TX-106 TX-108 AP-101			***				- 🚟	X4			***				
P-103	AP-102	 									******	**			
P-104 BY-101 SX-105 OS/95 Auto TX-117 OS/96 Auto TX-118 OS/96 Auto TX-118 OS/96 Auto TX-118 OS/96 Auto TX-107 TX-101 OS/95 Auto TX-107 TX-101 OS/95 Auto TX-101 OS/95 Auto TX-101 OS/95 Auto TX-102 OS/95 Auto TX-102 OS/95 Auto TX-103 OS/95 Auto TX-103 OS/95 Auto TX-103 OS/95 Auto TX-104 OS/95	AP-103							-	*			***			
P-106 BY-102 SX-108 G8/94 Auto TX-118 O3/98 Auto Auto TX-118 O3/98 Auto BY-106 BY-103 12/96 Manual SX-107 TY-101 O7/96 Auto Auto TX-118 O3/98 Auto SX-107 TY-101 O7/96 Auto Auto BY-106 SX-108 SX-108 TY-102 O9/95 Auto Auto BY-106 SX-108 TY-103 O9/95 Auto Auto BY-106 SX-110 TY-104 O6/95 Auto Auto BY-107 SX-111 TY-105 12/95 Auto Auto BY-107 SX-111 TY-106 12/95 Auto Auto BY-108 SX-108 SX-112 TY-106 12/95 Auto Auto BY-108 SX-114 U-101 Auto BY-108 SX-114 U-102 O1/96 Manual Auto BY-108 SX-114 U-102 O1/96 Manual Auto BY-108 SX-114 U-102 O1/96 Manual Auto BY-108 SY-101 O7/94 Auto U-104 Auto BY-108 SY-101 O7/94 Auto U-104 Auto U-105 O7/94 Auto U-104 Auto U-105 O7/94 Auto U-106 O7/94 Auto U-106 O7/94 Auto U-106 O7/94 Auto U-106 O7/94 Auto U-108 O7/95 Auto O7/95 Auto U-108	AP-104	<u> </u>		*]	30,00	Auto	₩	*			 			
P-106 BY-103 12/96 Manual SX-107 Ty-101 07/95 Auto Auto BY-104 SX-108 SX-108 Ty-102 09/95 Auto BY-106 SX-108 SX-109 09/98 Auto Ty-103 09/95 Auto Auto BY-106 SX-108 SX-110 Ty-104 06/95 Auto Auto BY-107 SX-111 Ty-105 12/95 Auto Auto BY-108 SX-112 Ty-106 12/95 Auto Auto BY-108 SX-112 Ty-106 12/95 Auto Auto BY-108 SX-113 U-101 Ty-104 U-102 U-104 U-105 U-104 U-104 U-105 U-104 U-104 U-105	AP-105								-			## ##			
P-107	AP-106			*		12/96	Manual		*	00/04	Auto				
P-108	AP-107								*			 			
W-101 08/95	AP-108				BY-105					09/98	Auto	 (2000)			
M-102 05/96 Auto BY-107 SX-111 TY-106 12/95 Auto Auto BY-108 SX-112 TY-106 12/95 Auto Auto BY-108 SX-112 TY-106 12/95 Auto Auto BY-109 SX-113 U-101 W-105 O6/96 Auto BY-110 2/97 Manual SX-114 U-102 O1/96 Manual W-106 O6/96 Auto BY-111 2/97 Manual SX-115 U-103 O7/94 Auto W-106 O6/96 Auto BY-111 2/97 Manual SX-115 U-103 O7/94 Auto W-106 O7/94 Auto W-106 O7/95 Auto W-107 O7/95 Auto W-107 O7/95 Manual W-107 O7/95 Man	AW-101	08/95	Auto		BY-106				7			 			
M-103 O5/96 Auto BY-108 SX-112 TY-106 12/95 Auto Auto BY-109 SX-113 U-101 Manual M-106 O6/96 Auto BY-110 2/97 Manual SX-115 U-103 O7/94 Auto Auto BY-111 2/97 Manual SX-115 U-103 O7/94 Auto Auto BY-111 Z/97 Manual SX-115 U-103 O7/94 Auto C-101 SY-102 O6/94 Manual U-105 O7/94 Auto C-103 O8/95 Auto C-101 SY-102 O6/94 Manual U-105 O7/94 Auto C-103 O8/94 Auto C-103 O8/94 Auto C-103 O8/94 Auto C-104 T-102 O6/94 Auto U-108 O8/94 Auto C-101 O3/96 Auto C-104 T-102 O6/94 Auto U-108 O5/95 Auto C-104 O8/96 Auto C-105 O5/98 Manual U-107 O8/94 Auto C-101 O8/96 Auto C-104 T-102 O6/94 Auto U-108 O5/95 Auto C-104 O8/96 Auto C-105 O5/98 Manual U-107 O8/94 Auto C-105 O5/98 Manual U-109 O7/94 Auto U-108 O5/95 Auto C-101 O8/96 Auto C-106 O2/96 Auto T-104 T-105 O7/95 Manual U-110 O1/96 Manual U-100 U-100 U-100 O1/96 Manual U-100 U-100 O1/96 Manual U-100	AW-102	05/96	Auto		BY-107				SX-111			***			
N-104 01/96	AW-103	05/96	Auto		BY-108				SX-112			 			-
M-106 O6/96	AW-104	01/96	Auto	***	BY-109			×	SX-113			***	U-101		
SY-101 O9/95 Auto BY-112 SY-101 O7/94 Auto U-104 Auto U-104 Auto U-102 O9/98 Auto C-101 SY-102 O6/94 Manual U-105 O7/94 Auto C-103 O9/95 Auto C-102 SY-103 O7/94 Auto U-106 O6/94 Auto U-106 O6/94 Auto U-107 O8/94 Auto C-104 O5/95 Manual U-107 O8/94 Auto U-108 O6/95 Auto U-109 O7/94 Auto U-109 O7/95 Manual U-110 O1/96 Manual U-110 O1/96 Manual U-109 O7/95 Manual U-201 O7/95	AW-105	06/96	Auto	***	BY-110	2/97	Manual		SX-114			₩	U-102	01/96	Manual
C-102 09/98 Auto C-101 SY-102 06/94 Manual U-105 07/94 Auto C-103 09/95 Auto C-102 SY-103 07/94 Auto U-106 08/94 Auto C-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto C-104 T-102 06/94 Auto U-108 05/95 Auto C-105 O5/95 Auto T-104 T-103 O7/95 Manual U-109 O7/94 Auto U-109 O7/94 Auto U-108 C-104 T-104 T-104 T-105 O7/95 Manual U-110 O1/96 Manual U-111 O1/96 Manual U-101 O1/96 Manual U-109 O7/95 Manual U-111 O1/96 Manual U-101 O1/96 Manual U-101 O1/96 Manual U-101 O1/96 Manual U-108 O7/95 Manual U-108 O7/95 Manual U-108 O7/95 Manual U-108 O7/95 O7/95 Manual U-108 O7/95 O7/95 O7/95 Manual U-108 O7/95 O7/9	AW-106	06/96	Auto	***	BY-111	2/97	Manual		SX-115			Ŵ	U-103	07/94	Auto
C-103	AX-101	09/95	Auto	**	BY-112				SY-101	07/94	Auto		U-104		
C-104 10/96 Auto C-103 08/94 Auto T-101 05/95 Manual U-107 08/94 Auto C-101 03/96 Auto C-104 T-102 06/94 Auto U-108 05/95 Auto C-102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto C-101 08/96 Manual C-106 02/98 Auto T-104 12/95 Manual U-110 01/96 Manual U-110 01/96 Manual U-110 01/96 Manual U-102 U-102 U-102 U-108 U-108 U-110 U-108 U-111 U-108 U-109	AX-102	09/98	Auto		C-101				SY-102	06/94	Manual	8	U-105	07/94	Auto
T-101 03/96	AX-103	09/95	Auto	**	C-102				SY-103	07/94	Auto	8	U-106	08/94	Auto
102 01/98 Auto C-105 05/96 Manual T-103 07/95 Manual U-109 07/94 Auto C-101 08/96 Manual C-106 02/98 Auto T-104 12/95 Manual U-110 01/96 Manual C-102 C-107 04/95 Auto T-105 07/95 Manual U-111 01/98 Manual U-111 01/98 Manual U-111 01/98 Manual U-112 U-102 U-102 U-103 U-104 U-105 U	AX-104			***		08/94	Auto			05/95	Мапиаі		U-107	08/94	Auto
C-101 OB/96 Manual C-108 O2/98 Auto T-104 12/95 Manual U-110 O1/96 Manual U-102 O1/96 Manual U-103 O1/96 Manual U-111 O1/96 Manual U-102 O1/96 Manual U-112 O1/96 Manual U-112 O1/96 Manual U-102 O1/95 Manual U-103 O1/96 Manual U-103 O1/96 Manual U-103 O1/96 Manual U-203 O1/96 Manual U-204 O1/96 O1/96 Manual U-204 O1/96	AY-101								T-102	06/94	Auto	**	U-108	05/95	Auto
C-102	AY-102											▓	U-109	07/94	Auto
101	AZ-101	08/96	Manual									****		01/96	Manual
102 02/95 Manual C-109 T-107 06/94 Auto U-201 103 C-110 T-108 10/95 Manual U-202 104 C-111 T-109 09/94 Manual U-203 09/98 Manual 105 C-112 03/96 Manual T-110 05/95 Auto U-204 6/98 Manual 106 C-201 T-111 07/95 Manual 107 C-202 T-112 09/96 Manual 108 C-203 T-201 109 C-204 T-202 110 T-203 111 T-204 112 03/95 Manual Total West Area: 69	AZ-102			2000 2000		04/95	Auto					ж.		01/96	Manual
103		02/05	Manual	****				₩				****			
104		02/95	Maridar	***								***			
105				***				₩							
106	3-105			****		03/96	Manual								
107. C-202 T-112 09/96 Manual 108 C-203 T-201 T-201 T-202 T-203 T-203 T-203 T-203 T-203 T-203 T-203 T-203 T-204 T-203 T-204 T-	3-106				$\overline{}$	03/30	mailudi	888				***	0-204	6/98	Manuai
	-107								ightarrow						
105	3-108			*****					-	00,00	munudi	*			
110	3-105	+		mm					} 			8			
111 T-204 T-	3-110											₩			
112 03/95 Manual Total West Area: 69	3-111			▓							<u>_</u>	*			
tal East Area: 43 Total West Area: 69	-112	03/95	Manual									*			
			***********	8335	L				7-6-1 151	4 22		***	I		
			. 00		م در دالمما		100 00	888			•				

¹¹² ENRAFs installed: 82 automatically entered into TMACS, 30 manually entered into CASS

TABLE A-8. TANK MONITOR AND CONTROL SYSTEM (TMACS) February 28, 1999

Note: Indicated below are the number of tanks having at least one operating sensor (some tanks have more than one sensor: multiple sensors of the same type in a tank are not shown in the table) for example: 10 tanks in BY-Farm have at least one operating TC sensor and 3 tanks in BY-Farm have at least one operating RTD sensor.

Acceptance Testing Completed: Sensors Automatically Monitored by TMACS

	Temper					
ļ		Resistance		l	ļ	Į.
EAST AREA	Thermocouple	Thermai	ENRAF		1	Gas
	Tree	Device	Level	Pressure	Hydrogen	Sample
Tank Farm	(TC)	(RTD)	Gauge	(b)	(c)	Flow
A-Farm (6 Tanks)	1		3	137	1	1
AN-Farm (7 Tanks)	7		4	7	3	3
AP-Farm (8 Tanks)						
AW-Farm (6 Tanks)	6		6		1	1
AX-Farm (4 Tanks)	3		4		1	i
AY-Farm (2 Tanks)	1.		2			
AZ-Farm (2 Tanks)						
B-Farm (16 Tanks)	1					
BX-Farm (12 Tanks)	11		12			
BY-Farm (12 Tanks)	10	3				
C-Farm (16 Tanks)	15	1	3	1		
TOTAL EAST AREA			<u></u>]		
(91 Tanks)	54	4	34		6	5
WEST AREA						
S-Farm (12 Tanks)	12		6	1	3	3
SX-Farm (15 Tanks)	14		7	1	7	7
SY-Farm (3 Tanks) (a)	. 3		2	1	2	2
T-Farm (16 Tanks)	14	1	3		1	1
TX-Farm (18 Tanks)	13		18			
TY-Farm (6 Tanks)	6	3	6			
U-Farm (16 Tanks)	15		6	4	6	6
TOTAL WEST AREA						
(86 Tanks)	81	44	48	7	19	19
TOTALS (177 Tanks)	131	88	82	15	25	24

⁽a) Tank SY-101 has 2 gas sample flow sensors plus 2 vent flow sensors, and 2 ENRAFs.

⁽b) Each tank has two sensors (high and low range)

⁽c) Each tank has two sensors (high and low range)

APPENDIX B

DOUBLE SHELL TANK WASTE TYPE AND SPACE ALLOCATION

B-2

TABLE B-1. DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION

FEBRUARY 1999

DOUBLE-SHELL TANK INVENTORY	BY WASTE TYPE	SPACE DESIGNATED FOR SPECIFIC US	SE .
Complexed Waste (AN-102, AN-106, AN-107, SY-101, SY-103, (AY-101 , AP-108 (DC))	3.72 Mgal	Spare Tanks (3) (1 Aging & 1 Non-Aging Waste Tank)	2.28 Mgal
Concentrated Phosphate Waste (AP-102)	1:09 Mgal	Watch List Tank Space (AN-103, AN-104, AN-105, AW-101, SY-101, SY-103)	0.66 Mgal
Double-Shell Slurry and Slurry Feed (AN-103, AN-104, AN-105, AP-101, AW-101, AW-106)	4.4 Mgal	Restricted Tank Space (AN-102, AN-107, AP-102, AZ-101, AZ-102	0.43 Mgal
Aging Waste (NCAW) at 5M Na Dilute in Aging Tanks (AZ-101, AZ-102)	1;23 Mgal 0;38 Mgal	Receiver/Operational Tank Space (2) (AP-106, AP-108, AW-102, AW-106, SY-102)	3.31 Mgal
Dilute Waste (1) (AN-101, AP-103, AP-105, AP-104, AP-106, AP-107 AW-102, AW-103, AW-104, AW-105, AY-102, SY-102)	4.04 Mgal	Total Specific Use Space (02/28/99)	6.68 Mgal
		TOTAL DOUBLE-SHELL TANK SPACE	
NCRW, PFP and DST Settled Solids (All DSTs)	4.04 Mgal	24 Tanks at 1140 Kgal 4 Tanks at 980 Kgal	27.36 Mgal 3.92 Mgal 31.28 Mgal
Total inventory=	18.9 Mgal	Total Available Space Double-Shell Tank Inventory Space Designated for Specific Use Remaining Unallocated Space	31.28 Mgal 18.9 Mgal 6.68 Mgal 5.70 Mgal

WVPTOT

- (1) Was reduced in volume by -0.00 Mgal this month (Evaporator WVR)
- (2) Tank Space Reduced by Facility Generations and Saltwell Liquid pumping
- (3) 241-AY-101: A minumum liquid level is set to provide extra protection against any bottom uplifting of the tank's steel liner. Because of space availability, waste is stored in AY-102, the aging waste spare tank. In case of a leak the contents of AY-102 will be distributed to any other DST(s) having available space.

Note: Net change in total DST inventory since last month: +0.043 Mgal

TOTAL DST SPACE AVAILABLE

Table B-2. Double Shell Tank Waste Inventory for February 1999

TANKS	INVENTORY	SOLIDS	TYPE	LEFT
AN-101=	158	33	DN	982
AN-102=	1062	89	CC	78
AN-103=	956	410	DSS.	184
AN-104=	1052	449	DSSF	88
AN-105=	1128	489	DSSF	14
AN-106=	39	17	CC	1101
AN-107=	1045	247	CC	95
AP-101=	1114	0	DSSF	26
AP-102=	1092	0	CP	48
AP-103=	25	1	DN	1115
AP-104≃	24	0	DN	1116
AP-105=	767	89	DSSF	373
AP-106=	94	0	DN	1046
AP-107=	22	0	DN	1118
AP-108=	97	0	DN	1043
AW-101=	1124	306	DSSF	16
AW-102=	1046	40	DN	94
AW-103=	510	348	NCRW	630
AW-104≖	1118	231	DN	22
AW-105≖	431	280	NCRW	709
AW-106=	579	228	CC	581
AY-101=	165	108	DC	815
AY-102=	466	32	DN	514
AZ-101=	848	47	NCAW	134
AZ-102=	909	104	NCAW	71
SY-101=	1182	41	CC	-42
SY-102=	1097	88	DN/PT	43
SY-103=	741	362	cc _	399
TOTAL*	18887	4039		12393

NOTE: Solids Adjusted to Most Current Available Data NOTE: All Volumes in Kilo-Gallons (Kgals)

NON-AGING = AGING =	27360 3920	01/99 TOTAL 02/99 TOTAL	18 18
TOTAL*	31280	INCREASE	10
-,		USABLE SPACE	
		AN-101=	
		AN-106=	1
WATCH LIST	SPACE	AP-101=	
AN-103≃	184	AP-103=	1
AN-104≃	88	AP-104=	1
AN-105=	14	AP-105=	
AW-101=	16	AP-107=	t
SY-101=	-42	AW-102=	
SY-103=	399	AW-103=	
TOTAL=	659	AW-104=	
	_	AW-105=	
RESTRICTED SPACE	(CC,CP,AW)	AW-106=	
AN-102=	78	AY-101=	:
AN-107#	95	AY-102=	:
AP-102=	48	TOTAL=	9:
AZ-101=	134	EVAP. OPERATIONS	-1'
AZ-102=	71	SPARE SPACE	-22
TOTAL=	426	USABLE LEFT=	57

1046

1043

2132

01/99 TOTAL SPACE

02/99 TOTAL SPACE

01/99 TOTAL SPACE

02/99 TOTAL SPACE

CHANGE#

CHANGE=

WASTE RECEIVER SPACE CHANGE

Inventory Calculation by Waste Type:

COMPL	EXED WASTE
AN-102=	973 (CC)
AN-106=	22 (CC)
AN-107=	798 (CC)
AW-106=	351 (CC)
AY-101=	57 (DC)
SY-101=	1141 (CC)
SY-103=	379 (CC)
TOTAL DG/CC=	3721
TOTAL SOLIDS*	1092

NCRV	SOLIDS (PD)
AW-103=	348
AW-105=	280
TOTAL*	628

SOLIDS (PT)
88
88

	CONCENTRATED PHOSPHATE (CP)
102-AP=	1092
TOTAL=	1092

DILUTE WAS	TE (DN)
AN-101=	125
AP-103=	24
AP-104=	24
AP-106=	94
AP-107=	22
AP-108=	97
AW-102=	1008
AW-103=	162
AW-104=	887
AW-105=	151
AY-102=	434
SY-102=	1009
TOTAL DN=	4035
TOTAL SOLIDS=	237

AP-106 (200E/DN)=

AP-108 (200E/DN)=

SY-102 (200W/DN)=

TOTAL

NCAW (AGING WASTE) (@ 5M Na) AZ-101= 79					
791					
434					
1225					
379					
151					

DS	S/DSSF
AN-103=	546
AN-104=	603
AN-105=	637
AP-101=	1114
AP-105=	678
AW-101=	818
TOTAL DSS/DSSF#	4396
TOTAL SOLIDS=	1743

5755

5756

2171

2132

-39

DST INVENTORY CHANGE

GRAND TOTALS	
NCRW SOLIDS=	628
DST SOLIDS=	3172
PFP SOLIDS=	88
AGING SOLIDS≃	151
CC =	3864
DC=	57
CP=	1092
NCAW=	1604
DSS/DSSF=	4396
DILUTE=	4035
TOTAL*	18887

NOTE: Tank AW-106 (evaporator receiver) has Concentrated Complexed (CC) waste in it and will be transferred to Tank 106-AN.

Table B-2. Double Shell Tank Waste Inventory for February 28, 1999

TOTAL AVAILABLE SPACE AS O	F FEBRUAF	RY 28, 1999:	12393	KGALS
WATCH LIST TANK SPACE:	TANK	WASTE TYPE	AVAILABLE	SPACE
Unusable DST Headspace - Due to Special Restrictions	AN-103			KGALS
Placed on the Tanks, as Stated in the "Wyden Bill"	AN-104			KGALS
•	AN-105			KGALS
	AW-101			KGALS
	SY-101			KGALS
•	SY-103			KGALS
,		TOTAL=	659	KGALS
		AVAILABLE TANK SPACE=	12393	KGALS
		IUS WATCH LIST SPACE=		KGALS
TOTAL AVAILABLE SPACE AFTER WA	ATCH LIST	SPACE DEDUCTIONS=	11734	KGALS
RESTRICTED TANK SPACE:	TANK	WASTE TYPE	AVAILABLE	SPACE
DST Headspace Available to Store Only Specific Waste T	ypes			
	AN-102	CC	78	KGALS
	AN-107	CC	95	KGALS
•	AP-102	CP	48	KGALS
	AZ-101			KGALS
	AZ-102			KGALS
		TOTAL=	426	KGALS
AVAILABLE SPACE	E AFTER W	ATCH LIST DEDUCTIONS=	11734	KGALS
	MINU	S RESTRICED SPACE=	-426	KGALS
TOTAL AVAILABLE SPACE AFTER RES	STRICTED S	PACE DEDUCTIONS=	11308	KGALS
USABLE/WASTE RECEIVER TANK SPACE:	TANK	WASTE TYPE	AVAILABLE	SPACE
DST Headspace Available to Store Facility Generated	ÄN-101		982	KGALS
and Evaporator Product Waste	AN-106	CC	1101	KGALS
	AP-101		26	KGALS
•	AP-103	DN	1115	KGALS
	AP-104	DN	1116	KGALS
	AP-105			KGALS
FACILITY WASTE RECEIVER TANK	AP-106			KGALS
	AP-107	DN	1118	KGALS
FACILITY WASTE RECEIVER TANK	AP-108	DC		KGALS
EVAPORATOR FEED TANK	AW-102	DN		KGALS
	AW-103	•		KGALS
	AW-104			KGALS
	AW-105			KGALS
EVAPORATOR RECEIVER TANK	AW-106			KGALS
	AY-101			KGALS
	AY-102			KGALS
FACILITY WASTE RECEIVER TANK	SY-102			KGALS
TOTAL	AVAILABL	E USABLE TANK SPACE=	11308	KGALS
EVAPORATOR OPERATIONAL TANK SPACE:				KGALS
SPARE TANK SPACE: (DOE Order 5820.2A)			-2280	KGALS
TOTAL TANK SPACE AVAILABLE AFTER AL	L DEDUCT	IONS#	7888	KGALS

SEG0299

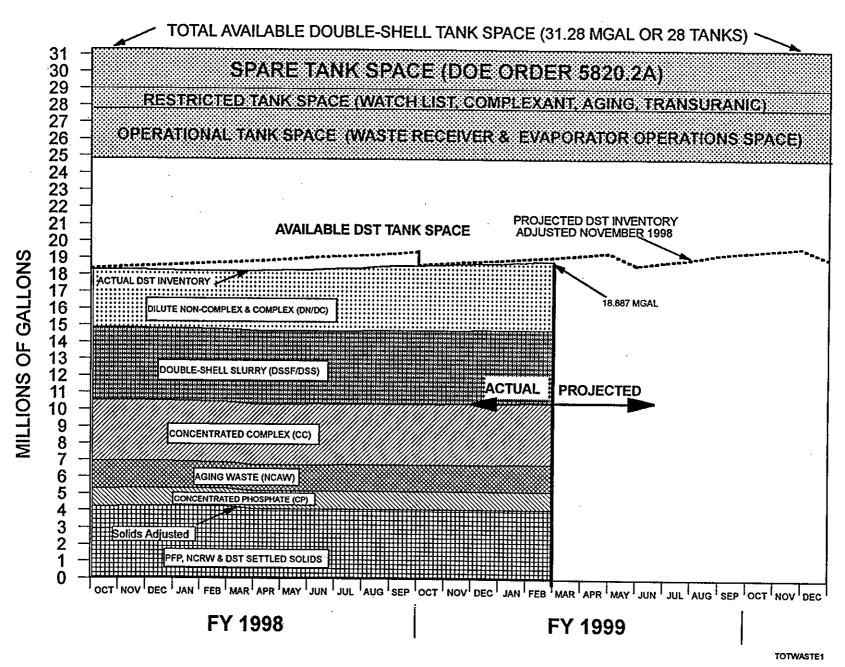


FIGURE B-1. TOTAL DOUBLE-SHELL TANK INVENTORY

This page intentionally left blank

APPENDIX C

TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS

C. TANK AND EQUIPMENT CODE/STATUS DEFINITIONS February 28, 1999

1. TANK STATUS CODES

WASTE TYPE (also see definitions, section 3)

AGING Aging Waste (Neutralized Current Acid Waste [NCAW])
CC Complexant Concentrate Waste

CP Concentrated Phosphate Waste
DC Dilute Complexed Waste
DN Dilute Non-Complexed Waste

DSS Double-Shell Slurry
DSSF Double-Shell Slurry Feed
NCPLX Non-Complexed Waste

PD/PN Plutonium-Uranium Extraction (PUREX) Neutralized Cladding

Removal Waste (NCRW), transuranic waste (TRU)

PT Plutonium Finishing Plant (PFP) TRU Solids

TANK USE (DOUBLE-SHELL TANKS ONLY)

CWHT Concentrated Waste Holding Tank

DRCVR Dilute Receiver Tank
EVFD Evaporate Feed Tank
SRCVR Slurry Receiver Tank

2. SOLID AND LIQUID VOLUME DETERMINATION METHODS

- F Food Instrument Company (FIC) Automatic Surface Level Gauge
- E ENRAF Surface Level Gauge (being installed to replace FICs)
- M Manual Tape Surface Level Gauge
- P Photo Evaluation
- S Sludge Level Measurement Device

3. DEFINITIONS

WASTE TANKS - GENERAL

Waste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition.

Watch List Tank

An underground storage tank containing waste that requires special safety precautions because it may have a serious potential for release of high level radioactive waste because of uncontrolled increases in temperature or pressure. Special restrictions have been placed on these tanks by "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the *National Defense Authorization Act for Fiscal Year 1991*, November 5, 1990, Public Law 101-510, (also known as the Wyden Amendment).

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to insure safe storage and interim operation, and ultimate disposition of the waste.

WASTE TYPES

Aging Waste (AGING)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW)

Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste.

Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants: ethylenediaminetetra-acetic acid (EDTA), citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA), being the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from T and S Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernate).

Double-Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

Non-complexed (NCPLX)

General waste term applied to all Hanford Site (NCPLX) liquors not identified as complexed.

PUREX Decladding (PD)

PUREX Neutralized Cladding Removal Waste (NCRW) is the solids portion of the PUREX plant neutralized cladding removal waste stream; received in Tank Farms as a slurry. NCRW solids are classified as transuranic (TRU) waste.

PFP TRU Solids (PT)

TRU solids fraction from PFP Plant operations.

Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces, and will therefore migrate or move by gravity. (See also Section 4)

Supernate

The liquid above the solids in waste storage tanks. (See also Section 4)

Ferrocyanide

A compound of iron and cyanide commonly expressed as FeCN. The actual formula for the ferrocyanide anion is [Fe(CN)₆]⁻⁴.

INTERIM STABILIZATION (Single-Shell Tanks only)

Interim Stabilized (IS)

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant liquid. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow must also have been at or below 0.05 gpm before interim stabilization criteria is met.

Jet Pump

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 gallons to about 4 gpm.

Saltwell Screen

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches.

Emergency Pumping Trailer

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure (WFIE) with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

INTRUSION PREVENTION (ISOLATION) Single-Shell Tanks only

Partially Interim Isolated (PI)

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

Interim Isolated (II)

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993, Interim Isolation was replaced by Intrusion Prevention.

Intrusion Prevention (IP)

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" - provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusuable equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

TANK INTEGRITY

Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicates a <u>new</u> loss of liquid attributed to a breach of integrity.

TANK INVESTIGATION

Intrusion

A term used to describe the infiltration of liquid into a waste tank.

SURVEILLANCE INSTRUMENTATION

Drywells

Drywells are vertical boreholes with 6-inch (internal diameter) carbon steel casings positioned radially around SSTs. These wells range between 50 and 250 feet in depth, and are monitored between the range of 50 to 150 feet. The wells are sealed when not in use. They are called drywells because they do not penetrate to the water table and are therefore usually "dry." There are 759 drywells.

Monitoring is done by gamma radiation or neutron-moisture sensors to obtain scan profiles of radiation or moisture in the soil as a function of well depth, which could be indicative of tank leakage.

Two single-shell tanks (C-105 and C-106) are currently monitored monthly by gamma radiation sensors. The remaining drywells are monitored on request by gamma radiation sensors. Monitoring by neutron-moisture sensors is done only on request.

Laterals

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

Surface Levels

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System (SACS).

Automatic FIC

An automatic waste surface level measurement device is manufactured by the Food Instrument Company (FIC).

The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape

HNF-EP-0182-131

reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and, until February 1999, the majority of the FICs transmitted readings to CASS. Since CASS retirement, all FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

ENRAF 854 ATG Level Detector

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the Tank Monitor and Control System (TMACS). The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

Annulus

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

Liquid Observation Well (LOW)

In-tank liquid observation wells are used for monitoring the interstitial liquid level (ILL) in single-shell waste storage tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL, a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends and have a nominal outside diameter of 3.5 inches. Two probes are used to monitor changes in the ILL; gamma and neutron, which can indicate intrusions or leakage by increases or decreases in the ILL. There are 65 LOWs (64 are in operation) installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid, and in two DSTs only. The LOWs installed in two DSTs, (SY-102 and AW-103 tanks), are used for special, rather than routine, surveillance purposes only.

Thermocouple (TC)

A thermocouple is a thermoclectric device used to measure temperature. More than one thermocouple on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are thermocouple elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed. A single thermocouple (probe) may be installed in a riser, or lowered down an existing riser or LOW. There are also four thermocouple laterals beneath Tank 105-A in which temperature readings are taken in 34 thermocouples.

In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

TERMS/ACRONYMS

CASS Computer Automated Surveillance System - this system was retired in February 1999

CCS Controlled, Clean and Stable (tank farms)

П Interim Isolated

 \mathbf{I} Intrusion Prevention Completed

<u> IS</u> Interim Stabilized

MT/FIC/ENRAF Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)

OSD Operating Specifications Document

PΙ Partial Interim Isolated

SAR Safety Analysis Reports

SHMS Standard Hydrogen Monitoring System

TMACS Tank Monitor and Control System

TPA Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology,

U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment, 1994

(Tri-Party Agreement)

USQ Unreviewed Safety Question

"Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510.

4. INVENTORY AND STATUS BY TANK - VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE E-6 (SINGLE-SHELL TANKS)


COLUMN HEADING	COLUMN VOLUME CALCULATIONS/DEFINITIONS
Total Waste	Solids volume plus Supernatant liquid. Solids include sludge and saltcake (see definitions below)
Supernate Liquid	Drainable Liquid Remaining minus Drainable Interstitial. Supernate is the liquid floating on the surface of the waste. Supernate is usually derived by subtracting the solids level measurement from the liquid level measurement. In some cases, the supernatant volume includes floating solid crusts because their volume cannot be measured. In-tank photographs or videos are useful in estimating the liquid volumes; the area of solids covered and the average depth can be estimated.
Drainable Interstitial Liquid	Drainable Liquid Remaining minus Supernate. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using calculated porosity values from past pumping or actual data for each tank, when available. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. Drainable interstitial liquid is calculated based on the saltcake and sludge volumes in the tank. The sum of the interstitial liquid contained in saltcake and sludge is the initial volume of drainable interstitial liquid. The volume reported as Drainable Interstitial Liquid is the initial volume of drainable interstitial liquid minus interstitial liquid removed by pumping.

HNF-EP-0182-131

COLUMN HEADING	COLUMN VOLUME CALCULATIONS/DEFINITIONS
Pumped This Month	Net total gallons of liquid pumped from the tank during the month. If supernate is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume. The total pumped volume is subtracted from drainable liquid remaining and pumpable liquid remaining. Pump production takes into account the amount of water added to the tank during the month (if any).
Total Pumped	Cumulative net total gallons of liquid pumped from 1979 to date.
Drainable Liquid Remaining	Supernate plus Drainable Interstitial. (See Supernatant Liquid and Drainable Interstitial Liquid above for definitions). The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernate minus total gallons pumped.
Pumpable Liquid Remaining	Drainable Liquid Remaining minus undrainable heel volume. (Dish bottom tanks have a "heel" where liquids can collect: flat bottom tanks do not). (See Drainable Liquid Remaining and Pumped this Month for definitions). Not all drainable interstitial liquid is pumpable. It is assumed that drainable interstitial liquid on top of the undrainable heel in sludge or saltcake, is not jet pumpable. Therefore, pumpable interstitial liquid is the initial volume of drainable interstitial liquid minus the amount of interstitial liquid on top of the heel. The volume shown as Pumpable Liquid Remaining is the sum of pumpable interstitial liquid and supernate minus total gallons pumped.
Sludge	Solids formed during sodium hydroxide additions to waste. Sludge usually was in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator. If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	Indicates the latest update of any change in the solids volume.
Solids Update Source - See Footnote	Indicates the source or basis of the latest solids volume update.
Last In-tank Photo	Date of last in-tank photographs taken.
Last In-tank Video	Date of last in-tank video taken.
See Footnotes for These Changes	Indicates any change made the previous month. A footnote explanation for the change follows the Inventory and Status by Tank section (Table E-6).

APPENDIX D

TANK FARM CONFIGURATION, STATUS, AND FACILITY CHARTS

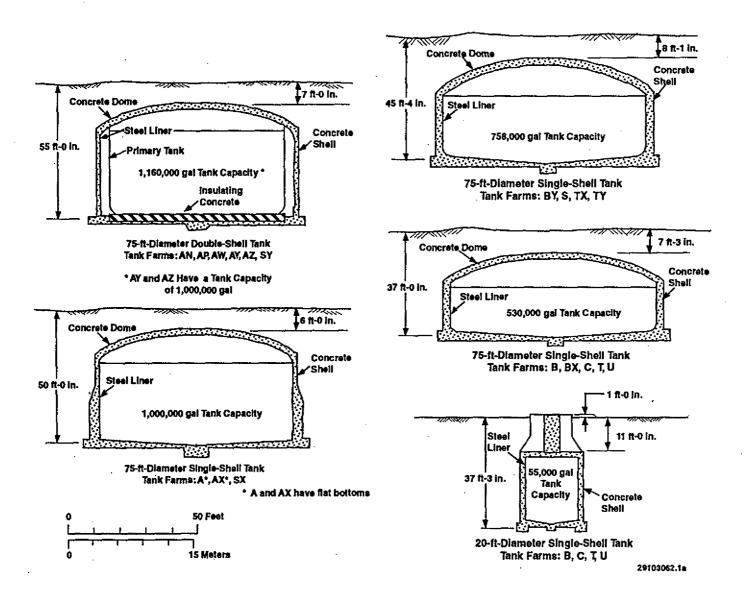

HNF-EP-0182

FIGURE D-1. HIGH-LEVEL WASTE TANK CONFIGURATION


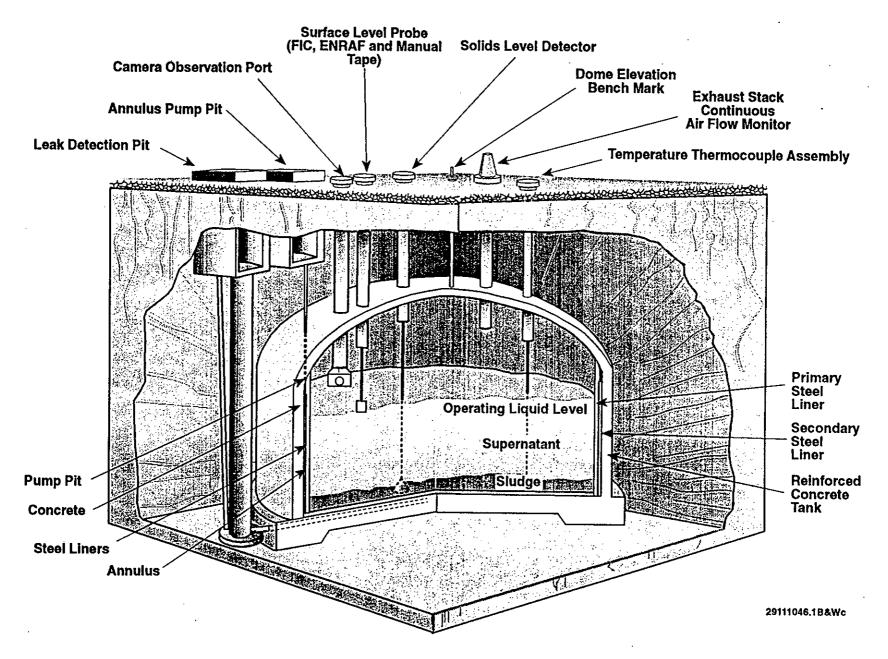


FIGURE D-2. DOUBLE-SHELL TANK INSTRUMENTATION CONFIGURATION

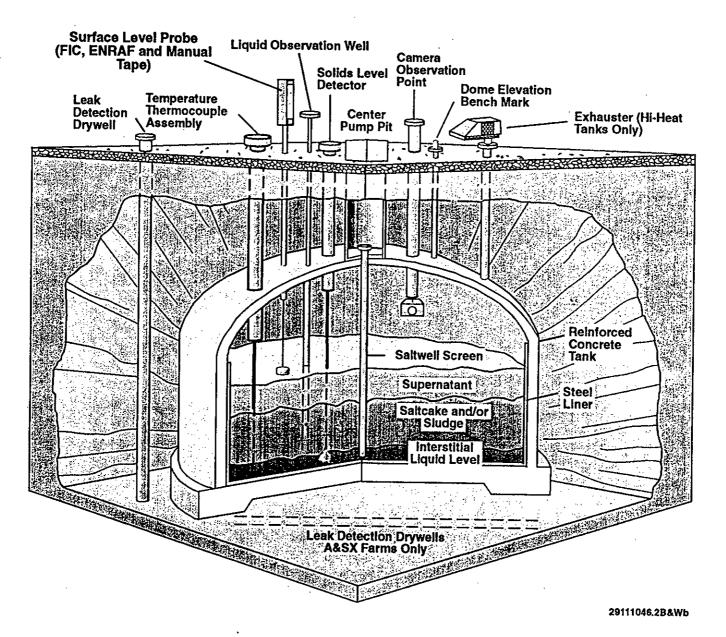

HNF-EP-0182

FIGURE D-3. SINGLE-SHELL TANK INSTRUMENTATION CONFIGURATION

THE HANFORD TANK FARM FACILITY CHARTS (colored foldouts) ARE ONLY BEING INCLUDED IN THIS REPORT ON A QUARTERLY BASIS

(i. e., months ending March 31, June 30, September 30, December 31)

NOTE: COPIES OF THE FACILITY CHARTS CAN BE OBTAINED FROM
DENNIS BRUNSON, MULTI-MEDIA SERVICES,
376-2345, G3-51

ALMOST ANY SIZE IS AVAILABLE, AND CAN BE LAMINATED.

P-Card required

This page intentionally left blank

APPENDIX E

MONTHLY SUMMARY
TANK USE SUMMARY
PUMPING RECORD, LIQUID STATUS AND PUMPABLE
LIQUID REMAINING IN TANK FARMS
INVENTORY SUMMARY BY TANK FARM
INVENTORY AND STATUS BY TANK

TABLE E-1. MONTHLY SUMMARY

TANK STATUS

February 28, 1999

	200	200	
•	EAST AREA	WEST AREA	TOTAL.
IN SERVICE	25	03	28 (1)
OUT OF SERVICE	66	83	149
SOUND	59	51	110
ASSUMED LEAKER	32	35	67
INTERIM STABILIZED	60	59	119 (2)
ISOLATED			
PARTIAL INTERIM	11	30	41
INTRUSION PREVENTION COMPLETE	55	53	108
CONTROLLED, CLEAN, AND STABLE	12	24	36

		WASTE VOI	LUMES (Kgall	ons)			
		200	200	1600.00	SST	DST	
		EAST AREA	WEST_AREA	TOTAL	IANKS	TANKS	TOTA
SUPERN	<u>ATANT</u>						
AGING	Aging waste	1604	0	1604	0	1604	1604
CC	Complexant concentrate waste	2147	1516	3663	3	3660	3663
CP	Concentrated phosphate waste	1092	0	1092	0	1092	1092
DC	Dilute complexed waste	1161	0	1161	1	1160	1161
DN	Dilute non-complexed waste	1620	. 0	1620	0	1620	1620
DN/PD	Dilute non-complex/PUREX TRU solid	313	0	313	0	313	313
DN/PT	Dilute non-complex/PFP TRU solids	0	1009	1009	0	1009	1009
NCPLX	Non-complexed waste	157	473	630	630	0	630
DSSF	Double-shell slurry feed	5299	48	5347	951	4396	5347
TOTAL	SUPERNATANT	13393	3046	16439	1585	14854	16439
SOLIDS	- seed and another indicators 15 to 15 and page - 1 for 1611 and all control of the another indicators and the another indicators	rombisäddet (standa as an arma testathod i debbit definitionen i dalet (contrated elimination seatched and entering of a	ez, .u. e Pervenenenenenenenentirentirentirentenen	1.1000/1988 11.53883/1989/1989/5/19884/1988 (1988	entreferingstististers, serenger et seren strikt in	Sizeron deleges resectoral
Double	e-shell slurry	410	0	410	0	410	410
Sludge	0	9334	6242	15576	12032	3544	15576
Saltca	ike	5188	16390	21578	21499	79	21578
TOTA	L SOLIDS	14932	22632	37564	33531	4033	37564
ТО	TAL WASTE	28325	25678	54003	35116	18887	54003
AVAILA	BLE SPACE IN TANKS	11993	442	12435	0	12435	12435
DRAINAI	BLE INTERSTITIAL	1861	4584	6445	6163	282	6445
DRAINAI	BLE LIQUID REMAINING	15205	7654	22859	7723	15136	22859

(1) Includes six double-shell tanks on Hydrogen Watch List not currently allowed to receive waste, AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103.

(2) Includes one tank (B-202) which does not meet current established supernatent and interstitial liquid stabilization criteria.

TABLE E-2. TANK USE SUMMARY February 28, 1999

	TARIVO AVAU ADI E				ISOLATED TA	NKS		
TANK FARMS	TANKS AVAILABLE TO RECEIVE WASTE TRANSERS	SOUND	ASSUMED <u>LEAKER</u>	PARTIAL INTERIM	INTRUSION PREVENTION COMPLETED	CONTROLLED CLEAN, AND STABLE	INTERIM TABILIZED TANKS)
EAST:								
A	0	3	3	2	4	o	-	
AN	7 (1)	7	0	ō	0	U	5	
AP	8	8	0	Õ	ŏ		0	
AW	6 (1)	6	0	ŏ	ő		0	
AX	0	2	2	1	3		•	
AY	2	2	0	0	ő		3 0	
AZ	2	2	0	Ō	ŏ		0	
В	0	6	10	Ō	16		16	(2
3X	0	7	5	0	12	12	12	12
BY	0	7	5	5	7		10	
C	0	9	7	3	13		14	
Total WEST	44-44-44-4-4-4-4-4-4-4-4-4-4-4-4-4-4-4	59	(C)		569 690 55	12	60	
\$	0	11	1	10	2			
SX	0	5	10	6	9		4	
SY	3 (1)	3	.0	Õ	Ö		9 0	
	0	9	7	5	11		14	
	^	10	8	Ō	18	1.0		
ГХ	0		_	Ō	6		6	
	0 0 0	1 12	5	v				
T TX	f b	10		- •		18 6	18	

HNF-EP-0182-131

(1) Six Double-Shell Tanks on the Hydrogen Tank Watch List are not currently receiving waste transfers (AN-103, 104, 105, AW-101, SY-101 and 103).

(2) Includes tank B-202 which no longer meets established supernatant interstitial liquid stabilization criteria.

TABLE E-3. PUMPING RECORD, LIQUID STATUS AND PUMPABLE LIQUID REMAINING IN TANK FARMS

February 28, 1999

			Waste Vo	olumes (Kgallons)			
TANK F <u>ARMS</u> EAST	PUMPED THIS MONTH	PUMPED FY TO DATE	CUMULATIVE TOTAL PUMPED 1979 TO DATE	SUPERNATANT LIQUID	DRAINABLE INTERSTITIAL REMAINING	DRAINABLE LIQUID REMAINING	PUMPABLE LIQUID REMAINING
A	0.0	0.0	150.5	517	291	758	697
AN	N/A	N/A	N/A	3704	127	3831	N/A
AP	N/A	N/A	N/A	3145	3	3148	N/A
AW	N/A	N/A	N/A	3375	142	3517	N/A
AX .	0.0	0.0	13.0	389	222	611	540
AY	N/A	N/A	N/A	501	5	506	N/A
AZ	N/A	N/A	N/A	1604	· 5	1609	N/A
В	0.0	0.0	0.0	15	164	179	80
BX	N/A	0.0	200.2	21	107	129	N/A
BY	0.0	0.0	1567.8	0	596	596	476
С	0.0	0.0	103.0	122	199	321	227
Total	0.0	0,0	2034.5	13393	1861	15205	2020
WEST				•			
S	0.0	0.0	853.6	120	1385	1505	1392
SX	11.7	70.8	207.7	197	1342	1563	1256
SY	N/A	N/A	N/A	2525	0	2525	N/A
T	0.0	24.0	233.6	28	179	207	137
TX .	N/A	0.0	1205.7	5	250	255	N/A
TY	N/A	0.0	29.9	3	31	34	N/A
U	0.0	0.0	0.0	168	1397	1565	1474

⁽¹⁾ Volume based on 21% (sludge waste) and 50% (saltcake waste) liquid in solid (porosity) value, per WHC-SD-W236A-ES-012, Rev .1, dated May 21, 1996, a re-evaluation of the non-stabilized tanks.

N/A = Not applicable for Double-Shell Tank Farms, and Single-Shell Tank Farms which have been declared Controlled, Clean and Stable (BX, TX, TY).

TABLE E-4. INVENTORY SUMMARY BY TANK FARM February 28, 1999

					SUPERA	IATANT	LIQUI	D VOL	<u>UMES</u>	(Kgallo	ns)			SOLID	S VOLUI	ME
TANK	TOTAL	AVAIL							,						SALT	
EARM	WASTE	SPACE	AGING	22	<u>CP</u>	DC	DN	DN/PD	DN/PT	DSSF	NCPLX	TOTAL	DSS	SLUDGE	CAKE	TOTAL
EAST																
A	1537	0	0	0	0	0	0	0	0	517	0	517		556	464	1020
AN	5438	2542	0	1793	0	0	125	0	0	1786	0	3704	410	1324	0	1734
AP	3235	5885	0	0	1092	97	164	0	0	1792	0	3145	0	90	0	90
AW	4808	2032	0	351	0	1006	887	313	0	818	0	3375	0	1358	75	1433
AX	906	0	0	: 3	0	0	0	0	0	386	0	389	١	19	498	517
AY	631	1329	. 0	0	0	57	444	0	0	0	0	501		130	438	130
AZ	1755	205	1604	0	. 0	0	0	0	0	0	0	1604	هٔ ا	151	0	151
В	2057	0	0	0	0	0	0	0	0	0	15	15	0	1697	345	2042
BX	1493	0	0	0	0	0	0	0	0	0	21	21	o	1351	121	1472
BY	4482	0	0	0	0	. 0	0	0	0	0	0	0	١	797	3685	4482
С	1983	0	0	0	0	1	0	0	0	0	121	122	o	1861	0	1861
Total	Zorzazek							#600159#46.D#1	65879:4411 88 010		DEPSE ARREST AREST A	Official designation of the control of	PALISTONIA PARAMINA	delit Code maan saassa saasa		
i Dtai	28325	11993	1604	2147	1092	1161	1620	313	O	5299	157	13393	410	9334	5188	14932
WEST																
s	5239	0	0	0	0	0	0	0	0	103	17	120	o	1206	3913	5119
SX	4349	0	. 0	0	0	0	0	0	0	0	197	197	ŏ	1310	2842	4152
SY	3020	442	0	1516	0	0	0	0	1009	0	0	2525	0	491	4	495
Т	1872	0	0	0	0	0	0	0	0	0	28	28	o	1844	0	1844
TX	7009	0	0	0	0	0	0	0	0	0	5	5	ő	241	6763	7004
TY	638	0	0	0	0	0	0	0	o	0	3	3	o	571	64	
U	3551	0	0	0	o	0	0	0	0	31	137	168	0	571 579	2804	635 3383
eeeteeteete	5597855700508084708447074	e de la companyación de la companyación de la companyación de la companyación de la companyación de la company	0010080.488848884444											5.0	2004	0000
Total	25878	442	P 8 0 *	1518	Ò	0.0	Ö	0	1009	134	387	3046	Ō	6242	1,6390	22832
TOTAL	54003	12435	1604	3863	×1092 ···	1161	1820		1000	5433	544	16439		15578		37564
A CONTRACTOR OF THE CONTRACTOR		Procedure to the Control of the Cont		160 man 183.			0.ULV	. O. J J	- L CO 3	2403	944	15439	3.2410	15578	21578	27664

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

February 28, 1999

		TANK S	TATUS					LIQU	IID VOLUN	IE .	S	DLIDS VOL	UME	VOLUI	<u>ME DETERM</u>	INATION	PHOTOS	/VIDEOS	
				EQUIVA-	TOTAL	AVAIL.	SUPER- NATANT	DRAIN- ABLE INTER-	DRAIN- ABLE LIQUID	PUMP ABLE LIQUID				riavid	SOLIDS	souds	LAST	LAST	SEE FOOTNOT FOR
	WAST			WASTE	WASTE		FIGUID	STIT.	REMAIN	REMAIN	DSS	SLUDGE			VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MATL	INTEGRITY	USE	INCHES	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)		CAKE	METHOE	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								-	AN TANI	K FARM	STATUS								_
AN-101	DN	SOUND	DRCVR	57.5	158	982	125	0	125	125	0	33	0	FM	S	04/30/96	0/0/0		
AN-102	CC	SOUND	CWHT	386.2	1062	78	973	3	976	973	0	89	0	FM	S	08/22/89	0/ 0/ 0		
AN-103	DSS	SOUND	CWHT	347.6	956	184	546	0	546	546	410	0	0	FM	S	03/31/97	10/29/87		1
AN-104		SOUND	CWHT	382.5	1052	88	603	48	651	629	0	449	0	FM	S	03/31/97	08/19/88		
	DSSF	SOUND	CWHT	409.5	1126	14	637	53	690	668	0	489	0	FM	s	03/31/97	01/26/88		1
AN-106		SOUND	CWHT	14.2	39	1101	22	0	22	22	٥	17	0	FM	\$	08/22/89	0/ 0/ 0		1
AN-107	CC	SOUND	CWHT	380,0	1045	95	798	23	821	799	°	247	0	FM	S	08/22/89	09/01/88		ţ
DOUE	LE-SHEL	L TANKS		TOTALS	5438	2542	3704	127	3831	3762	410	1324	. 0						
									AP TANE	C FARM S	STATUS	<u> </u>							
AP-101	DSSF	SOUND	DRCVR	405.1	1114	26	1114	0	1114	1114	0	o	0	FM	s	05/01/89	0/0/0		1
AP-102	CP.	SOUND	GRTFD	397.1	1092	48	1092	0	1092	1092	0	0	0	FM	s	07/11/89	0/0/0		1
AP-103	DN	SOUND	DRCVR	9.1	25	. 1115	24	0	24	24	0	1	0	FM	s	05/31/96	0/0/0		
AP-104	ÐN	SOUND	GRTFD	8.7	24	1116	24	0	24	24	. 0	0	0	FM	S	10/13/88	0/0/0		
AP-105	DSSF	SOUND	CWHT	278.9	767	373	678	3	681	678	0	89	0	FM	s	03/31/98	0/0/0	09/27/98	(a)
AP-106	DN	SOUND	DRCVR	34.2	94	1046	94	0	94	94	0	0	0	FM	s	10/13/88	0/0/0		1
AP-107	DN	SOUND	DRCVR	8.0	22	1118	22	` 0	22	22	0	0	0	FM	s	10/13/88	0/0/0	•	}
AP-108	DC	SOUND	DRCVR	35.3	97	1043	97	0	97	97	0	0	0	FM	s	10/13/88	0/0/0		
3 DOUE	LE-SHEL	L TANKS		TOTALS	3235	5885	3145	3	3148	3145	0	90	0						
									AW TAN	K FARM:	STATIIS	 :							
AW-10	DSSF	SOUND	CWHT	408.7	1124	16	818	30	848	826	0	•	o	l FM	s	03/31/97	03/17/88		1
AW-10:		SOUND	EVFD	380.4	1046	94	1006	0	1006	1006	Ĭ	40	ŏ	FM	s	08/31/97	02/02/83		1
	DN/PD	SOUND	DRCVR	185.5	510	630	162	35	197	175	هٔ	348	o	FM	S	03/31/98	0/ 0/ 0		(a)
AW-104		SOUND	DRCVR		1118	22	887	30	917	895	ة ا	156	75	FM	Š	03/31/98	02/02/83		(a)
	DN/PD		DRCVR		431	709	151	27	178	156	o	280	0	FM	S	03/31/98	0/0/0		(a)
AW-10		SOUND	SRCVR	210.5	579	561	351	20	371	351	o	228	ō	FM	s	08/31/97	02/02/83		""
							E .				ı			1					L

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE SHELL TANKS

February 28, 1999

		TANK S	STATUS					LIQI	JID VOLUK	/E		SOLIDS V	OLUME	Vol	UME DETE	RMINATION	PHOTO	S/VIDEOS	
TANK_	WAST MATL	TANK INTEGRITY	TANK USE	EQUIVA- LENT WASTE INCHES	TOTAL Waste (Kgal)	AVAIL. SPACE (Kgal)	SUPER- NATANT LIQUID (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	DRAIN- ABLE LIQUID REMAIN (Kgal)	PUMP- ABLE LIQUID REMAIN (Kgai)	DSS (Kgal)	SLUDGE			SOLIDS E VOLUME D METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	SEE FOOTNOTE FOR THESE CHANGES
								A	Y TANK	FARM ST	<u> FATUS</u>					-			
AY-101	DC	SOUND	DRCVR	60.0	165	815	57	5	62	57	0	108	0	FM	S	10/31/97	12/28/82		1
AY-102	DN	DANDOS	DRCVR	169.5	466	514	444	0	444	444	•	22	0	FM	S	10/31/97	04/28/81		
2 DOUBL	E-SHEL	TANKS		TOTALS	631	1329	501	5	506	501	°	130	0						
								£	Z TANK	FARM ST	<u> TATUS</u>			•		•			
AZ-101	AGING	SOUND	CWHT	307.6	846	134	799	0	799	799	0	47	0	FM	s	10/31/97	08/18/83		
AZ-102	AGING	SOUND	DRCVR	330.5	909	71	805	5	810	805	0	104	Q	FM	s	10/31/97	10/24/84		
2 DOUBI	LE-SHELI	L TANKS		TOTALS	1755	205	1604	5	1609	1604		151	0						
								S	Y TANK	FARM ST	ATUS								
SY-101	CC	SOUND	CWHT	429.8	1182	0	1141	0	1141	1141	0	41	0	FM	s	05/31/96	04/12/89		(6)
SY-102	DN/PT	SOUND	DRCVR	398.9	1097	43	1009	Ō	1009	1009	0	88	. 0	FM	S	03/31/98	04/29/81		(a)
SY-103	CC	SOUND	CWHT	269.5	741	399	375	0	375	375	٥	362	4	FM	S	06/30/96	10/01/85]
3 DOUB	LE-SHEL	L TANKS		TOTALS	3020	442	2525	0	2525	2525		491	4		···				
GRAND	TOTAL				18887	12435	14854	282	15136	14946	410	3544	79	 					

Note: +/- 1 Kgal differences are the result of computer rounding

Available Space Calculations

Used in This Document

Tank Farms
AN, AP, AW, SY
AY, AZ (Aging Waste)

(Most Conservative) 1,140,000 gel (414.5 in.)

980,000 gai (356.4 in.)

- NOTE: Tanks AN-102, AN-107, AY-101, AY-102, AP-103, AP-104, AP-107 These tanks currently contain waste that is outside of the current corrosion control specification. An alternate strategy of corrosion control (monitor using corrosion probes; adjust chemistry as required for control) is being proposed but has not been fully evaluated. Note that the supermate in AY-102 is within the corrosion specifications, however, the sludge layer is outside the specifications.
- (a) Solids levels in tanks AP-105, AW-103, AW-104, AW-105, and SY-102 were adjusted based on document HNF-SD-WM-TI-806, "Gas Release Event Safety Analysis Tool Pedigree Database for Hanford Tanks," Rev 2, dated December 28, 1998.
- (b) Tank SY-101 Total Waste exceeds the "most conservative" Available Space calculations used for these tanks in this document.

	TIECE A	OLUMES A	DE TUE	DECIT!	TOFF	vice in Vice	DING C	20003202308308	ATTONIC	Séculores dominar desere	AVNO	T A CID	70 U ATA	I CI IDE A	CE LEVE	raviria S	mesm	Kerk .
	TANK S		XXXX IIIIS.	KINGU		N. Maria		UID VOLUI		WILLS IN		NOTUWE		E DETERMIN		PHOTOS/		
	IANK S	14105			SUPER-	DRAIN- ABLE	PUMPED	OID VOLU	DRAIN- ABLE	PUMP- ABLE	300.03	VOLUME	VOLORI	E DETERMIN	ATION	FILOTOSIA	/IDEO3	SEE FOOTNOTE
			STABIL/		NATE	INTER-	THIS	TOTAL	rignid	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
- 4 4 4 4	WASTE	TANK	ISOLATION		LIQUID	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE		VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
					_			A TAI	YK FARM	<u>STATUS</u>								
·-101	DSSF	SOUND	/PI	953	508	263	0.0	0.0	721	697	3	442	P	F	12/31/98	08/21/85		(e)
-102	DSSF	SOUND	IS/PI	41	4	2	0.0	39.5	6	0	15	22	P	FP	07/27/89			}
-103	DSSF	ASMD LKR	IS/IP	371	5	15	0.0	111.0	20	0	366	0	<u>.</u>	FP	06/03/88	12/28/88		İ
-104	NCPLX	ASMD LKR	IS/IP	28	0	0	0.0	0.0	0	0	28	0	M	PS	01/27/78	06/25/86		•
\-105	NCPLX	ASMD ŁKR	IS/IP	19	0	4	0.0	0.0	4	0	19	0	P	MP	08/23/79	08/20/86		
-106	CP	SOUND	IS/IP	125		7	0.0	0.0	7	0	125	0	Р	М	09/07/82	08/19/86		
SING	LE-SHELL T	ANKS	TOTALS	1537	617	291	0.0	150.5	758	697	556	464						
								AX TA	NK FARM	STATUS								
X-101	DSSF	SOUND	/PI	748	386	172	0.0	0.0	558	534	1 3	359	l p	F	12/31/98	08/18/87		(e)
X-102		ASMD LKR	IS/IP	39	3	14	0.0	13.0	17	3	7	29	F	S	09/06/88			,,,,
X-103		SOUND	IS/IP	112	١٥	36	0.0	0.0	36	3	2	110	F	s	08/19/87	08/13/87		
4X-104	NCPLX	ASMD LKR	IS/IP	. 7	0	0	0.0	0.0	0	0	7	0	P	M	04/28/82	08/18/87		
SING	LE-SHELL T	ANKS	TOTALS:	906	389	222	0.0	13.0	611	540	19	498	 -					
31140	CE-STIELE I	AIRS	TOTALS.	300	308		0.0					430	<u> </u>					
						_			IK FARM			_		_				
3-101	NCPLX	ASMD LKR	IS/IP	113	0	6	0.0	0.0	6	0	113	0	P	F	04/28/82	•		
F102	NCPLX	SOUND ASMD LKR	IS/IP	32		0	0.0	0.0	4	0	18	10	P	F	08/22/85			
-103 -104	NCPLX NCPLX	SOUND	IS/IP IS/IP	59 371	1 :	0 46	0.0	0.0 0.0	0 47	40	301	0 69	M	M.	02/28/85 06/30/85	10/13/88		1
-104	NCPLX	ASMD LKR	IS/IP	306	ہٰ ا	23	0.0	0.0	23	0	40	266	P	MP	12/27/84	05/19/88		
-106	NCPLX	SOUND	IS/IP	117	;	6	0.0	0.0	7	ő	118	200	,	F	03/31/85	02/28/85		
-107	NCPLX	ASMD LKR	IS/IP	165	1 ;	12	0.0	0.0	13	7	164	. 0	M	M	03/31/85	02/28/85		Į.
-108	NCPLX	SOUND	IS/IP	94		4	0.0	0.0	4	ó	94	0	<u></u>	F	05/31/85	05/10/85		
-109	NCPLX	SOUND	IS/IP	127	ا	8	0.0	0.0	8	ō	127	ŏ	м	M	04/08/85	04/02/85		ł
3-110	NCPLX	ASMD LKR	IS/IP	246	l i	22	0.0	0.0	23	. 17	245	ō	MP	MP	02/28/85	03/17/88		
-111	NCPLX	ASMD LKR	IS/IP	237	1 1	21	0.0	0.0	22	16	236	ō	F	F	06/28/85	06/26/85		
3-112	NCPLX	ASMD LKR	IS/IP	33	3	0	0.0	0.0	3	0	30	0	F	F	05/31/85	05/29/85		
-201	NCPLX	ASMD LKR	IS/IP	29	1	3	0.0	0.0	4	0	28	0	м	M	04/28/82	11/12/86	06/23/95	.[
3-202	NCPLX	SOUND	IS/IP	27	0	3	0.0	0.0	3	0	27	0	P	M	05/31/85	05/29/85		
-203	NCPLX	ASMD LKR	IS/IP	51	1	5	0.0	0.0	6	0	50	0	PM	PM	05/31/84	11/13/86		i
B-204	NCPLX	ASMD LKR	IS/IP	50	1	6	0.0	0.0	6	0	49	0	P	M	05/31/84			ļ
8 600	GLE-SHELL	TANKS	TOTALS	2057	15	164	0.0	0.0	179	80	1697	345	 					
NICOL	OFC-OUFFF	IMMVS	IUIALS	2057	1 10	104	0.0	0.0	179	- 80	1 1097	345						

ģ

February 28, 1999

00000 FEB.000	TANK S	OLUMES TATUS						UID VOLU				VOLUME		E DETERMIN		PHOTOS/		
	TAIN O	17.100			 	DRAIN-		OID VOLO	DRAIN-	PUMP-	300.03	VOLUME	VOCOIM	E DE LEMMI	ATION	rno los)	AIDEOS	SEE
					S	ABLE	PUMPED		ABLE	ABLE	\		\				İ	FOOTNOTES
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
ANK	MAT'L,	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								BX TA	NK FARM	STATUS						-		
X-101	NCPLX	ASMD LKR	IS/IP/CCS	43	1	0	0.0	0.0	1	0	42	0	P	M	04/28/82	11/24/88	11/10/94	1
X-102	NCPLX	ASMD LKR	IS/IP/CCS	96	0	4	0.0	0.0	4	0	96	0	P	M	04/28/82	09/18/85		
X-103	NCPLX	SOUND	IS/IP/CCS	68	6	Ō	0.0	0.0	6	0	62	0	P	F	11/29/83	10/31/86	10/27/94	
X-104	NCPLX	SOUND	IS/IP/CCS	99	3	30	0.0	17.4	33	27	96	0) F	F	09/22/89	09/21/89		1
X-105	NCPLX	SOUND	IS/IP/CCS	51	5	6	0.0	15.0	11	4	43	3	F	S	09/03/86	10/23/86		
X-106	NCPLX	SOUND	IS/IP/CCS	38	0	0	0.0	14.0	0	0	38	0	MP	PS	08/01/95	05/19/88	07/17/95	!
X-107	NCPLX	SOUND	IS/IP/CCS	345	1	29	0.0	23.1	30	23	344	0	MP	P	09/18/90	09/11/90		
X-108	NCPLX	ASMD LKR	IS/IP/CCS	26	0	1	0.0	0.0	1	0	26	0	M	PS	07/31/79	05/05/94		
X-109	NCPLX	SOUND	IS/IP/CCS	193	0	13	0.0	8.2	13	8	193	0	FP	P	09/17/90	09/11/90		
X-110	NCPLX	ASMD LKR	IS/IP/CCS	207	3	16	0.0	1.5	19	13	195	9	MP	M	10/31/94	07/15/94	10/13/94	
X-111	NCPLX	ASMD LKR	IS/IP/CCS	162	1	1,	0.0	116.9	3	1	52	109	М	M	04/06/95	05/19/94	02/28/95	
3X-112	NCPLX	SOUND	IS/IP/CCS	165	1	7	0.0	4.1	8	2	164	0	FP	P	09/17/90	09/11/90		}
2 SING	LE-SHELL	TANKS	TOTALS:	1493	21	107	0.0	200.2	129	78	1351	121	<u> </u>					
								BY TA	NK FARM	STATUS						_		
3Y-101	NCPLX	SOUND	IS/IP	387	0	6	0.0	35.8	5	0	109	278	P	M	05/30/84	09/19/89		
Y-102	NCPLX	SOUND	IS/PI	277	0	11	0.0	159.0	11	0	0	277	MP	M	05/01/95	09/11/87	04/11/95	į .
Y-103	NCPLX	ASMD LKR	IS/PI	414	0	38	0.0	95.9	38	32	6	409	MP	M	11/25/97	09/07/89	02/24/97	
Y-104	NCPLX	SOUND	IS/IP	406	0	18	0.0	329.5	18	0	40	366	P	M	04/28/82	04/27/83		
Y-105	NCPLX	ASMD LKR	/PI	504	0	192	0.0	0.0	192	186	169	345	P	MP	12/31/98	07/01/86		(a)
3Y-106	NCPLX	ASMD LKR	/Pi	562	0	244	0.0	63.7	244	238	84	478	P	MP.	12/31/98	11/04/82		(e)
3Y-107	NCPLX	ASMD LKR	IS/IP	266	0	25	0.0	56.4	25	0	60	206	P	MP	04/28/82	10/15/86		
	NCPLX	ASMD LKR	IS/IP	228	0	9	0.0	27.5	9	0	154	74	MP	M	04/28/82	10/15/86		1
	NCPLX	SOUND	IS/PI	290	0	37	0.0	157.1	37	20	57	233	F	PS	07/08/87	06/18/97		
	NCPLX	SOUND	IS/IP	398	0	9	0.0	213.3	9	0	103	295	M	s	09/10/79	07/26/84		
	NCPLX	SOUND	IS/IP	459) 0	0	0.0	313.2	0	0	21	438	P	М	04/28/82	10/31/86		1
3Y-112	NCPLX	SOUND	IS/IP	291	٥	8	0.0	116.4	8	0	5	286	P	M	04/28/82	04/14/88		
2 611/	BLE-SHELL	TANKO	TOTALS:	4482	0	596	0.0	1567.8	596	476	797	3685						

Ų

February 28, 1999

	TANK S	OLUMES.		ALLO OL				UID VOLU		1000		VOLUME	39,7,03		E DETERMIN		A	
	·	TATO		·		DRAIN-		010 10 10	DRAIN-	PUMP-	000.55	<u> </u>		1000				SEE
					•	ABLE	PUMPED		ABLE	ABLE	1		\		-			FOOTNOTE
			STABIL/	TOTAL	SUPER-	INTER-	THIS .	TOTAL	LIQUID	FIGUID	ŀ	SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION		NATE	STIT.		PUMPED	REMAIN				VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	
ANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
								C TA	NK FARM	STATUS						•		•
101	NCPLX	ASMD LKR	IS/IP	88	0	3	0.0	0.0	3	0	88	0	М	M	11/29/83	11/17/87		
102	DC	SOUND	IS/IP	316	0	30	0.0	46.7	30	17	316	0	F	FP	09/30/95	05/18/76	08/24/95	
103	NCPLX	SOUND	/Pi	202	83	11	0.0	0.0	94	88	119	0	F	S	12/31/98	07/28/87		(e)
104	CC	SOUND	IS/IP	295	0	11	0.0	0.0	11	5	295	0	FP	P	09/22/89	07/25/90		
105	NCPLX	SOUND	IS/PI	134	2	30	0.0	0.0	32	9	132	0	F	S	10/31/95	08/05/94	08/30/95	
106	NCPLX	SOUND	/Pi	229	32	30	0.0	0.0	62	52	197	0	F	PS	04/28/82	08/05/94	08/08/94	
107	DC	SOUND	IS/IP	237	0.	24	0.0	40.8	24	15	237	0	F	S	09/30/95	00/00/00		
108	NCPLX	SOUND	IS/IP	66	0	0	0.0	0.0	0	0	66	0	М	s	02/24/84	12/05/74	11/17/94	
109	NCPLX	SOUND	IS/IP	66	4	0	0.0	0.0	4	0	62	0	М	PS	11/29/83	01/30/76		[
110	DC	ASMD LKR	IS/IP	178	1	28	0.0	15.5	29	15	177	0	F	FMP	06/14/95	08/12/86	05/23/95	il .
111	NCPLX	ASMD LKR	IS/IP	57	0	0	0.0	0.0	0	0	57	0	М	s	04/28/82	02/25/70	02/02/95	;
112	NCPLX	SOUND	IS/IP	104	0	32	0.0	0.0	32	26	104	0	M	PS	09/18/90	09/18/90		
201	NCPLX	ASMD LKR	IS/IP	2	0	0	0.0	0.0	0	0	2	0	P	MP	03/31/82	12/02/86		ŀ
202	EMPTY	ASMD LKR	IS/IP	1	0	0	0.0	0.0	0	0	1	0	Р	M	01/19/79	12/09/86		
203	NCPLX	ASMD LKR	IS/IP	5	0	0	0.0	0.0	0	0	6	0	P	MP	04/28/82	12/09/86		1
-204	NCPLX	ASMD LKR	IS/IP	3	0	0	0.0	0.0	0	0	3	0	Р	MP	04/28/82	12/09/86		
SING	3LE-SHELL	TANKS	TOTALS:	1983	122	199	0.0	103.0	321	227	1861	0						
								S TA	NK FARM	STATUS								
101	NCPLX	SOUND	/PI	427	1 12	132	0.0	0.0	144	138	211	204] F	PS	12/31/98	03/18/88		(0)
102	DSSF	SOUND	/PI	549	ه ا	230	0.0	0.0	230	224	105	444	P	FP	12/31/98	03/18/88		(e)
103	DSSF	SOUND	/PI	248	17	105	0.0	0.0	122	110	9	222	м	s	12/31/98	06/01/89		(e)
104	NCPLX	ASMD LKR	IS/IP	294	1 1	28	0.0	0.0	29	23	293	0	M	м	12/20/84	12/12/84		
105	NCPLX	SOUND	IS/IP	456	١٠	35	0.0	114.3	35	13	2	454	MP	s	09/26/88	04/12/89		
106	NCPLX	SOUND	/PI	479	53	205	0.0	97.0	258	243	ه ا	426	Р	FP	12/31/98	03/17/89	09/12/94	(o)
107	NCPLX	SOUND	/PI	376	14	82	0.0	0.0	96	90	293	69	F	PS	12/31/98	03/12/87		(e)
108	NCPLX	SOUND	IS/PI	450	0	4	0.0	199.8	4	0	4	446	Р	MP	12/20/96	03/12/87	12/03/96	
109	NCPLX	SOUND	/PI	507	0	177	0.0	111.0	177	167	13	494	F	PS	09/30/75			(e)
110	NCPLX	SOUND	IS/PI	390	0	30	0.0	203.1	30	23	131	259	F	PS	05/14/92	1	12/11/96	
	NCPLX	SOUND	/PI	540	23	204		3.3	227	221	139	378	Р	FP	12/31/98	ľ		(e)
-111		* *	•	523	0	153		125.1	153	140			P	FP	12/31/98			(e)
112	NCPLX	SOUND	/PI	023	١ ٧	,,,,					1 *	• • • •		.,	, ,			10,

1	HESE V	OLUMES .	ARE THE	RESUL'	r of E	NGINEE	RING C	CONTRACTOR CONTRACTOR	niary 28, ATIONS	estroper to proper a	AY NO	T AGR	EE WITT	I SURFA	CE LEVE	EL MEAS	UREME	NTS
	TANK S	TATUS		<u></u>			LIQ	UID VOLU	ME	<u> </u>	SOLIDS	VOLUM		VOLUM	E DETERMIN	NATION		
TANK	WASTE MAT'L.	TANK INTEGRITY	STABIL/ ISOLATION STATUS		SUPER- NATE (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED	DRAIN- ABLE LIQUID REMAIN (Kgal)		SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	IN-TANK	SEE FOOTNOTE FOR THESE CHANGES
								SX TA	NK FARM	STATUS								
SX-101 SX-102		SOUND SOUND	/PI /PI	442 543	0	170 224	0.0 0.0	0.0 0.0	170 224	163 216	128 117	314 426	P P	FP M	12/31/98 12/31/98			(e) (e)
SX-103 SX-104	NCPLX DSSF	SOUND ASMD LKR	/PI /PI	851 684	0 0	278 170	0.0 11.1	0.0 183.1	278 170	271 172	115 136	536 448	F	s s	12/31/98 01/31/99		02/04/98	(e) (a)(e)
	NCPLX	SOUND	/PI /Pi	683 513	0 197	309 109	0.0 0.6	0.0 24.6	309 330	301 108	73 52	610 264	P	F PS	12/31/98 01/31/99	06/01/89		(d)(e) (b)(e)
SX-108	NCPLX NCPLX	ASMD LKR ASMD LKR	IS/IP IS/IP	104 87	0	5 5	0.0	0.0	5	0	104 87	0	1	M M	04/28/82 12/31/93	03/06/87		
SX-110	NCPLX	ASMD LKR	IS/IP IS/IP	244 62	0	48 0	0.0	0.0	48 0	25 0	62	244		M PS	01/10/96	02/20/87		
SX-112	NCPLX NCPLX NCPLX	ASMD LKR ASMD LKR ASMD LKR	IS/IP IS/IP IS/IP	125 92 26	0	7 3 0	0.0 0.0 0.0	0.0 0.0 0.0	, 7 3 0	0 0 0	1 25 92 26	0 0 0	P	PS M M	05/31/74 04/28/82 04/28/82	03/10/87		ļ
SX-114	NCPLX NCPLX	ASMD LKR ASMD LKR	IS/IP IS/IP	181 12	0	14	0.0 0.0	0.0 0.0	14	0	181 12	0	P	M M	04/28/82 04/28/82	02/26/87		
15 SIN	GLE-SHELL	TANKS	TOTALS:	4349	197	1342	11.7	207.7	1563	1256	1310	2842				<u></u>		
								T TAR	IK FARM	STATUS								
T-101	NCPLX	ASMD LKR	IS/PI	102	1	16	0.0	25.3	17	0	101	0	F	s	04/14/93	04/07/93		Ī
T-102	NCPLX	SOUND	IS/IP	32	13	0	0.0	0.0	13	13	19	0	Р	FP	08/31/84	06/28/89		[
T-103	NCPLX	ASMD LKR	IS/IP	27	4	0	0.0	0.0	4	0	23	0	F	FP	11/29/83	07/03/84		
T-104	NCPLX	SOUND	/Pi	328	0	31	0.0	146.8	31	25	328	0	Р	MP	01/31/99	06/29/89		(c)(e)
T-105	NCPLX	SOUND	IS/IP	98	0	23	0.0	0.0	23	17	98	0	P	F	05/29/87	05/14/87		
T-106	NCPLX	ASMD LKR	IS/IP	21	2	0	0.0	0.0	2	0	19	0	P	FP	04/28/82	06/29/89		
T-107	NCPLX	ASMD LKR	IS/PI	173	0	22	0.0	11.0	22	12	173	0		FP	05/31/96		05/09/96	·]
T-108	NCPLX	ASMD LKR	IS/IP	44	0	0	0.0	0.0	0	0	44	0	j P	M	04/28/82	07/17/84		1

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 28, 1999

	TANK S	TATUS					LIQ	NID AOFA	ME		SOLIDS	VOLUME	VOLUI	ME DETERM	INATION			
						DRAIN- ABLE	PUMPED		DRAIN- ABLE	PUMP- ABLE					· · · · · · ·			SEE FOOTNOTI
			STABIL/	TOTAL	SUPER-	INTER-	THIS	TOTAL	LIQUID	LIQUID	İ	SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	NATE	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
ANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
109	NCPLX	ASMD LKR	IS/IP	58	0	o	0.0	0.0	0	o	58	0	I. м	м	12/30/84	02/25/93		l
110	NCPLX	SOUND	/PI	353	0	40	0.0	40.9	40	34	353	0	Р	FP	01/31/99			(d)(e)
111	NCPLX	ASMD LKR	IS/PI	446	0	34	0.0	9.6	34	29	446	0	P	FP	04/18/94	04/13/94	02/13/95	1
112	NCPLX	SOUND	IS/IP	67	7	0	0.0	0.0	7	7	60	0	P	FP	04/28/82	08/01/84		Į.
201	NCPLX	SOUND	IS/IP	29	1	3	0.0	0.0	4	0	28	0	M	PS	05/31/78	04/15/86		į
202	NCPLX	SOUND	IS/IP	21	0	2	0.0	0.0	2	0	21	0	FP	P	07/12/81	07/06/89		ļ .
203	NCPLX	SOUND	IS/IP	35	0	4	0.0	0.0	4	0	35	. 0	M	PS	01/31/78	08/03/89		ł
-204	NCPLX	SOUND	IS/IP	38	0	4	0.0	0.0	4	0	38	0	FP	P	07/22/81	08/03/89		1
SING	LE-SHELL	TANKS	TOTALS:	1872	28	179	0.0	233,6	207	137	1844	0						 -
								TY TA	NK FARM	STATUS				,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,				
X-101	NCPLX	SOUND	IS/IP/CCS	87	lз	2	0.0	0.0	5	0	84	o	l e	P	02/02/84	10/24/85		1
X-102	NCPLX	SOUND	IS/IP/CCS	217	0	22	0.0	94.4	22	0	0	217	м	S	08/31/84	10/31/85		Ì
X-103	NCPLX	SOUND	IS/IP/CCS	157	0	15	0.0	68,3	15	0	157	0	F	s	08/14/80	10/31/85		.
X-104	NCPLX	SOUND	IS/IP/CCS	65	1	14	0.0	3.6	15	0	0	64	F	FP	04/06/84	10/16/84		
X-105	NCPLX	ASMD LKR	IS/IP/CCS	609	0	20	0.0	121.5	20	0	٥	609	М.	PS	08/22/77	10/24/89		l
X-106	NCPLX	SOUND	IS/IP/CCS	453	0	10	0.0	134,6	10	0	0	453	M	s	08/29/77	10/31/85		
X-107	NCPLX	ASMD LKR	IS/IP/CCS	36	1	1	0.0	0.0	2	0	0	35	FP	FP	01/20/84	10/31/85		ŀ
X-108	NCPLX	SOUND	IS/IP/CCS	134	0	0	0.0	13.7	0	0	0	134	P	FP	05/30/83	09/12/89]
X-109	NCPLX	SOUND	IS/IP/CCS	384	0	10	0.0	72.3	10	0	0	384	F	PS	05/30/83	10/24/89		
X-110	NCPLX	ASMD LKR	IS/IP/CCS	462	0	15	0.0	115.1	. 15	0	0	462	M	PS	05/30/83	10/24/89		1
X-111	NCPLX	SOUND	IS/IP/CCS	370	0	9	0.0	98.4	9	0	0	370	М	PS	07/26/77	09/12/89		
X-112	NCPLX	SOUND	IS/IP/CCS	649	0	24	0.0	94.0	24	.0	0	649	P	PS	05/30/83	11/19/87		1
X-113	NCPLX	ASMD LKR	IS/IP/CCS	607	0	16	0.0	19.2	16	0	0	607	М	PS	05/30/83	04/11/83	09/23/94	·I
X-114	NCPLX	ASMD LKR	IS/IP/CCS	535	0	16	0.0	104.3	15	0	0	535	M	PS	05/30/83	04/11/83	02/17/95	1
(-115	NCPLX	ASMD LKR	is/IP/CCS	640	0	19	0.0	99.1	19	0	0	640	М	s	03/25/83	06/15/88		
X-116	NCPLX	ASMD LKR	IS/IP/CCS	631	0	23	0.0	23.8	23	0	0	631	М	PS	03/31/72	10/17/89		1
X-117	NCPLX	ASMD LKR	IS/IP/CCS	626	0	8	0.0	54.3	8	0	0	626	M	PS	12/31/71	04/11/83		
X-118	NCPLX	SOUND	IS/IP/CCS	347	0	27	0.0	89.1	27	0	0	347	F	s	11/17/80	12/19/79		1
					I								1					1

:

February 28, 1999

	TANK S	TATUS					LIQ	nid Aorn	ME		SOLIDS	VOLUM	VOLUM	DETERMIN	ATION	PHOTOS/	/IDEOS	
						DRAIN-			DRAIN-	PUMP-								SEE
			•		SUPER-	ABLE	PUMPED		ABLE	ABLE]							FOOTNOTE
			STABIL/	TOTAL	NATE	INTER-	THIS	TOTAL	LIQUID	FIGUID		SALT	LIQUIDS	SOLIDS	SOLIDS	LAST	LAST	FOR
	WASTE	TANK	ISOLATION	WASTE	FIGUID	STIT.	MONTH	PUMPED	REMAIN	REMAIN	SLUDGE	CAKE	VOLUME	VOLUME	VOLUME	IN-TANK	IN-TANK	THESE
TANK	MAT'L.	INTEGRITY	STATUS	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	METHOD	METHOD	UPDATE	PHOTO	VIDEO	CHANGES
				•				TY TA	NK FARM	STATUS								
TY-101	NCPLX	ASMD LKR	IS/IP/CCS	118	0	. 0	0.0	8.2	0	0	118	0	P	F	04/28/82	08/22/89		1
TY-102	NCPLX	SOUND	IS/IP/CCS	64	0	14	0.0	6.6	14	0	0	64	Р	FP	06/28/82	07/07/87		•
TY-103	NCPLX	ASMD LKR	IS/IP/CCS	162	0	5	0.0	11.5	5	0	162	0	P	FP	07/09/82	08/22/89		
TY-104	NCPLX	ASMD LKR	IS/IP/CCS	46	3	12	0.0	0.0	15	0	43	0	Р	FP	06/27/90	11/03/87		<u> </u>
TY-105	NCPLX	ASMD LKR	IS/IP/CCS	231	0	0	0.0	3.6	0	0	231	0	P	M	04/28/82	09/07/89	•	1
TY-106	NCPLX	ASMD LKR	IS/IP/CCS	17	0	0	0.0	0.0	0	0	17	0	Р	М	04/28/82	08/22/89		l
8 SINGL	E-SHELL T	ANKS	TOTALS:	638	3	31	0.0	29.9	34	. 0	571	64						
								TI TAN	ik farm :	ZITATZ								
J-101	NCPLX	ASMD LKR	IS/IP	25	1 з	0	0.0	0,0	3	0	22	0	l P	MP	04/28/82	06/19/79		i
J-102	NCPLX	SOUND	/PI	375	18	157	0.0	0.0	175	168	43	314	P	MP	12/31/98			(0)
U-103	NCPLX	SOUND	/PI	468	13	216	0.0	0.0	229	218	12	443	P	FP	12/31/98			(0)
U-104	NCPLX	ASMD LKR	IS/IP	122	0	7	0.0	0.0	7	0	122	0	Р	MP	-	08/10/89		\
U-105	NCPLX	SOUND	/PI	418	37	173	0.0	0.0	210	204	32	349	FM	PS		07/07/88		(o)
U-106	NCPLX	SOUND	/PI	226	15	97	0.0	0.0	112	. 98	١٥	211	F	PS	12/31/98	07/07/88		(6)
J-107	DSSF	SOUND	/PI	406	31	175	0.0	0.0	206	196	15	360	F	s	12/31/98	10/27/88		(0)
U-108	NCPLX	SOUND	/PI	468	24	205	0.0	0.0	229	223	29	415	F	s	12/31/98			(0)
U-109	NCPLX	SOUND	/PI	463	19	203	0.0	0.0	222	216	35	409	F	F	12/31/98			(0)
U-110	NCPLX	ASMD LKR	IS/PI	186	0	15	0.0	0.0	15	9	186	0	М	M	12/30/84	12/11/84		
U-111	DSSF	SOUND	/PI	329	0	149	0.0	0.0	149	142	26	303	PS	FPS	12/31/98	06/23/88		(0)
U-112	NCPLX	ASMD LKR	IS/IP	49	4	0	0.0	0.0	4	0	45	0	P	MP	02/10/84	08/03/89		
U-201	NCPLX	SOUND	IS/IP	5	1	0	0.0	0.0	1	0	4	0	м	S	08/15/79	08/08/89		1
U-202	NCPLX	SOUND	IS/IP	5	1	0	0.0	0.0	1	0	4	0	М	s	08/15/79	08/08/89		
U-203	NCPLX	SOUND	IS/IP	3	1	0	0.0	0.0	1	0	2	0	М	S	08/15/79	06/13/89		1
J-204	NCPLX	SOUND	IS/IP	3	1	0	0.0	0.0	, 1	0	2	0	м	\$	08/15/79	06/13/89		1
6 SING	LE-SHELL	TANKS	TOTALS:	3551	168	1397	0.0	0.0	1565	1474	579	2804						<u> </u>
				22														
GRAND	TOTAL			35116	1585	6163	11.7	4565.0	7723	6357	I 12032	21499	1			I		B .

13

February 28, 1999

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH SURFACE LEVEL MEASUREMENTS

FOOTNOTES:

Total Waste is calculated as the sum of Sludge and Saltcake plus Supernate.

The category "Interim Isolated" (II) was changed to "Intrusion Prevention" (IP) in June 1993. See section C. "Tank and Equipment Code and Status Definitions."

Stabilization information from WHC-SD-RE-TI-178 SST STABILIZATION RECORD, latest revision, or SST Stabilization or Cognizant Engineer

(a) SX-104 Following Information from Cognizant Engineer

Several transfers to SY-102 were performed during February 1999. Pumping will be interrupted by work to relocate the alarm circuitry and may be impacted by the cross site transfer. Volumes reported are based on Best-Basis Inventory Control values and will be updated annually as pumping data accumulates.

Total Waste: 584 Kgal Supernate: 0 Kgal

Drainable Interstitial; 169.9 Kgal Pumped this month: 11.1 Kgal Total Pumped: 183.1 Kgal

Drainable Liquid Remaining: 169,9 Kgal Pumpable Liquid Remaining: 171,9 Kgal

Sludge: 136 Kgal Saltcake: 448 Kgal

Pumping during February 1999 required 19,804 gal of dilution water and 2,066 gal of water for transfers.

(b) SX-106 Following information from Cognizant Engineer

Several transfers to SY-102 were performed during February 1999. Pumping will be interrupted by work to relocate the alarm circuitry and may be impacted by the cross site transfer. Volumes reported are based on Best-Bassis inventory Control values and will be updated annually as pumping data accumulates.

Total Waste: 513 Kgal Supernate: 197.4 Kgal

Drainable interstitial: 109 Kgai Pumped this month: 0.6 Kgai Total Pumped: 24.6 Kgai

Drainable Liquid Remaining: 330,4 Kgal Pumpable Liquid Remaining: 108,4 Kgal

Sludge: 52 Kgal Saltcake: 264 Kgal

Pumping during February 1999 required 870 gai of dilution water and 644 gal of water for transfer line flushes.

HNF-EP-0182-131

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 28, 1999

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH SURFACE LEVEL MEASUREMENTS

FOOTNOTES:

(c) T-104 Following information from Cognizant Engineer

Pumping resumed June 7, 1998. Transfer line plugged on January 23 and was cleared on January 27, 1999. No pumping in February 1999; pumping operations are suspended until after the cross site transfer of SY-102. Volumes reported are based on Best-Basis Inventory Control values and will be updated annually as pumping data accumulates.

Total Waste: 328 Kgal Supernate: 0 Kgal

Drainable Interstitial: 31.4 Kgal Pumped this month: 0.0 Kgal Total Pumped: 146.8 Kgal

Drainable Liquid Remaining: 31.4 Kgal Pumpable Liquid Remaining: 25.4 Kgal

Sludge: 328 Kgal Saltcake: 0 Kgal

Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will be corrected as porosity data becomes available with continued pumping.

(d) T-110 Following information from Cognizant Engineer

Pumping began May 21, 1997. Pumping began January 9, transfer line plugged on January 10, cleared on January 20, and plugged again on January 27, 1999.

Pumping operations are suspended until after the cross site transfer of SY-102.

Volumes reported are based on Best-Basis inventory Control values and will be updated annually as pumping data accumulates,

Total Waste: 353 Kgal Supernate: 0 Kgal

Drainable interstitial: 40.4 Kgal Pumped this month: 0.0 Kgal Total Pumped: 40.9 Kgal

Drainable Liquid Remaining: 40.4 Kgal Pumpable Liquid Remaining: 34.4 Kgal

Sludge: 353 Kgal Saltcake: 0 Kgal

Actual volume of liquid remaining to be pumped is still a rough estimate. Volumes will continue to be corrected as porosity data becomes available with continued pumping.

(e) Volume estimates for the remaining 29 SSTs (excluding C-106) not yet interim stabilized were revised per HNF-2978, "Updated Jet Pump Durations for Interim Stabilization of Remaining Single-Shell Tanks," Rev. O, R. D. Schrieber, dated July 16, 1998. This included supernate, saltcake, sludge, drainable liquid remaining, drainable interstitial liquid, and pumpable liquid remaining. Volume estimates were again revised for Drainable interstitial Liquid in these tanks per Rev.0 update March 24, 1999.

HNF-EP-0182-131

This page intentionally left blank.

APPENDIX F

PERFORMANCE SUMMARY

7

TABLE F-1. PERFORMANCE SUMMARY (Sheet 1 of 2)

WASTE VOLUMES (Kgalions) February 28, 1999

INCREASES/DECREASES IN WASTE VOLUMES STORED IN DOUBLE-SHELL TANKS

CUMULATIVE EVAPORATION - 1950 TO PRESENT WASTE VOLUME REDUCTION

HNF-EP-0182-131

	THIS	FY1999	FACILITY		
SOURCE	MONTH	TO DATE	242-B EVAPORATOR (10)		7172
B PLANT	0	0	242-T EVAPORATOR (1950's) (1	0)	9181
PUREX TOTAL (1)	0	0	IN-TANK SOLIDIFICATION UNIT 1	(10)	11876
PFP (1)	0	0	IN-TANK SOLIDIFICATION UNIT 2	(10)	15295
T PLANT (1)	. 0	0	IN-TANK SOLID. UNIT 1 & 2 (10)		7965
S PLANT (1)	. 0	0	(after conversion of Unit 1 to a	cooler for Unit 2)	8833
300 AREAS (1)	0	0	242-T (Modified) (10)	•	24471
400 AREAS (1)	0	0	242-S EVAPORATOR (10)		41983
SULFATE WASTE -100 N (2)	0	0	242-A EVAPORATOR (11)		73689
C-106 SOLIDS (INCLUDING FLUSH)	0	11	242-A Evaporator was restarte	ed April 15, 1994,	
TRAINING/X-SITE (9)	0	0	after having been shut down s	ince April 1989.	•
TANK FARMS (6)	5	12	Total waste reduction since	e restart:	9486
SALTWELL LIQUID (8)	40	257	Campaign 94-1	2417 Kgal	
			Campaign 94-2	2787 Kgal	
OTHER GAINS	15	77	Campaign 95-1	2161 Kgal	
Slurry increase (3)	7		Campaign 96-1	1117 Kgal	
Condensate	5		Campaign 97-1	351 Kgal	
Instrument change (7)	o .		Campaign 97-2	653 Kgal	
Unknown (5)	3	•			
OTHER LOSSES	-12	-68			•
Slurry decrease (3)	-6				
Evaporation (4)	-5				
Instrument change (7)	0				
Unknown (5)	-1			,	
EVAPORATED	0	0			
GROUTED	0	0		•	
STOTAL ALEMAN SERVICE	48	289			

TABLE F-1. PERFORMANCE SUMMARY (Sheet 2 of 2)

Footnotes:

INCREASES/DECREASES IN WASTE VOLUMES

- (1) Including flush
- (2) Sulfate waste is generated from ion exchange backflushing and sand filter clean out, resulting in sulfate waste.
- (3) Slurry increase/growth is caused by gas generation within the waste.
- (4) Aging waste tanks
- (5) Unknown waste gains or losses
- (6) Includes Tank Farms miscellaneous flushes
- (7) Liquid level measurement instrument changes from the automatic FIC to manual tape (and vice versa) result in unusual gains or losses because the manual tape may rest on an uneven crust surface giving a different reading from that of the automatic FIC.
- (8) Results from pumping of single-shell tanks to double-shell tanks.
- (9) Tracks waste being sent to the double-shell tanks from the "Precampaign Training Run." Evaporator procedures require a training run at least once per year. This also includes pressure testing and flushing of cross-site transfer lines.

WASTE VOLUME REDUCTION

- (10) Currently inoperative.
- (11) Currently operative. The 242-A Evaporator-Crystallizer was started up March 1977, and shut down April 1989 because of regulatory issues, and remained shut down for subsequent upgrading. This evaporator operates under a vacuum, employing evaporative concentration with subsequent crystallization and precipitation of salt crystals (forming saltcake). The evaporator was restarted on April 15, 1994.

TABLE F-2. SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANKS

SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANK (DST) SYSTEM FOR FEBRUARY 1999: ALL VOLUMES IN KGALS

- The DST system received waste transfers/additions from SST Stabilization in February
- There was a net change of +43 Kgals in the DST system for Februray 1999.
- The total DST inventory as of February 28, 1999 was 18,887 Kgals.
- There was no Saltwell Liquid (SWL) pumped to the East Area DSTs in February.
- There were 40 Kgals of Saltwell Liquid (SWL) pumped to the West Area DSTs (102-SY) in February.

	FEBR	UARY 1999 DST WASTE REC	EIPTS		
FACILITY GENER	ATIONS	OTHER GAINS ASS	OCIATED WITH	OTHER LOSSES ASS	SOCIATED WITH
SWL (West)	+40 Kgal (2SY)	SLURRY	+7 Kgal	SLURRY	-6 Kgal
TOTAL	+40 Kgal	CONDENSATE	+5 Kgal	CONDENSATE	-5 Kgal
	;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;;	INSTRUMENTATION	+0 Kgal	INSTRUMENTATION	-0 Kgal
		UNKNOWN	+3 Kgal	UNKNOWN	-1 Kgal
		TOTAL	+15 Kgal	TOTAL	-12 Kgal

	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR	NET DST CHANGE	TOTAL DST VOLUME
OCT98	73	81	4	0	77	18675
NOV98	52	115	17	0	69	18744
DEC98	26	57	-20	0	6	18750
JAN99	89	122	5	0	94	18844
FEB99	40	74	3	0	43	18887
MAR99		135		0		
APR99		128		. 0		
MAY99		-736		0		
JUN99		204		0		
JUL99		177		0		
AUG99		127		0		
SEP99		149		0		

NOTE: The "PROJECTED DST WASTE RECEIPTS" numbers were updated in December 1998.

COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES (ALL VOLUMES IN KGALS)

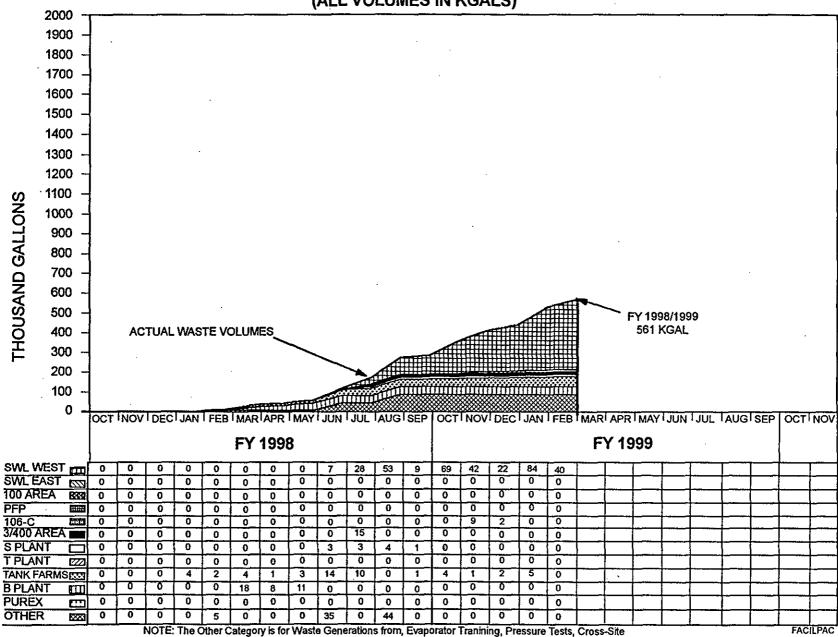


FIGURE F-1. COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES (All volumes in Kgals)

This page intentionally left blank

APPENDIX G

MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

G N

TABLE G-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements
February 28, 1999

FACILITY	<u>LOCATION</u>	PURPOSE (receives waste from:)	(Gallonsi	MONITORED BY	<u>REMARKS</u>
241-A-302-A	A Farm	A-151 DB	956	SACS/ENRAF/Manually	Foamed over Catch Tank pump pit & div. box to prevent intrusion
241-ER-311	B Plant	ER-151, ER-152 DB	7463	SACS/FIC/Manually	Rain
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Pumped 11/98
241-AZ-151	AZ Farm	AZ-702 condensate	2842	SACS/FIC/Manually	Volume changes daily - pumped to AZ-102 as needed
241-AZ-154	AZ Farm	·	25	SACS/MT	• • • • • • • • • • • • • • • • • • • •
244-BX-TK/SMP	BX Complex	DCRT - Receives from several farms	25052	SACS/MT	Using Manual Tape for tank & sump
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	12974	MCS/SACS/WTF	WTF- received water from cross-site transfer line checks
A-350	A Farm	Collects drainage	327	MCS/SACS/WTF	WIF himped so needed
AR-204	AY Farm	RR Cars during transfer to rec. tanks	350	DIP TUBE	Alarms on SACS
A-417	A Farm	•	12051	SACS/WTF	Pumped 4/98
CR-003-TK/SUMP	C Farm	DCRT	3915	MT/ZIP CORD	Pumped 4/98 Zip cord in sump O/S 3/11/96, water intrusion, 1/98
WEST AREA					
241-TX-302-C	TX Farm	TX-154 DB	269	SACS/ENRAF/Manually	
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	8114	SACS/ENRAF/Manually	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	2196	SACS/ENRAF/Manually	
241-S-304	S Farm	S-151 DB	157	SACS/ENRAF/Manually	Replaced S-302-A, 10/91; ENRAF installed 7/98
					Sump not alarming.
244-S-TK/SMP	S Farm	DCRT - Receives from several farms	16073	SACS/Manually	WTF (uncorrected)
244-TX-TK/SMP	TX Farm	DCRT - Receives from several farms	13089	SACS/Manually	MT
Vent Station Catch	Tank	Cross Country Transfer Line	339 LEGEND:	SACS/Manually	MT

	acilities		

LEGEND: D8 - Diversion Box

DCRT : Double-Contained Receiver Tank

TK - Tank

SMP - Sump

FIC = Food Instrument Corporation measurement device

RS - Robert Shaw instrument measurement device

MFIC - Manual FIC

MT - Manual Tape

CWF - Weight Factor/SpG -- Corrected Weight Factor

SACS - Surveillance Automated Control System

MCS - Monitor and Control System

O/S - Out of Service

ENRAF - Surface Level Measuring Device

TABLE G-2. EAST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES INACTIVE - no longer receiving waste transfers

February 28, 1999

			,	MONITORE	ED .
<u>FACILITY</u>	LOCATION	RECEIVED WASTE FROM:	<u>(Gallonsi</u>	BY	<u>REMARKS</u>
216-BY-201	BY Farm	TBP Waste Line	Unknown	NM	(216-BY)
241-A-302-B	A Farm	A-152 DB	5681	SACS/MT	Isoleted 1985, Project B-138 Interim Stabilized 1990, Rain intrusion
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-CX-70	Hot Semi-	Transfer lines	Unknown	NM	Isolated, Decommission Project,
241-CX-72	Works	Transfer lines	650	NM	See Dwg H-2-95-501, 2/5/87
241-ER-311A	SW B Plant	ER-151 DB	Unknown	NM	Isolated
244-AR VAULT	A Complex	Between farms & B-Plant	Unknown	NM ⁻	Not actively being used. Systems activated for final clean-out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)
361-B-TANK	B Plant	Drainage from B-Plant	Unknown	NM	Interim Stabilization 1985 (1)

Total East Area Inactive facilities 18

LEGEND: DB - Diversion Box

DCRT - Double-Contained Receiver Tank

MT - Manual Tape

SACS - Surveillance Automated Control System

TK - Tank

SMP - Sump

R - Usually denotes replacement

NM - Not Monitored

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

TABLE G-3. WEST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES
INACTIVE - no longer receiving waste transfers
February 28, 1999

MONITOR	?ED
---------	-----

FACILITY	LOCATION	RECEIVED WASTE FROM:	(Gallons)	<u>BY</u>	REMARKS
216-TY-201	E. of TY Farm	Supernate from T-112	Unknown	NM	Isolated
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-S-302	S Farm	240-S-151 DB	8506	SACS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	0	SACS/FIC *	Assumed Leaker TF-EFS-90-042
			* FIC in Intrus	ion mode	Partially filled with grout 2/91, determined
					still assumed leaker after leak test
241-S-302-B	S Farm	S Encasements	Unknown	NM	Isolated 1985 (1)
241-SX-302	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-SX-304	SX Farm	SX-152 Transfer Box, SX-151 DB	Unknown	NM	Isolated 1985 (1)
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	- Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	1600	SACS/MT	New MT installed 7/16/93
241-TX-302B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Unknown	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recupiex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S Farm	Pers. Decon. Facility	Unknown	NM	Isolated
244-U-TK/SMP	U Farm	DCRT - Receives from several farms	Unknown	NM	Not yet in use
244-TXR VAULT	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM ·	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
270-W	SE of U Plant	Condensate from U-221	Unknown	NM	Isolated 1970
361-T-TANK	T Plant	Drainage from T-Plant	Unknown	NM	isolated 1985 (1)
361-U-TANK	U Plant	Drainage from U-Plant	Unknown	NM	Interim Stabilzed, MT removed 1984 (1)

Total West Area inactive facilities 27

LEGEND: DB - Diversion Box. TB - Transfer Box
DCRT - Double-Contained Receiver Tank
TK - Tank
SMP - Sump
R - Usually denotes replacement
FIG - Surface Level Monitoring Device
MT - Manual Tape
O/S - Out of Service
SACS - Surveillance Automated Control System
NM - Not Monitored
ENRAF - Surface Level Monitoring Device

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

APPENDIX H

LEAK VOLUME ESTIMATES

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 5) February 28, 1999

		Date Declared Confirmed or	Volume		Associated KiloCuries		Interim Stabilized	Leak I	Estimate
Tank Number		Assumed Leaker (3)	Gallons (2)(4	<u>)</u>	137 cs (10	<u>)</u>	Date (12)	Updated	Referenc
241-A-103	•	1987	5500	(9)			06/88	1987	(j)
241-A-104	***	1975	500 to 2500		0.8 to 1.8	(q)	09/78	1983	(p)(a)
241-A-105	(1)	1963	10000 to		85 to 760	(b)	07/79	1991	(b)(c)
241-AX-102		1988	3000				09/88	1989	(h)
241-AX-104		1977	•	- (7)		·	08/81	1989	(g)
241-B-101 241-B-103		1974		- (7)		•	03/81	1989	(g)
241-B-103		1978 1978	•	- (7) - (7)			02/85 12/84	1989	(<u>ā</u>)
241-B-107		1980	8000	(9)			03/85	1989 1986	(g) (d)(f)
241-B-110		1981	10000				03/85	1986	(d)
241-B-111		1978	<u> </u>	- (7)			06/85	1989	(g)
241-B-112		1978	2000	(0)			05/85	1989	(g)
241-B-201 241-B-203		1980 1983	1200 300				08/81 06/84	1984	(e) (f)
41-B-204		1984	400				06/84	1986 1989	(d) (g)
41-BX-101		1972		- (7)			09/78	1989	(g)
41-BX-102		1971	70000	•••	50	(1)	11/78	1986	(d)
41-BX-108		1974	2500	4=1	0.5	(1)	07/79	1986	(d)
!41-BX-110 !41-BX-111		1976 1984 (14)		- (7) - (7)			08/85	1989	(g)
41-BY-103		1973	<5000				03/95	1993	(g)(r)
41-BY-103		1973		, · (7)			11/97 N/A	1983 1989	(a)
41-BY-106		1984					N/A N/A	1989	(g) (a)
41-BY-107		1984	15100	(9)	•		07 <i>/</i> 79	1989	(g) (g)
41-BY-108		1972	< 5000				02/85	1983	(a)
41-C-101		1980	20000	(9)(11))		11/83	1986	(d)
41-C-110 41-C-111		1984 1968	2000 5500	(9)			05/95	1989	(g)
	(5)	1988	550	(3)			03/84 03/82	1989 1987	(g) (i)
41-C-202	(5)	1988	450				08/81	1987	ő
41-C-203	(F)	1984	400	(9)			03/82	1986	(d)
	(5)	1988	350				09/82	1987	(i)
41-S-104		1968	24000	(9)			12/84	1989	(g)
41-SX-104 41-SX-107		1988 1964	6000	(9)			N/A	1988	(k)
	(6)(15)	1962	<5000 2400 to		17 to 140		10/79 08/79	1983 1991	(a) (m)(q)(u
			35000		(m)(q)(u)		00,75	1331	(11),(0),(0
41-SX-109	(6)(15)	1965	<10000			(n)(u)	05/81	1992	(n)(u)
41-SX-110	(4.5)	1976	5500				08/79	1989	(g)
	(15) (15)	1974 1969	500 to 2000 30000		0.6 to 2.4	(I)(q)(u)	07/79	1986	(d)(q)(u)
41-SX-113	(13)	1962	15000		40 8	(I)(u) (I)	07/79 11/78	1986 1986	(d)(u) (d)
41-SX-114		1972		(7)	Ū	117	07/79	1989	(g)
41-SX-115		1965	50000		21	(o)	09/78	1992	(ō)
41-T-101		1992	7500				04/93	1992	(p)
41-T-103 41-T-106		1974 1973	<1000		40	m	11/83	1989	(g)
41-T-100		1973	115000	(9) (7)	40	(1)	08/81 05/96	1986 1989	(d) (g)
41-T-108		1974	<1000	(9)			11/78	1980	(ř)
41-T-109		1974	<1000	(9)			12/84	1989	(g)
41-T-111		1979, 1994 (13)	<1000				02/95	1994	(f)(t)
41-TX-105 41-TX-107 ((6)	1977 1984	2500	(7)			04/83 10/79	1989	(g) (d)
41-TX-110	·-,	1977		(7)			04/83	1986 1989	(a) (a)
11-TX-113		1974		(7)			04/83	1989	(g) (g)
11-TX-114		1974	-	(7)			04/83	1989	(g)
\$1-TX-115 \$1-TX-116		1977 1977	**	(7) (7)			09/83 04/83	1989 1989	(g)
11-TX-117		1977	-	(7)			03/83	1989	(g) (g)
11-TY-101		1973	<1000				04/83	1980	(f)
11-TY-103		1973	3000	,	0.7	(1)	02/83	1986	(d)
11-TY-104		1981	1400	(9)			11/83	1986	(d)
41-TY-105		1960	35000	•		(I)	02/83	1986	(d)
11-TY-106		1959	20000			(I) (II)	11/78	1986	(d)
∤1-U-101 ∤1-U-104		1959 1961	30000 55000		20 0.09		09/79 10/78	1986 1998	(d)
- : -W-1U#				(0)			12/84	1986 1986	(d) (d)(q)
i1-U-110		1975	5000 to 8100	(9)	0.05	107	12/0*	1360	IC HEST

N/A = not applicable (not yet interim stabilized)

TABLE H-1. SINGLE-SHELL LEAK VOLUME ESTIMATES (Sheet 2 of 5)

Footnotes:

- (1) Current estimates [see reference(b)] are that 610 Kgallons of cooling water was added to Tank 241-A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with <u>Dangerous Waste Regulations</u> [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 Kgallons to 277 Kgallons) is based on the following (see References):
 - 1. Reference (b) contains an estimate of 5 Kgallons to 15 Kgallons for the initial leak prior to August 1968.
 - 2. Reference (b) contains an estimate of 5 Kgallons to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.
 - 3. Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978 but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
 - 4. Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

	Low Estimate	High Estimate
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	0	232,000
Totals	10,000	277,000

- These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- In many cases, a leak was suspected long before it was identified or confirmed. For example, reference (d) shows that Tank 241-U-104 was suspected of leaking in 1956. The leak was "confirmed" in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, Tank 241-U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," "borderline" and "dormant," were merged into one category now reported as "assumed leaker." See reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) There has been an effort in the past few years to re-evaluate these leak volume estimates; however, the activity is not currently funded.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 3 of 5)

- (5) The leak volume estimate date for these tanks is before the "declared leaker" date because the tank was in a "suspected leaker" or "questionable integrity" status; however, a leak volume had been estimated prior to the tank being reclassified.
- (6) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating a continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations.
- (7) Methods were used to estimate the leak volumes from these 19 tanks based on the <u>assumption</u> that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallons), for an average of approximately 8 Kgallons for each of 19 tanks.
- (8) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (9) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (10) The curie content shown is as listed in the reference document and is <u>not</u> decayed to a consistent date: therefore, a cumulative total is inappropriate.
- Tank 241-C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a "minimum heel" in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See references (q) and (s); refer to reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (12) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (13) Tank T-111 was declared an assumed re-leaker on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (14) Tank BX-111 was declared an assumed re-leaker in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (15) The leak volume and curie release estimates on SX-108, SX-109, SX-111, and SX-112 have been reevaluated using a Historical Leak Model [see reference (u)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology." (This quote is from the first page of the referenced report). Therefore, an uncertainty analysis to determine the applicability of this methodology is currently in progress.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 4 of 5)

References:

- (a) Murthy, K.S., et al, June 1983, Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, Tank 241-A-105 Leak Assessment, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, Tank 241-A-105 Evaporation Estimate 1970 Through 1978, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, Single-Shell Tank Isolation Safety Analysis Report, SD-WM-SAR-006, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, Waste Status Summary, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford, Hanford Engineering Development Laboratory, Richland, Washington.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, Single-Shell Tank Leak Volumes, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, Liquid Level Losses in Tanks 241-C-201, -202 and -204, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R. and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Westinghouse Hanford Company, Richland, Washington.
- (k) Campbell, G. D., July 8, 1988, Internal Memorandum to R. K. Welty, Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (1) ERDA, 1975, Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, Tank 241-SX-108 Leak Assessment, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, Tank 241-SX-109 Leak Assessment, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, Tank 241-SX-115 Leak Assessment, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 5 of 5)

- (p) WHC, 1992d, Occurrence Report, Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC,1990b, A History of the 200 Area Tank Farms, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993, Occurrence Report, Single-Shell Underground Waste Storage Tank 241-BX-111 Surface Level Decrease and Change From Steady State Condition, RL-WHC-TANKFARM-1993-0035, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1993a, Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (t) WHC, 1994, Occurrence Report, Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (u) HNF, 1998, Agnew, S. F. and R. A. Corbin, August 1998, Analysis of SX Farm Leak Histories Historical Leak Model, (HLM), HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico

APPENDIX I

INTERIM STABILIZATION STATUS CONTROLLED, CLEAN, AND STABLE STATUS

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (Sheet 1 of 3) February 28, 1999

	T	Interim	1	***]	Interim	1	**		1	Interim	
Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.		Tank	Tank	Stabil.	Stabil.
Number	Integrity	Date (1)	Method		Number		Date (1)	Method	. 🐰	Number		Date (1)	Method
A-101	SOUND	N/A			C-101	ASMD LKR	11/83	AR	' 🖁	T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/89	SN		C-102	SOUND	09/95	JET		T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	06/88	AR		C-103	SOUND	N/A			T-110	SOUND	N/A	
A-104	ASMD LKR	09/78	AR		C-104	SOUND	09/89	SN		T-111	ASMD LKR	02/95	JET
A-105	ASMD LKR	07/79	AR	×	C-105	SOUND	10/95	AR (5)		T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR		C-106	SOUND	N/A			T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A			C-107	SOUND	09/85	JET	_	T-202	SOUND	08/81	AR
AX-102 AX-103	ASMD LKR SOUND	09/88 08/87	SN		C-108 C-109	SOUND	03/84	AR	- 🎇	T-203	SOUND	04/81	AR
AX-103	ASMD LKR	08/81	AR AR	888 888	C-110	SOUND ASMD LKR	11/83 05/95	JET	- 88	T-204	SOUND	08/81	AR
B-101	ASMD IKR	03/81	SN		C-111	ASMD LKR	03/84	SN	-88	TX-101 TX-102	SOUND	02/84	AR
B-102	SOUND	08/85	SN	***	C-112	SOUND	09/90	AR	- 88	TX-102	SOUND	04/83 08/83	JET JET
B-103	ASMD IKR	02/85	SN		C-201	ASMD LKR	03/82	AR		TX-103	SOUND	09/79	SN
B-104	SOUND	06/85	SN		C-202	ASMD LKR	08/81	AR		TX-105	ASMD LKR	04/83	JET
B-105	ASMD IKR	12/84	AR		C-203	ASMD LKR	03/82	AR		TX-106	SOUND	06/83	JET
B-106	SOUND	03/85	SN		C-204	ASMD LKR	09/82	AR		TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN		S-101	SOUND	N/A	<u> </u>		TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN		S-102	SOUND	N/A			TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN		S-103	SOUND	N/A			TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR		S-104	ASMD LKR	12/84	AR		TX-111	SOUND	04/83	JET
B-111	ASMD LKR	06/85	SN	*	S-105	SOUND	09/88	JET		TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	▩	S-106	SOUND	N/A			TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	8	S-107	SOUND	N/A			TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR	₩	S-108	SOUND	12/96	JET (7)		TX-115	ASMD LKR	09/83	JET
B-203	ASMD LKR	06/84	AR		S-109	SOUND	N/A			TX-116	ASMD LKR	04/83	JET
B-204 BX-101	ASMD LKR ASMD LKR	06/84	AR		S-110	SOUND	01/97	JET (8)		TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	09/78	AR	***	S-111	SOUND	N/A			TX-118	SOUND	04/83	JET
BX-102 BX-103	SOUND	11/78 11/83	AR AR(2)	 	S-112 SX-101	SOUND	N/A	-		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	09/89	SN	 	SX-101	SOUND	N/A N/A			TY-102 TY-103	SOUND ASMD LKR	09/79	AR
BX-105	SOUND	03/81	SN	***	SX-102	SOUND	N/A			TY-103	ASMD LKR	02/83 11/83	JET AR
BX-106	SOUND	07/95	SN	***	SX-104	ASMD LKR	N/A			TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	09/90	JET	*	SX-105	SOUND	N/A			TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	*	SX-106	SOUND	N/A		***	U-101	ASMD LKR	09/79	AR
BX-109	SOUND	09/90	JET		SX-107	ASMD LKR	10/79	AR		U-102	SOUND	N/A	
BX-110	ASMD LKR	08/85	SN (4)	*	SX-108	ASMD LKR	08/79	AR	***	U-103	SOUND	N/A	
BX-111	ASMD LKR	03/95	JET		SX-109	ASMD LKR	05/81	AR		U-104	ASMD LKR	10/78	AR
BX-112	SOUND	09/90	JET		SX-110	ASMD LKR	08/79	AR	*	U-105	SOUND	N/A	
BY-101	SOUND	05/84	JET	*	SX-111	ASMD LKR	07/79	SN	***	U-106	SOUND	N/A	
BY-102	SOUND	04/95	JET		SX-112	ASMD LKR	07/79	AR	***	U-107	SOUND	N/A	
3Y-103	ASMD LKR	11/97	JET(10)		SX-113	ASMD LKR	11/78	AR		U-108	SOUND	N/A	
3Y-104	SOUND	01/85	JET		SX-114	ASMD LKR	07/79	AR		U-109	SOUND	N/A	
3Y-105	ASMD LKR	N/A	2		SX-115	ASMD LKR	09/78	AR		U-110	ASMD LKR	12/84	AR
3Y-106	ASMD LKR	N/A		-	T-101	ASMD LKR	04/93	SN	m	U-111	SOUND	N/A	
3Y-107 3Y-108	ASMD LKR	07/79 02/85	JET	m	T-102 T-103	SOUND	03/.81	AR(2)(3)		U-112	ASMD LKR	09/79	AR
3Y-109	SOUND	07/97	JET(9)	***	T-103	SOUND SOUND	11/83	AR		U-201 U-202	SOUND	08/79	AR
3Y-110	SOUND	01/85	JET (a)		T-105	SOUND	N/A 06/87	AD			SOUND	08/79	SN
3Y-111	SOUND	01/85	JET	ж.	T-106	ASMD LKR	08/81	AR AR	****	U-203 U-204	SOUND	08/79	AR
3Y-112	SOUND	06/84	JET	ж.	T-107	ASMD LKR	05/96	JET	::::::::::::::::::::::::::::::::::::::	V-2V+	300ND	08/79	SN
EGEND:	000110	00,04	ос. _В		1-107	AOIND ERIT	05/30	JET					
	dministratively	interim sta	hilized							Interim St	abilized Tanka	-	119
	JET = Saltwell jet pumped to remove drainable interstitial liquid									terim Stabiliz		30	
	upernate pump	•				w				10111	COMIT WELDING	~~	30
	lot yet interim		· ·							Total S	ingle-Shell T	anks	149
	.KR = Assume						Ì						
		·····							-				

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (sheet 2 of 3)

Footnotes:

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Initially, seven tanks (B-104, B-110, B-111, BX-103, T-102, T-112, and U-110) met the supernatant and interstitial liquid interim stabilization criteria at the time they were stabilized, but did not meet current established interim stabilization criteria.

Since then, tanks B-110, B-111, U-110 were determined to have met current interim stabilization criteria, per WHC-SD-WM-ER-516-REV 0, "Interim Stabilization Status of SSTs B-104, B-110, B-111, T-102, T-112, and U-110," and WHC-SD-WM-ER-518-REV 0, "Investigation of Liquid Intrusion in 241-BX-103," both dated October 5, 1995.

Later, tanks B-104, BX-103, T-102, T-112 were determined to meet current interim stabilization criteria as of September 30, 1996, per memo 9654456, J. H. Wicks to Dr. J. K. McClusky, DOE-RL.

Tank B-202 was determined to no longer meet the current established criteria for 200-series tanks due to a steady increase in the surface level indicating an ongoing intrusion based on a comparison of in-tank videos and subsequent evaluation in March 1996.

- (3) Original Interim Stabilization data are missing on four tanks: B-201, T-102, T-112, and T-201.
- (4) BX-110 was interim stabilized by Supernate Pumping in August 1985. Jet pumping began in December 1993 and soon stopped because of equipment failure. Due to low net volume pumped, major equipment failure, and ALARA, it was decided jet pumping would not resume. An in-tank video was taken in October 1994. Reevaluation after review of the video indicated 1.5 Kgallons of waste was pumped. (Almost 3 Kgallons of water flushes were needed to produce 1.5 Kgallons tank waste.)
- (5) C-105 was interim stabilized administratively on October 30, 1995. No jet pumping occurred in this tank, nor does interstitial liquid level data exist for this tank. There are no diptubes or LOWs installed. Approximately 12 Kgallons of liquid waste was evaporated between May 1993 and October 1995. An in-tank video taken August 30, 1995, revealed a shallow supernatant pool surrounded by a 5-8 foot solids waste shore. The volume of supernate is estimated as 2 Kgallons. The tank currently meets the established criteria for declaring single-shell tanks Interim Stabilized.
- (6) T-107 was interim stabilized by Jet Pumping in May 1996. Pumping was completed in March, and an in-tank video taken in May showed no supernate visible on the surface. The surface has an irregular contour of mostly sludge, and the elevation differences between high and low points appear to be about four inches.
- (7) S-108 was interim stabilized by Jet Pumping in December 1996. Pumping was completed in September and an in-tank video taken in December showed no supernate visible on the surface of the waste, which appears to be saltcake. The video shows a relatively level surface with some caving and crowning. Total waste is 448.7 Kgallons, with drainable liquids 4.0 Kgallons and no pumpable liquids.
- (8) S-110 was interim stabilized by Jet Pumping in January 1997. Pumping was completed in July 1996, and an in-tank video taken in December showed no supernate visible on the surface of the waste, which appears to be saltcake. The level is not consistent and there appears to have been some caving and crowning. Total waste is 389.0 Kgallons, with drainable liquids 29.8 Kgallons and pumpable liquids 23.4 Kgallons.
- (9) BY-109 was interim stabilized by Jet Pumping in July 1997. Pumping was completed in May 1997, and an intank video taken in June indicated there is a relatively uniform, slightly concave, crusty/cracked contour over most of the surface with no visible supernate. Total waste is 290.0 Kgallons, with drainable liquids 36.7 Kgallons, and pumpable liquids 20.3 Kgallons.

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (sheet 3 of 3)

(10) BY-103 was interim stabilized in November 1997, after completion of jet pumping in September. An in-tank video taken in February 1997 showed no visible surface liquid and no evidence of an intrusion. The waste was dry and flaky. Dried, caked waste was suspended from many of the pipes and pieces of process equipment. The overall surface of the waste seemed to slump slightly towards the center of the tank. Total waste is 414 Kgallons, with drainable liquids 38.3 Kgallons, and pumpable liquids 31.9 Kgallons.

TABLE I-2. TRI-PARTY AGREEMENT SINGLE-SHELL TANK INTERIM STABILIZATION SCHEDULE February 28, 1999

As part of the Controlled, Clean, and Stable mission, the Single-Shell Tank Interim Stabilization Project goal is to mitigate the risk to the environment from a leak release from aging SSTs, by removing as much of the drainable liquid as practical, for safe storage prior to full waste retrieval.

New TPA milestones were negotiated effective September 23, 1996, to allow greater flexibility in the sequencing of tanks, in light of the latest technical information regarding tank waste safety status and watch list concerns.

Milestone	Description	Due Date	Actual Date	Comments
M-41-20	Start Interim Stabilization of 4 Single-Shell Tanks	9/30/96	3/24/96	S-108, S-110, T-104, and T-107 started.
M-41-21	Start Interim Stabilization of 2 Single-Shell Tanks	5/31/97 (1)	5/12/97	BY-109 started 9/10/96; T-110 started 5/12/97
M-41-22	Start Interim Stabilization of 6 Single-Shell Tanks	9/30/97 (2)(4)		BY-103 started 9/29/97, SX-104 started 9/26/97
M-41-23	Start Interim Stabilization of 8 Single-Shell Tanks	3/31/98 (3)(4)		
M-41-24	Start Interim Stabilization of 9 Single-Shell Tanks	9/30/98 (4)		,
M-41-25	Start Interim Stabilization of 3 Single-Shell Tanks	3/31/99 (4)		
M-41-26	Start Interim Stabilization of 2 Single-Shell Tanks	9/30/99 (4)		
M-41-27	Complete Saltwell Pumping of Single-Shell Tanks	9/30/00 (4)		
M-41-00	Complete Interim Stabilization of Single-Shell Tanks including Intrusion Prevention	9/30/00 (4)		

- (1) On March 13, 1997, Department of Ecology (Ecology) approved Change Control Form M-41-96-03, extending M-41-21 from March 31 to May 31, 1997.
- (2) Change Control Form M-41-97-01 was sent to Ecology on June 27, 1997; Dispute Resolution invoked on July 16, 1997. This Change Request was denied by the Director of Ecology on February 10, 1998.
- (3) Change Control Form M-41-97-02 was sent to Ecology on December 29, 1997. Dispute Resolution invoked on January 13, 1998. This Change Request was denied by the Director of Ecology on March 10, 1998.
- (4) Path Forward Plan submitted to Ecology on April 15, 1998, projects completion date of September 30, 2004.

TABLE I-3. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY
February 28, 1999

Partial Interim Isolated (PI)	Intrusion Preven	tion Completed (IP)	Interim Stabili	zed (IS)
EAST AREA	EAST AREA	WEST AREA	EAST AREA	WEST AREA
A-101	A-103	S-104	A-102	S-104
A-102	A-104	S-105	A-103	S-105
	A-105		A-104	S-108
AX-101 .	A-106	SX-107	A-105	S-110
		SX-108	A-106	
BY-102	AX-102	SX-109		SX-107
BY-103	AX-103	SX-110	AX-102	SX-108
BY-105	AX-104	SX-111	AX-103	SX-109
BY-106		SX-112	AX-104	SX-110
BY-109	B-FARM - 16 tanks	SX-113		SX-111
	BX-FARM - 12 tanks	SX-114	B-FARM - 16 tanks	SX-112
C-103		SX-115	BX-FARM - 12 tanks	SX-113
C-105	§BY-101			SX-114
C-106	₿BY-104	T-102	EBY-101	SX-115
East Area 11	∰BY-107	T-103	BY-102	•
	BY-108	T-105	BY-103	T-101
WEST AREA	BY-110	T-106	BY-104	T-102
S-101	BY-111	T-108	BY-107	T-103
S-102	BY-112	T-109	BY-108	T-105
S-103		T-112	BY-109	T-106
S-106	C-101	T-201	BY-110	T-107
S-107	≣ C-102	T-202	BY-111	T-108
S-108	ਊC-104	T-203	∦BY-112	T-109
S-109	C-107	T-204		T-111
S-110	C-108	· .	C-101	T-112
S-111	C-109	TX-FARM - 18 tanks	©C-102	T-201
S-112	C-110	TY-FARM - 6 tanks	C-104	T-202
	C-111		C-105	T-203
SX-101	C-112	U-101	C-107	T-204
SX-102	C-201	U-104	C-108	
SX-103	C-202	U-112	C-109	TX-FARM - 18 tanks
SX-104	C-203	U-102	C-110	TY-FARM - 6 tanks
SX-105	C-204	U-202	C-111	
SX-106	East Area 55		C-112	U-101
		U-204	C-201	U-104
T-101		West Area 53 Total 108	C-202	U-110
T-104		Total 108	C-203	U-112
T-107			,	U-201
T-110	Ĭ		East Area 60	U-202
T-111	Controlled, Clean, an	d Stable (CCS)		U-203
11.400	Controlled, Clean, an	id Stable (CCS)		U-204 West Area 59
U-102 U-103	EAST AREA	WEST AREA		Total 119
	BX-FARM - 12 Tanks	TX-FARM - 18 tanks		115
U-105 U-106	DV-LYLIN - 15 ISUVA	TY FARM - 6 tanks	•	
U-106 U-107	East Area was a decent 2 kg			
U-107	The second secon	Total		
U-109	I			
U-110	Note: CCS activities h	ave been deferred		
U-111	until funding is availab		; :	
West Area				
Total				
·			k	

APPENDIX J CHARACTERIZATION PROGRESS STATUS

Hanford Tank 200 West 200 East **Farm Facilities** T-Tank Farm **(1)** (1) (13) (#) 200 East and West (102 (10) Characterization (6) **Progress Status** Vapor Only Done BX-Tank Farm High Priority Tank (Basis Priority) TY-Tank Farm SY-Tank Farm (B) BY-Tank Farm (10) (8) **(#)** 103 (10) No Sample Taken (6) (107) (107) 1 (116) All lanks 75 ft. dia. except 200 series tanks which are 20 ft. dia. @ 55,000 gal TX-Tank Farm 139 Tanks Sampled (Solid, Liquids) (15) B-Tank Farm 25 Tanks Sampled (Vapor Only) 508 Samples Taken ₩₩ (28) (30) (8) (112) 55 Tanks - All Analyses Completed 105 (30) 106 (22) Status as of FEBRUARY 28, 1999 (10) (13) (101 (12) (1) 102 (21) (4) AP-Tank Farm 8 U-Tank Farm 8 8 (6) 8 **6 ® AN-Tank Farm** (1) (6) S-Tank Farm (m) **(19)** (m) C-Tank Farm AZ-Tank Farm **® ® AX-Tank Farm** AY-Tenk Farm SX-Tank Farm (10) (104 (49) **6** 100 **8** (107 (24) (106 (27) (B) (105) (112 (23) (170 (23) AW-Tank Farm (114 (25) A-Tenk Farm Figure J-1 2G95120163.3

J-2=

FIGURE J-1. CHARACTERIZATION PROGRESS STATUS CHART LEGEND (Sheet 2 of 2)

February 28, 1999

200 East/West	The chart divides the two areas.
Tank Farms	Each tank farm is represented by a rough schematic of the tank layout and a heading naming the farm.
Circles	Tanks are depicted by a circle for single-shell tanks and a double circle for double-shell tanks.
Boxes	A thin line box around a tank inside a tank farm denotes "Watch List" status, in concurrence with Table A-1 of this document.
Numbers in Circles	The top number is the tank number. The number in parentheses is a weighted priority number, described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." The numbers can be compared to each other to gain appreciation of relative priority: the higher the number, the greater the priority to sample and analyze.
Underlined Numbers	If a number in parenthesis is underlined, it is denoted as a "Characterization Basis Tank," as described in WHC-SD-WM-TA-164, "Tank Waste Characterization Basis." These are key tanks taken from the priority list that are of principal interest to the Characterization Program.
Circle Shading	The shading in the circle indicates the degree to which sampling and analysis are complete per requirements described in applicable Data Quality Objectives (DQOs). If blank, no characterization sampling has taken place. If fully shaded, the sampling and analysis are complete for each DQO applicable to that tank. Tanks in which characterization has begun but is not complete are designated by being half shaded.
Corner Triangles	Small triangles near a tank circle give further information on half-shaded tanks. Upper left corner triangles indicate that vapor samples have been taken from the tank. Lower left-hand corner triangles indicate that the tank has been sampled, analyzed, and a formal report has been written on the condensed phase sampling. Further status of the tank will be determined after review of the report is complete. Lower right-hand corner triangles indicate that some review has been completed and it has been determined that more sampling is needed to resolve the DQO requirements. Absence of triangles from a half shaded tank indicates recent condensed phase sampling.

This page intentionally left blank

DISTRIBUTION

Number of copies

OFFSITE - USA

2 Congress of the United States

House of Representatives 1111 Longworth Building Washington D.C. 20515-3703

Ron Wyden, Member of Congress, 3rd District

House of Representatives 1431 Longworth House Office Building Washington D. C. 20515

Richard "Doc" Hastings, Member of Congress, 4th District

5 U. S. Department of Energy-Headquarters

1000 Independence Avenue, SW Washington, D. C. 20585

H. Calley EM-38 Cloverleaf Bldg.
Kurt Juroff EM-38 Cloverleaf Bldg.
Kenneth Lang EM-36 Cloverleaf Bldg.
William M. Levitan EM-1 FORS/5A-014
Ralph Lightener EM-38 Cloverleaf Bldg.

U. S. Nuclear Regulatory Commission

Division of Fuel Cycle, Safeguards & Security

Mail Stop T8-A33 Washington, DC 20555

Robert Pierson, Chief

2 Washington State Department of Ecology

Nuclear & Mixed Waste Management Program

P.O. Box 47600

Olympia, WA 98504-7600

Library

Nuclear Waste Program 300 Desmond Drive Lacey, WA 98504

R. Stanley

1 Washington State Department of Health

Radiation Protection 7171 Cleanwater Lane Box 47827 Olympia, WA 98504-7827

Ed Bricker

l <u>Oregon State Department of Energy</u>

625 Marion St. NE Salem, OR 97310

Dirk Dunning

1 Oak Ridge National Laboratory

P. O. Box 2008

Oak Ridge, TN 37831-6180

C. Forsberg

MS-6180

l Los Alamos National Laboratory

P. O. Box 1663

Los Alamos, NM 87545

Stephen Agnew

Group CST-4

MS-J-486

1 <u>Sandia National Laboratories</u>

1515 Eubank, NE P. O. Box 5800

Albuquerque, NM 87185

Scott Slezak, Organization 2161

MS 0716

Donald T. Oakley 9612 Hall Road

Potomac, MD 20854

l Fluor Daniel, Inc.

3353 Michelson Drive Irvine, CA 92698

Charles Divona,

MS-531G

1 Foster-Miller, Inc.

Power Systems Technology Group 350 Second Avenue Waltham, MA 02451-1196

Maureen Williams

1 National Research Council

2101 Constitution Ave, N.W. Washington D. C. 20418

Robert S. Andrews, Senior Staff Officer, MS HA456

1 Government Accountability Project

West Coast Office 1402 Third Avenue, Suite 1215 Seattle, WA 98101

Thomas E. Carpenter, Director

1.	Foster Wheeler Environmental Corp. 3200 George Washington Way, Suite G Richland, WA 99352	
	R. J. Roberts	
. 1	ARES Corporation 636 Jadwin Ave., Suite B Richland, WA 99352	
1	Babad Technical Services 2540 Cordoba Court Richland, WA 99352	
1	Vista Research, Inc. 3000 George Washington Wa Richland, WA 99352	y, Suite 2C
	Phil Ohl	
1	Wastren Inc. 1050 Gilmore Ave, Suite C Richland, WA 99352	
	Gary Dunford	
1	R. K. Welty 409 S. 41st Ave West Richland, WA 99353	
ONSITE		
1	Bechtel Hanford, Inc. J. P. Shearer	H0-20
1	BAT R. T. Winward	A2-22
2	MACTEC - Meier Associate J. D. Bingham M. A.Kufahl	R2-11 R2-11
2	MACTEC - ERS J. F. Bertsch R. G. McCain	B1-42 B1-42
1	MACTEC S. M. Blacker	R3-75
1	General Accounting Office	
	C. R. Abraham	A1-80

2	Washington State Department of Ecology		
	Tony Valero	B5-18	
	Library	B5-18	
	Dictary		
1	U. S. Environmental Protection Agency		
•	D. R. Sherwood	B5-01	
	D. R. Sherwood	155-01	
17	U.S. Department of Energy-Office of River Protect		
	D. C. Bryson	S7-54	
	J. M. Clark	S7-54	
	. J. J. Davis	A0-21	
	R. L. Higgins	S7-53	
	R. D. Hildebrand	H0-12	
	D. H. Irby	S7-54	
	J. E. Kinzer	S7-50	
	C. Pacheco	S7-54	
	T. E. Olds	A7-75	
	S. H. Pfaff	S7-50	
	M. L. Ramsey	S7-54	
	G. W. Rosenwald	\$7-54 \$7-54	
	M. J. Royack	S7-54	
•	A. B. Sidpara	\$7-53 \$7-53	
	<u> </u>		
	R. A. Stolberg	A4-81	
	D. J. Williams	S7-41	
	D. D. Wodrich	A0-21	
	Reading Room	H2-53	
5	Pacific National Northwest Laboratories		
•	S. A. Bryan	P7-25	
	R. E. Gephart	K9-76	
	B. E. Opitz	K6-75	
	R. D. Scheele	P7-25	
	L. A. Smyser	A0-21	
	I. A. billysel	A0-21	
120	Fluor Daniel, Inc., and Affiliated		
	D. I. Allen	R2-50	
	J. J. Badden	S5-07	
	D. G. Baide	S5-05	
	D. B. Bechtold	T6-07	
	L. Bedford	R2-84	
	T. M. Blaak	S5-13	
	H. L. Boston	R2-53	
	V. C. Boyles	R2-11	
	C. B. Bryan	T4-07	
	J. W. Cammann	R2-11	
	R. J. Cash	S7-73	
	W. L. Cowley	R1-49	
	C. Defigh-Price	R2-12	
	D. K. DeFord	S7-24	
	M. P. Delozier	R2-58	
	M. L. Dexter (10)	R1-51	
	W. T. Dixon	R3-01	
	R. A. Dodd	S5-07	
	J. G. Douglas	H3-26	
	A. C. Etheridge	H7-07	
	T. C. Duterrage	est VI	

S. D. Estey	R2-11
K. D. Fowler	R2-11
G. T. Frater	K9-46
J. R. Freeman-Pollard	R2-89
L. A. Gaddis	H5-57
K. A. Gasper	A3-03
T. C. Geer	R1-43
M. S. Gerber	B3-30
B. C. Gooding	T4-01
M. D. Guthrie	S6-72
J. C. Guyette	S7-40
D. B. Hagmann	R2-89
B. K. Hampton	S7-40
B. M. Hanlon (10)	T4-08
G. N. Hanson	S5-07
	R1-56
R. A. Harding	
W.M. Harty Jr.	S5-13
D.C. Hedengren	R2-11
B. A. Higley	R3-73
K. M. Hodgson	R2-11
J. L. Homan	R3-25
S. E. Hulsey	R3-01
M. N. Islam	R1-43
O. M. Jaka	S5-34
P. Jennings	R2-84
R. D. Jensen	B3-53
B. A. Johnson	S5-03
G. D. Johnson	S7-73
T. E. Jones	H0-22
J. Kalia	R1-43
R. A. Kirkbride	R3-73
P. F. Kison	T4-07
N. W. Kirch	R2-11
J. S. Konyu	R4-04
J. G. Kristofzski	S7-01
M. J. Kupfer	R3-75
M. A. Lane	S2-47
M. D. LeClair	R3-75
J. A. Lechelt	R2-11
J. W. Lentsch	S5-07
G. T. MacLean	B4-48
D. J. McCain	R2-12
M. A. McLaughlin	H8-67
W. H. Meader	H8-66
J. M. Morris	R2-84
M. A. Payne	R2-58
R. E. Pohto	R2-84
R. L. Powers	S5-13
R. E. Raymond (2)	T4-08
D. S. Rewinkel	S7-40
C. J. Rice	R2-50
W. E. Ross	S7-84
	H0-34
K. Sathyanarayana	
D. J. Saueressig	S8-05
J. S. Schofield	S7-12
R. E. Schreiber	B2-05
E. B. Schwenk, Jr.	L6-38

N. J. Scott-Proctor	S5-01
J. E. Shapley	B4-46
M. L. Sheriff	S5-07
D. H. Shuford	S7-03
E. R. Siciliano	B4-43
R. R. Thompson	R2-12
A. M. Umek	S7-40
T. B. Veneziano	S7-40
D. T. Vladimiroff	S7-20
J. A. Voogd	R2-53
A. E. Young (6)	R1-10
F. A. Zak	S7-34
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S5-04
Environmental	55-04
Data Mgmt Center (2)	H6-08
Unified Dose Assessment	110-06
Center (UDAC)	A0-20
• •	
Document Processing Center	A3-94